


SOKKIA

CX-52
CX-55

Compact X-ellence Station

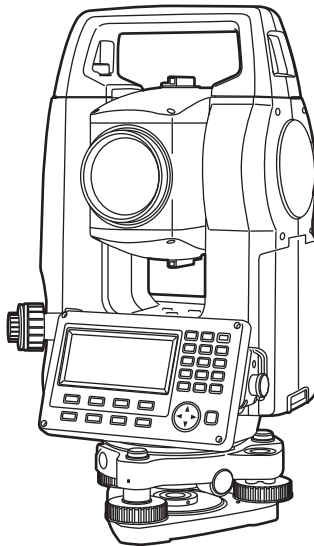

CLASS 3R Laser Product

OPERATOR'S MANUAL

1010291-01-A



Li-ion

CONTAINS Li-ion BATTERY.
MUST BE RECYCLED OR DISPOSED OF PROPERLY.

JSIMA :This is the mark of the Japan Surveying Instruments
Manufacturers Association.

SOKKIA

CX-52 CX-55

Compact X-ellence Station

CLASS 3R Laser Product

OPERATOR'S MANUAL

- Thank you for selecting the CX-52/55.
- Please read this operator's manual carefully before using this product.
- Verify that all equipment is included.
 - ☞ "List of standard components" (separate sheet)
- CX has a function to output data saved in the CX to a connected host computer. Command operations from a host computer can also be performed. For details, refer to "Communication manual" and ask your local dealer.
- The specifications and general appearance of the instrument are subject to change without prior notice and without obligation by TOPCON CORPORATION and may differ from those appearing in this manual.
- The content of this manual is subject to change without notice.
- Some of the diagrams shown in this manual may be simplified for easier understanding.

HOW TO READ THIS MANUAL

Symbols

The following conventions are used in this manual.



: Indicates precautions and important items which should be read before operations.



: Indicates the chapter title to refer to for additional information.



: Indicates supplementary explanation.



: Indicates an explanation for a particular term or operation.

[MEAS] etc. : Indicates softkeys on the display.

{ESC} etc. : Indicates operation keys on the CX.

<S-O> etc. : Indicates screen titles.

Notes regarding manual style

- Except where stated, "CX" means CX-52/55.
- Screens and illustrations appearing in this manual are of CX-52.
- Location of softkeys in screens used in procedures is based on the factory setting. It is possible to change the allocation of softkeys in OBS mode.
- ☞ What are softkeys: "4.1 Parts of the Instrument", Softkeys allocation: "31.3 Allocating Key Functions"
- Learn basic key operations in "5. BASIC OPERATION" before you read each measurement procedure.
- For selecting options and inputting figures, see "5.1 Basic Key Operation".
- Measurement procedures are based on continuous measurement. Some information about procedures when other measurement options are selected can be found in "Note" (Note).
- Ⓡ indicates functions/options not available on all products. Contact your local dealer for availability with your product.
- KODAK is a registered trademark of Eastman Kodak Company.
- All other company and product names featured in this manual are trademarks or registered trademarks of each respective organization.

CONTENTS

1. PRECAUTIONS FOR SAFE OPERATION	1
2. PRECAUTIONS	5
3. LASER SAFETY INFORMATION	9
4. CX FUNCTIONS	11
4.1 Parts of the Instrument	11
4.2 Mode Diagram	14
5. BASIC OPERATION	15
5.1 Basic Key Operation	15
5.2 Display Functions	18
5.3 Star Key Mode	21
6. USING THE BATTERY	22
6.1 Battery Charging	22
6.2 Installing/Removing the Battery	24
7. SETTING UP THE INSTRUMENT	25
7.1 Centering	25
7.2 Levelling	26
8. FOCUSING AND TARGET SIGHTING	29
9. POWER ON/OFF	31
10. ANGLE MEASUREMENT	33
10.1 Measuring the Horizontal Angle between Two Points (Horizontal Angle 0°)	33
10.2 Setting the Horizontal Angle to a Required Value (Horizontal Angle Hold)	34
10.3 Angle Measurement and Outputting the Data	36
11. DISTANCE MEASUREMENT	37
11.1 Returned Signal Checking	38
11.2 Distance and Angle Measurement	39
11.3 Recalling the Measured Data	40
11.4 Distance Measurement and Outputting the Data	41
11.5 Coordinate Measurement and Outputting the Data	42
11.6 REM Measurement	44
12. SETTING INSTRUMENT STATION	47
12.1 Entering Instrument Station Data and Azimuth Angle	48
12.2 Setting Instrument Station Coordinate with resection measurement	55
13. COORDINATE MEASUREMENT	68
14. SETTING-OUT MEASUREMENT	71
14.1 Coordinates Setting-out Measurement	72
14.2 Distance Setting-out Measurement	75
14.3 REM Setting-out Measurement	78
15. SETTING-OUT LINE	80
15.1 Defining Baseline	80
15.2 Setting-out Line Point	85

CONTENTS

15.3 Setting-out Line Line	88
16. SETTING-OUT ARC	91
16.1 Defining an Arc	91
16.2 Setting-out Arc	98
17. POINT PROJECTION	102
17.1 Defining Baseline	102
17.2 Point Projection	103
18. TOPOGRAPHY OBSERVATION	105
18.1 Observation Setting	106
18.2 Observation	109
19. OFFSET MEASUREMENT	113
19.1 Single-distance Offset Measurement	113
19.2 Angle Offset Measurement	115
19.3 Two-distance Offset Measurement	117
19.4 Plane Offset Measurement	120
19.5 Column Offset Measurement	122
20. MISSING LINE MEASUREMENT	124
20.1 Measuring the Distance between 2 or more Points	124
20.2 Changing the Starting Point	129
21. SURFACE AREA CALCULATION	131
22. INTERSECTIONS	135
23. TRAVERSE ADJUSTMENT	139
24. ROUTE SURVEYING	148
24.1 Instrument Station Settings	148
24.2 Straight Line Calculation	149
24.3 Circular Curve Calculation	151
24.4 Spiral Curve	154
24.5 Parabola	160
24.6 3 Point Calculation	164
24.7 Intersection Angle/Azimuth Angle Calculation	167
24.8 Route Calculation	169
25. CROSS SECTION SURVEY	184
26. Point to Line MEASUREMENT	190
27. RECORDING DATA - TOPO MENU -	193
27.1 Recording Instrument Station Data	193
27.2 Recording Backsight Point	195
27.3 Recording Angle Measurement Data	198
27.4 Recording Distance Measurement Data	199
27.5 Recording Coordinate Data	200
27.6 Recording Distance and Coordinate Data	202
27.7 Recording Notes	203
27.8 Reviewing JOB Data	204

27.9 Deleting Recorded JOB Data	206
28. SELECTING/DELETING A JOB	208
28.1 Selecting a JOB	208
28.2 Deleting a JOB	211
29. REGISTERING/DELETING DATA	212
29.1 Registering/Deleting Known Point Data	212
29.2 Reviewing Known Point Data	216
29.3 Registering/Deleting Codes	217
29.4 Reviewing Codes	219
30. OUTPUTTING JOB DATA	220
30.1 Outputting JOB Data to Host Computer	220
31. CHANGING THE SETTINGS	224
31.1 Configuration -Config Mode-	224
31.2 EDM Settings	231
31.3 Allocating Key Functions	235
31.4 Changing Password	239
31.5 Restoring Default Settings	240
32. WARNING AND ERROR MESSAGES	241
33. CHECKS AND ADJUSTMENTS	246
33.1 Circular Level	246
33.2 Tilt Sensor	247
33.3 Collimation	250
33.4 Reticle	251
33.5 Optical Plummet	254
33.6 Additive Distance Constant	256
34. STANDARD EQUIPMENT AND OPTIONAL ACCESSORIES	258
34.1 Standard equipment	258
34.2 Optional accessories	258
34.3 Target system	260
34.4 Power supplies	262
35. SPECIFICATIONS	263
36. EXPLANATION	268
36.1 Manually Indexing the Vertical Circle by Face 1, Face 2 Measurement	268
36.2 Correction for refraction and earth curvature	270
37. REGULATIONS	271

1. PRECAUTIONS FOR SAFE OPERATION

For the safe use of the product and prevention of injury to operators and other persons as well as prevention of property damage, items which should be observed are indicated by an exclamation point within a triangle used with WARNING and CAUTION statements in this operator's manual.

The definitions of the indications are listed below. Be sure you understand them before reading the manual's main text.

Definition of Indication



WARNING

Ignoring this indication and making an operation error could possibly result in death or serious injury to the operator.



CAUTION

Ignoring this indication and making an operation error could possibly result in minor injury or property damage.



This symbol indicates items for which caution (hazard warnings inclusive) is urged. Specific details are printed in or near the symbol.



This symbol indicates items which are prohibited. Specific details are printed in or near the symbol.









This symbol indicates items which must always be performed. Specific details are printed in or near the symbol.






1. PRECAUTIONS FOR SAFE OPERATION

General

Warning












-  Do not use the unit in areas exposed to high amounts of dust or ash, in areas where there is inadequate ventilation, or near combustible materials. An explosion could occur.
-  Do not perform disassembly or rebuilding. Fire, electric shock, burns or hazardous radiation exposure could result.
-  Never look at the sun through the telescope. Loss of eyesight could result.
-  Do not look at reflected sunlight from a prism or other reflecting object through the telescope. Loss of eyesight could result.
- Direct viewing of the sun using the telescope during sun observation will cause loss of eyesight. Use solar filter (optional accessory) for sun observation.
 "34.2 Optional accessories"
-  When securing the instrument in the carrying case make sure that all catches, including the side catches, are closed. Failure to do so could result in the instrument falling out while being carried, causing injury.

Caution


-  Do not use the carrying case as a footstool. The case is slippery and unstable so a person could slip and fall off it.
-  Do not place the instrument in a case with a damaged catch, belt or handle. The case or instrument could be dropped and cause injury.
-  Do not wield or throw the plumb bob. A person could be injured if struck.
-  Secure handle to main unit with locking screws. Failure to properly secure the handle could result in the unit falling off while being carried, causing injury.
-  Tighten the adjustment tribrach clamp securely. Failure to properly secure the clamp could result in the tribrach falling off while being carried, causing injury.

Power Supply

Warning

-  Do not place articles such as clothing on the battery charger while charging batteries. Sparks could be induced, leading to fire.
-  Do not use batteries other than those designated. An explosion could occur, or abnormal heat generated, leading to fire.
-  Do not use voltage other than the specified power supply voltage. Fire or electrical shock could result.
-  Do not use damaged power cords, plugs or loose outlets. Fire or electric shock could result.
-  Do not use power cords other than those designated. Fire could result.
-  Use only the specified battery charger to recharge batteries. Other chargers may be of different voltage rating or polarity, causing sparking which could lead to fire or burns.
-  Do not use the battery or charger for any other equipment or purpose. Fire or burns caused by ignition could result.
-  Do not heat or throw batteries into fire. An explosion could occur, resulting in injury.
-  To prevent shorting of the battery in storage, apply insulating tape or equivalent to the terminals. Otherwise shorting could occur resulting in fire or burns.
-  Do not use batteries or the battery charger if wet. Resultant shorting could lead to fire or burns.
-  Do not connect or disconnect power supply plugs with wet hands. Electric shock could result.






Caution

-  Do not touch liquid leaking from batteries. Harmful chemicals could cause burns or blisters.

1. PRECAUTIONS FOR SAFE OPERATION

Tripod

Caution

-  When mounting the instrument to the tripod, tighten the centering screw securely. Failure to tighten the screw properly could result in the instrument falling off the tripod, causing injury.
-  Tighten securely the leg fixing screws of the tripod on which the instrument is mounted. Failure to tighten the screws could result in the tripod collapsing, causing injury.
-  Do not carry the tripod with the tripod shoes pointed at other persons. A person could be injured if struck by the tripod shoes.
-  Keep hands and feet away from the tripod shoes when fixing the tripod in the ground. A hand or foot stab wound could result.
-  Tighten the leg fixing screws securely before carrying the tripod. Failure to tighten the screws could lead to the tripod legs extending, causing injury.

2. PRECAUTIONS

Charging Battery


- Be sure to charge the battery within the charging temperature range.
Charging temperature range: 0 to 40°C

Warranty policy for Battery

- Battery is an expendable item. The decline in retained capacity depending on the repeated charging/discharging cycle is out of warranty.

Tribrach Clamp

- When the instrument is shipped, the tribrach clamp is held firmly in place with a locking screw to prevent the instrument from shifting on the tribrachs. Before using the instrument the first time, loosen this screw with a screwdriver. And before transporting it, tighten the locking screw to fasten the tribrach clamp in place so that it will not shift on the tribrachs.

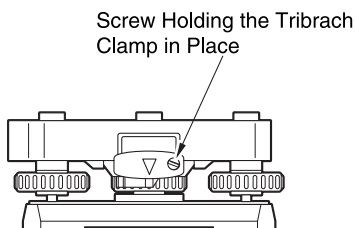

Precautions concerning water and dust resistance

CX conforms to IP66 specifications for waterproofing and dust resistance when the battery cover is closed and connector caps are attached correctly.

- Be sure to close the battery cover and correctly attach the connector caps to protect the CX from moisture and dust particles.
- Make sure that moisture or dust particles do not come in contact with the inside of the battery cover, terminal or connectors. Contact with these parts may cause damage to the instrument.
- Make sure that the inside of the carrying case and the instrument are dry before closing the case. If moisture is trapped inside the case, it may cause the instrument to rust.
- Do not press the speaker hole using something with a pointed tip. Doing so will damage an internal waterproof sheet, resulting in a degraded waterproof property.
- If there is a crack or deformation in the rubber packing for the battery cover, stop using and replace the packing.
- To retain the waterproof property, it is recommended that you replace the rubber packing once every two years. To replace the packing, contact your local dealer.

2. PRECAUTIONS

The Lithium Battery

- The lithium battery is used to maintain the CX Calendar & Clock function. It can back up data for approximately 5 years of normal use and storage (Temperature = 20°, humidity = about 50%), but its lifetime may be shorter depending on circumstances.


Vertical and horizontal clamps

- Always fully release the vertical/horizontal clamps when rotating the instrument or telescope. Rotating with clamp(s) partially applied may adversely affect accuracy.

Backing up data

- Data should be backed up (transferred to an external device etc.) on a regular basis to prevent data loss.

Other precautions

- If the CX is moved from a warm place to an extremely cold place, internal parts may contract and make the keys difficult to operate. This is caused by cold air trapped inside the hermetically sealed casing. If the keys do not depress, open the battery cover to resume normal functionality. To prevent the keys from becoming stiff, remove the connector caps before moving the CX to a cold place.
- Never place the CX directly on the ground. Sand or dust may cause damage to the screw holes or the centering screw on the base plate.
- Do not aim the telescope directly at the sun. Also, attach the lens cap to the telescope when not in use. Use the Solar filter to avoid causing internal damage to the instrument when observing the sun.
 "34.2 Optional accessories"
- Protect the CX from heavy shocks or vibration.
- Never carry the CX on the tripod to another site.
- Turn the power off before removing the battery.
- When placing the CX in its case, first remove its battery and place it in the case in accordance with the layout plan.
- Consult your local dealer before using the instrument under special conditions such as long periods of continuous use or high levels of humidity. In general, special conditions are treated as being outside the scope of the product warranty.

Maintenance

- Always clean the instrument before returning it to the case. The lens requires special care. First, dust it off with the lens brush to remove tiny particles. Then, after providing a little condensation by breathing on the lens, wipe it with the wiping cloth.
- If the display unit is dirty, carefully wipe it with a soft, dry cloth. To clean other parts of the instrument or the carrying case, lightly moisten a soft cloth in a mild detergent solution. Wring out excess water until the cloth is slightly damp, then carefully wipe the surface of the unit. Do not use any alkaline cleaning solutions, alcohol, or any other organic solvents, on the instrument or display unit.
- Store the CX in a dry room where the temperature remains fairly constant.
- Check the tripod for loose fit and loose screws.
- If any trouble is found on the rotatable portion, screws or optical parts (e.g. lens), contact your local dealer.
- When the instrument is not used for a long time, check it at least once every 3 months.

"33. CHECKS AND ADJUSTMENTS"

- When removing the CX from the carrying case, never pull it out by force. The empty carrying case should be closed to protect it from moisture.
- Check the CX for proper adjustment periodically to maintain the instrument accuracy.

Exporting this product (Relating EAR)

- This product is equipped with the parts/units, and contains software/technology, which are subject to the EAR (Export Administration Regulations). Depending on countries you wish to export or bring the product to, a US export license may be required. In such a case, it is your responsibility to obtain the license. The countries requiring the license as of May 2013 are shown below. Please consult the Export Administration Regulations as they are subject to change.

North Korea

Iran

Syria

Sudan

Cuba

URL for the EAR of the US: <http://www.bis.doc.gov/policiesandregulations/ear/index.htm>

2. PRECAUTIONS

Exceptions from responsibility

- The user of this product is expected to follow all operating instructions and make periodic checks (hardware only) of the product's performance.
- The manufacturer, or its representatives, assumes no responsibility for results of faulty or intentional usage or misuse including any direct, indirect, consequential damage, or loss of profits.
- The manufacturer, or its representatives, assumes no responsibility for consequential damage, or loss of profits due to any natural disaster, (earthquake, storms, floods etc.), fire, accident, or an act of a third party and/or usage under unusual conditions.
- The manufacturer, or its representatives, assumes no responsibility for any damage (change of data, loss of data, loss of profits, an interruption of business etc.) caused by use of the product or an unusable product.
- The manufacturer, or its representatives, assumes no responsibility for any damage, and loss of profits caused by usage different to that explained in the operator's manual.
- The manufacturer, or its representatives, assumes no responsibility for damage caused by incorrect operation, or action resulting from connecting to other products.

3. LASER SAFETY INFORMATION

CX is classified as the following class of Laser Product according to IEC Standard Publication 60825-1 Ed.3.0: 2014 and United States Government Code of Federal Regulation FDA CDRH 21CFR Part 1040.10 and 1040.11 (Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No.50, dated June 24, 2007.)


Device		Laser class
EDM device in objective lens	Light beam used for measurement (When reflectorless measurement is selected in Config mode)	Class 3R
	Light beam used for measurement (When prism or reflective sheet is selected as target in Config mode)	Class 1
	Laser-pointer	Class 3R



- EDM device is classified as Class 3R Laser Product when reflectorless measurement is selected. When the prism or reflective sheet is selected in Config mode as target, the output is equivalent to the safer class 1.

Warning


- Use of controls or adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.
- Follow the safety instructions on the labels attached to the instrument as well as in this manual to ensure safe use of this laser product.

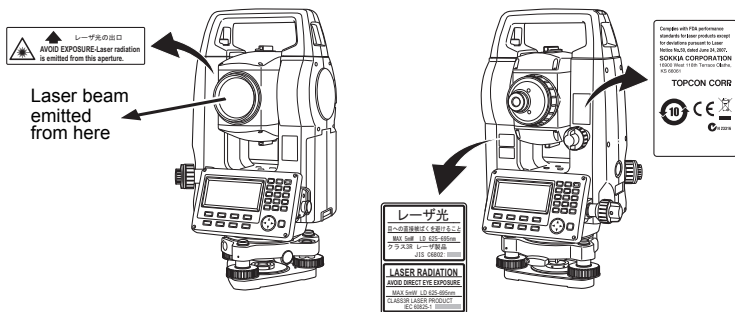

3. LASER SAFETY INFORMATION


- Never intentionally point the laser beam at another person. The laser beam is injurious to the eyes and skin. If an eye injury is caused by exposure to the laser beam, seek immediate medical attention from a licensed ophthalmologist.
- Do not look directly into the laser beam. Doing so could cause permanent eye damage.
- Do not stare at the laser beam. Doing so could cause permanent eye damage.
- Never look at the laser beam through a telescope, binoculars or other optical instruments. Doing so could cause permanent eye damage.
- Sight targets so that laser beam does not stray from them.

Caution


- Perform checks at start of work and periodic checks and adjustments with the laser beam emitted under normal conditions.
- When the instrument is not being used, turn off the power.
- When disposing of the instrument, destroy the battery connector so that the laser beam cannot be emitted.
- Operate the instrument with due caution to avoid injuries that may be caused by the laser beam unintentionally striking a person in the eye. Avoid setting the instrument at heights at which the path of the laser beam may strike pedestrians or drivers at head height.
- Never point the laser beam at mirrors, windows or surfaces that are highly reflective. The reflected laser beam could cause serious injury.
- When using the Laser-pointer function, be sure to turn OFF the output laser after distance measurement is completed. Even if distance measurement is canceled, the Laser-pointer function is still operating and the laser beam continues to be emitted. (After turning ON the Laser-pointer, the laser beam is emitted for 5 minutes, and then automatically switches OFF. But in the Status screen and when target symbol (ex. ) is not displayed in the OBS mode, the laser beam is not automatically turned off.)
- Only those who have been received training as per the following items shall use this product.
 - Read the Operator's manual for usage procedures for this product.
 - Hazardous protection procedures (read this chapter).
 - Requisite protective gear (read this chapter).
 - Accident reporting procedures (stipulate procedures beforehand for transporting the injured and contacting physicians in case there are laser induced injuries).
- Persons working within the range of the laser beam are advised to wear eye protection which corresponds to the laser wavelength of the instrument being used.
- Areas in which the laser is used should be posted with a standard laser warning sign.

4. CX FUNCTIONS

4.1 Parts of the Instrument

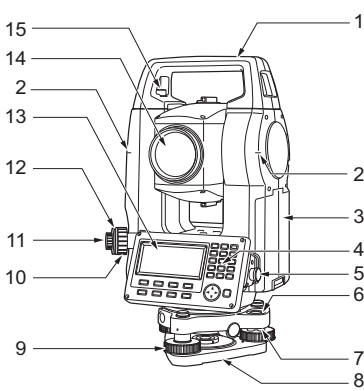

- 1 Handle
- 2 Instrument height mark
- 3 Battery cover
- 4 Operation panel
- 5 Serial connector
- 6 Circular level
- 7 Circular level adjusting screws
- 8 Base plate
- 9 Levelling foot screw
- 10 Optical plummet focussing ring
- 11 Optical plummet eyepiece
- 12 Optical plummet reticle cover
- 13 Display unit
- 14 Objective lens
(Includes Laser-pointer function)

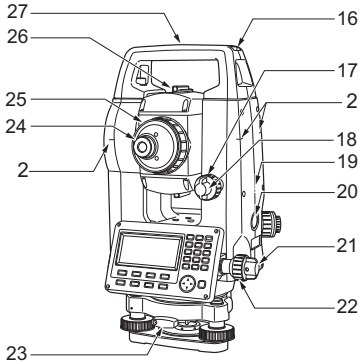

- 15 Handle locking screw
- 16 Tubular compass slot
- 17 Vertical fine motion screw
- 18 Vertical clamp
- 19 Speaker
- 20 Trigger key
- 21 Horizontal clamp
- 22 Horizontal fine motion screw
- 23 Tribrach clamp
- 24 Telescope eyepiece screw
- 25 Telescope focussing ring
- 26 Sighting collimator
- 27 Instrument center mark

4. CX FUNCTIONS



Sighting collimator

Use sighting collimator to aim the CX in the direction of the measurement point. Turn the instrument until the triangle in the sighting collimator is aligned with the target.



Instrument height mark

The height of the CX is as follows:

- 192.5mm (from tribrach mounting surface to this mark)
- 236mm (from tribrach dish (TR-102) to this mark)

"Instrument height" is input when setting instrument station data and is the height from the measuring point (where CX is mounted) to this mark.



Trigger Key

Press the trigger key when the CX is in the OBS mode or when **[MEAS]/[STOP]** is indicated on the display unit. You can start/stop measurement. In the screen displaying **[AUTO]**, press trigger key to perform automatic operation from distance measurement to recording.



Laser-pointer Function


A target can be sighted with a red laser beam in dark locations without the use of the telescope.



Independent Angle Calibration System (IACS) technology

(CX-52 only)


This revolutionary technology provides an even higher level of stability and reliability for angle measurement. With IACS technology, the instrument independently calibrates angle to a high degree of accuracy, and eliminates the need for a reference standard instrument when performing calibration.

 Independent angle calibration cannot be performed by the user.

Consult your local dealer.


Operation panel

☞ "5.1 Basic Key Operation"

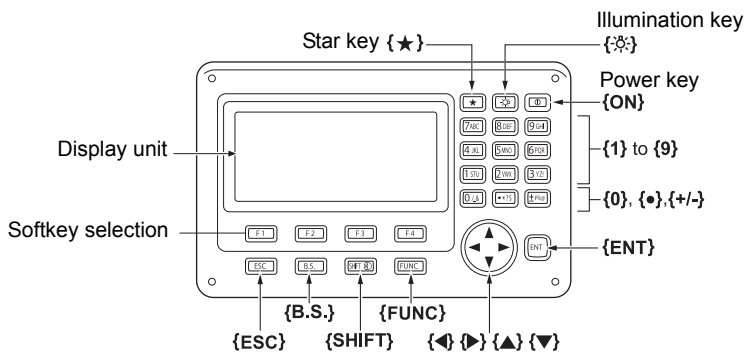


Handle

The handle can be removed from the instrument. To remove it, loosen the handle locking screw.

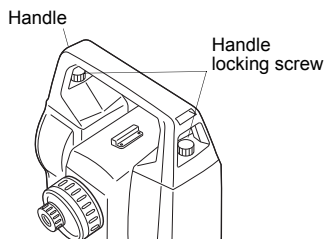


4.2 Mode Diagram

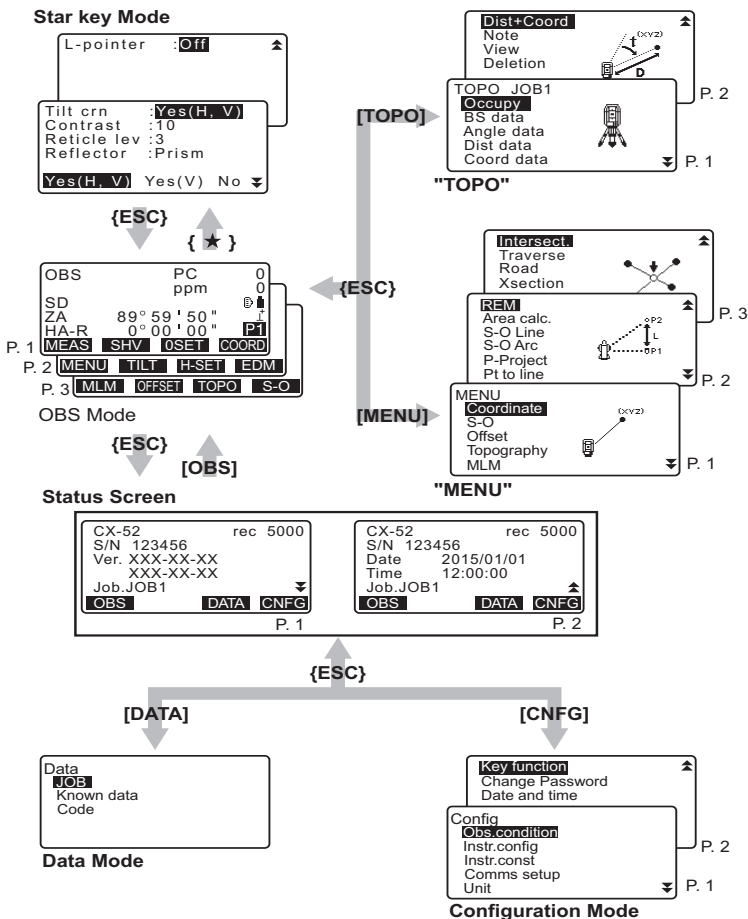

5. BASIC OPERATION

5.1 Basic Key Operation


Learn basic key operations here before you read each measurement procedure.

 Location of operation keys on the panel: "4.1 Parts of the Instrument"


● Power ON / OFF


{ON}	Power On
{ON} (Press and hold: About 1 second)	Power Off


● Lighting up the display unit and key

	Switch the screen/key backlight and Reticle illumination On / Off
----------------------------------------------------------------------------------	-------------------------------------------------------------------


● Switching target type

Target type can be switched only on the screen where the target symbol (ex. ) is displayed.


{SHIFT} 	Switches between target types (Prism/Sheet/N-Prism (reflectorless))
-------------------------------------------------------------------------------------------	---------------------------------------------------------------------

 Target symbol displayed: "5.2 Display Functions", Switching between target types in the Star Key mode: "5.3 Star Key Mode", Switching the target type in Config mode: "31.2 EDM Settings"

● Switching the Laser-pointer ON/OFF

 (Press and hold)	To turn the laser-pointer ON/OFF, press and hold until a beep sounds.
----------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------

Note

- After turning ON the laser-pointer, the laser beam is emitted for 5 minutes, and then automatically switches OFF. But in the Status screen and when target symbol (ex. ) is not displayed in the OBS mode, the laser beam is not automatically turned off.

5. BASIC OPERATION

● Softkey operation

Softkeys are displayed on the bottom line of the screen.

{F1} to {F4}	Select the function matching the softkeys
{FUNC}	Toggle between OBS mode screen pages (when more than 4 softkeys are allocated)


● Inputting letters/figures

{SHIFT}	Switch between numeric and alphabetic characters.
{0} to {9}	During numeric input, input number of the key. During alphabetic input, input the characters displayed above the key in the order they are listed.
{.}/{±}	Input a decimal point/plus or minus sign during numeric input. During alphabetic input, input the characters displayed above the key in the order they are listed.
{◀}/{▶}	Right and left cursor/Select other option.
{ESC}	Cancel the input data.
{B.S.}	Delete a character on the left.
{ENT}	Select/accept input word/value.

Example: Entering "JOB M" in the JOB name field

1. Press **{SHIFT}** to enter the alphabet input mode
Alphabet input mode is indicated by an "A" on the right of the screen.
2. Press **{4}**.
"J" is displayed.
3. Press **{5}** three times.
"O" is displayed.
4. Press **{7}** twice.
"B" is displayed.
5. Press **{▶}** twice.
Input a blank space.

6. Press **{5}** once.
"M" is displayed. Press **{ENT}** to complete inputting.

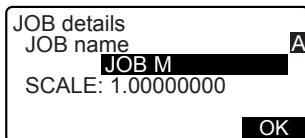


● Selecting options

{▲}/▼	Up and down cursor
▶/◀	Right and left cursor/Select other option
{ENT}	Accept the option

Example: Select a reflector type

1. Press **[EDM]** in page 2 of OBS mode.
2. Move to "Reflector" using **{▲}/▼**.
3. Display the option you want to select using **▶/◀**.
Switches between "Prism", "Sheet" and "N-prism."

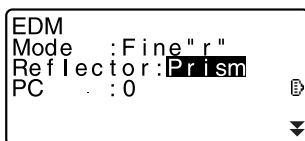

4. Press **{ENT}** or **▼** to move to the next option.
The selection is set and you can set the next item.

● Switching modes

[★]	From OBS mode (Observation Mode) to Star Key Mode
[CNFG]	From Status mode to Config Mode (Configuration Mode)
[OBS]	From Status mode to OBS mode (Observation Mode)
[DATA]	From Status mode to Data Mode
{ESC}	Return to the Status mode from each Mode


"4.2 Mode Diagram"

● Other operation


{ESC}	Return to the previous screen
--------------	-------------------------------

5.2 Display Functions


Status screen

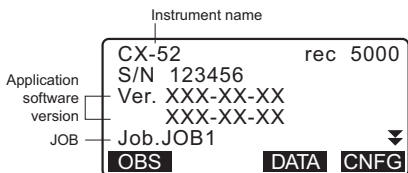


OBS mode screen

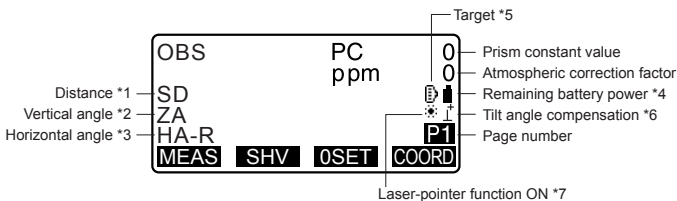

Measuring screen

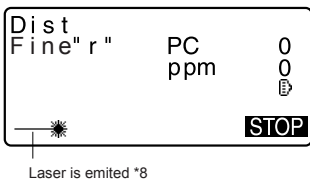

Input screen

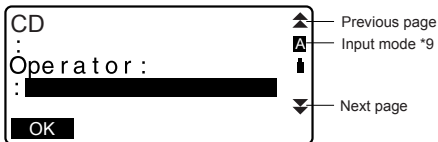

* 1 Distance


☞ Switching distance display status: "31.1 Configuration -Config Mode-"

SD: Slope distance

HD: Horizontal distance

VD: Height difference

* 2 Vertical angle

-  Switching vertical angle display status: "31.1 Configuration -Config Mode-"
 ZA: Zenith angle (Z=0)
 VA: Vertical angle (H=0/H=±90)

To switch vertical angle/slope in %, press **[ZA/%]**






* 3 Horizontal angle


- Press **[R/L]** to switch the display status.
 HA-R: Horizontal angle right
 HA-L: Horizontal angle left

* 1,2,3

To switch usual "SD, ZA, HA-R" display to "SD, HD, VD", press **[SHV]**.




* 4 Remaining battery power (Temperature=25°C, EDM on)

Using BDC46C	Battery level
	level 3 Full power
	level 2 Plenty of power remains.
	level 1 Half or less power remains.
	level 0 Little power remains. Charge the battery.
 (This symbol is displayed every 3 seconds)	No power remains. Stop the measurement and charge the battery.

 "6.1 Battery Charging"


*5 Target display

 Press **{SHIFT}** to switch the selected target. This key function can be used only on the screens on which the target symbol is displayed.

-  :prism
 :reflective sheet
 :reflectorless

* 6 Tilt angle compensation


When this symbol is displayed, the vertical and horizontal angles are automatically compensated for small tilt errors using 2-axis tilt sensor.

 Tilt compensation setting: "31.1 Configuration -Config Mode-"

5. BASIC OPERATION


*7 Laser-pointer display


 Switching Laser-pointer ON/OFF: "5.1 Basic Key Operation"


 :Laser-pointer is ON

*8 Appears when laser beam is emitted for distance measurement

*9 Input mode

 :Inputting capital letters and figures.



 :Inputting small letters and figures.

 :Inputting numbers.

5.3 Star Key Mode

Pressing the Star key {★} displays the Star Key menu.

In the Star Key mode, you can change the setting commonly used for measuring.

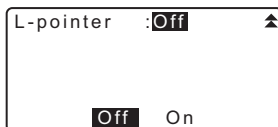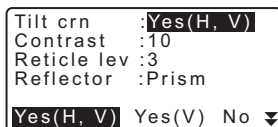

The following operations and settings can be made in the Star Key mode

1. Turning ON/OFF tilt angle correction
2. Adjusting the display unit's contrast (Steps 0~15)
3. Adjusting reticle illumination level (Steps 0~5)
4. Switching the target type
5. Turning ON/OFF laser pointer

* The Star Key mode can be called only from the OBS mode.

6. USING THE BATTERY

6.1 Battery Charging

The battery has not been charged at the factory.



- The charger will become rather hot during use. This is normal.
- Do not use to charge batteries other than those specified.
- The charger is for indoor use only. Do not use outdoors.
- Batteries cannot be charged, even when the charging lamp is flashing, when the temperature is outside the charging temperature range.
- Do not charge the battery just after charging is completed. Battery performance may decline.
- Remove batteries from the charger before putting into storage.
- When not in use, disconnect the power cable plug from the wall outlet.
- Store the battery in a dry room where the temperature is within the following ranges. For long-term storage, the battery should be charged at least once every six months.

Storage period	Temperature range
1 week or less	-20 to 50°C
1 week to 1 month	-20 to 45°C
1 month to 6 months	-20 to 40°C
6 months to 1 year	-20 to 35°C

- Batteries generate power using a chemical reaction and as a result have a limited lifetime. Even when in storage and not used for long periods, battery capacity deteriorates with the passage of time. This may result in the operating time of the battery shortening despite having been charged correctly. In this event, a new battery is required.

PROCEDURE

1. Connect the power cable to the charger and plug the charger into the wall outlet.



2. Mount the battery in the charger by matching the grooves on the battery with the guides on the charger.

When charging starts, the lamp starts blinking.

3. Charging takes approximately 2.5 hours (25°C).

The lamp lights when charging is finished.

4. Remove the battery and unplug the charger.

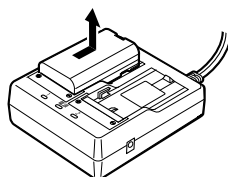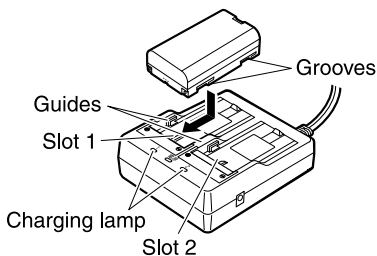

Note

- Slots 1 and 2: The charger starts charging the battery mounted first. If you place two batteries in the charger, the battery in slot 1 is charged first, and then the battery in slot 2. (step 2)
- Charging lamp: The charging lamp is off when the charger is outside the charging temperature range or when the battery is mounted incorrectly. If the lamp is still off after the charger falls within its charging temperature range and the battery is mounted again, contact your local dealer. (steps 2 and 3)
- Charging time: BDC46C: about 2.5 hours (at 25°C)
(Charging can take longer than the times stated above when temperatures are either especially high or low).

6.2 Installing/Removing the Battery


Mount the charged battery.




- Use the provided battery BDC46C for this instrument.
- When removing the battery, turn the power off.
- When installing/removing the battery, make sure that moisture or dust particles do not come in contact with the inside of the instrument.
- Waterproofing property for this instrument is not secured unless the battery cover is closed, and the connector caps are correctly attached. Do not use it with these open or loose, under the condition where water or other liquid spills over the instrument.

PROCEDURE

1. Open the cover while pressing the button on the battery cover.

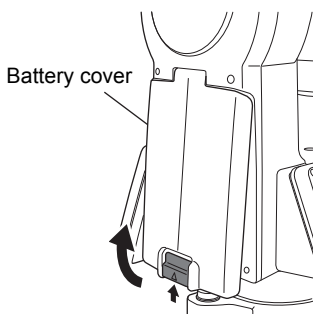

2. Insert the battery with the arrow shown on it downward while pressing toward the instrument.

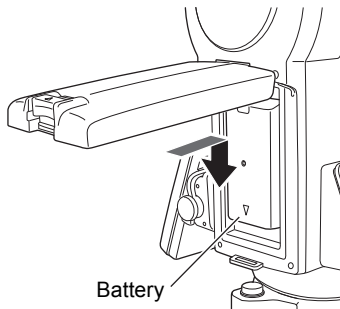

- Inserting the battery aslant may damage the instrument or the battery terminal.
3. Close the cover. Listen for the click to ensure that the cover is properly closed.

7. SETTING UP THE INSTRUMENT




- Mount the battery in the instrument before performing this operation because the instrument will tilt slightly if the battery is mounted after levelling.

7.1 Centering

PROCEDURE Centering with the optical plummet eyepiece


1. Make sure the legs are spaced at equal intervals and the head is approximately level.

Set the tripod so that the head is positioned over the survey point. Make sure the tripod shoes are firmly fixed in the ground.

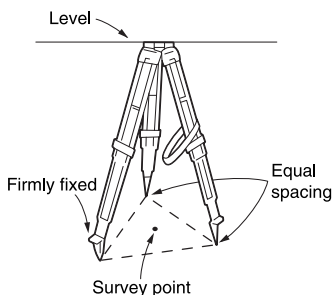

2. Place the instrument on the tripod head.

Supporting it with one hand, tighten the centering screw on the bottom of the unit to make sure it is secured to the tripod.

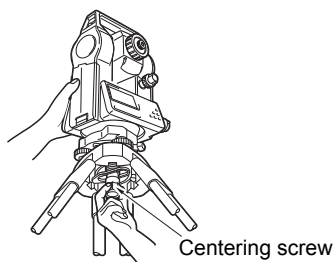

3. Looking through the optical plummet eyepiece, turn the optical plummet eyepiece to focus on the reticle.

Turn the optical plummet focussing ring to focus on the survey point.

 
Focussing on the survey point

Focussing on the reticle



7. SETTING UP THE INSTRUMENT

- Adjust the levelling foot screws to center the survey point in the optical plummet reticle.




- Continue to the levelling procedure.

"7.2 Levelling"

7.2 Levelling

PROCEDURE

- Perform the centering procedure.
 "7.1 Centering"
- Center the bubble in the circular level by either shortening the tripod leg closest to the offcenter direction of the bubble or by lengthening the tripod leg farthest from the offcenter direction of the bubble. Adjust one more tripod leg to center the bubble.

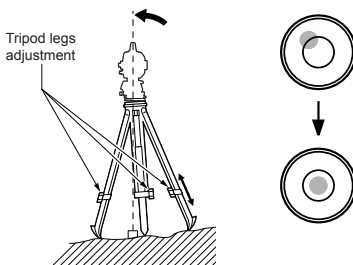


Turn the levelling foot screws while checking the circular level until the bubble is centered in the center circle.

- Press **{ON}** to power on
 "9. POWER ON/OFF"
- The circular level is displayed on the screen.
 - "●" indicates bubble in circular level. The range of the inside circle is $\pm 4'$ and the range of the outside circle is $\pm 6'$. Tilt angle values X and Y are also displayed on the screen.

7. SETTING UP THE INSTRUMENT


- “●” is not displayed when the tilt of the instrument exceeds the detection range of the tilt sensor. Level the instrument while checking the air bubbles in the circular level until “●” is displayed on the screen.

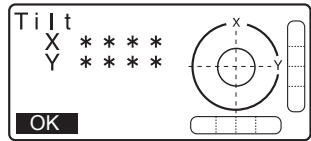


Note

- When executing the measurement program, if measurement starts with the instrument tilted, the circular level is displayed on the screen.

4. Center “●” in the circular level
☞ steps 1 to 2
 - If the bubble is centered, move to step 9.

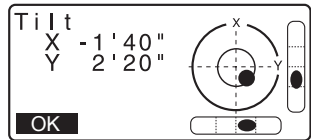

5. Turn the instrument until the telescope is parallel to a line between levelling foot screws A and B, then tighten the horizontal clamp.
6. Set the tilt angle to 0° using foot screws A and B for the X direction and levelling screw C for the Y direction.
7. Loosen the centering screw slightly.
Looking through the optical plummet eyepiece, slide the instrument over the tripod head until the survey point is exactly centered in the reticle.
Retighten the centering screw securely.

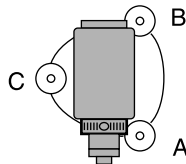

7. SETTING UP THE INSTRUMENT

8. Confirm that the bubble is positioned at the center of the circular level on the screen.
If not, repeat the procedure starting from step 6.
9. When levelling is completed, press **[OK]** changes to the OBS mode.


8. FOCUSING AND TARGET SIGHTING



- When sighting the target, strong light shining directly into the objective lens may cause the instrument to malfunction. Protect the objective lens from direct light by attaching the lens hood. Observe to the same point of the reticle when the telescope face is changed.

PROCEDURE

1. Look through the telescope eyepiece at a bright and featureless background. Turn the eyepiece screw clockwise, then counterclockwise little by little until just before the reticle image becomes focussed. Using these procedures, frequent reticle refocussing is not necessary since your eye is focussed at infinity.
2. Loosen the vertical and horizontal clamps, then use the sighting collimator to bring the target into the field of view. Tighten both clamps.
3. Turn the telescope focussing ring to focus on the target. Turn the vertical and horizontal fine motion screws to align the target with the reticle. The last adjustment of each fine motion screw should be in the clockwise direction.

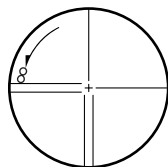

8. FOCUSING AND TARGET SIGHTING

4. Readjust the focus with the focussing ring until there is no parallax between the target image and the reticle.



Eliminating parallax

This is the relative displacement of the target image with respect to the reticle when the observer's head is moved slightly before the eyepiece.

Parallax will introduce reading errors and must be removed before observations are taken. Parallax can be removed by refocussing the reticle.

9. POWER ON/OFF


☞ Setting "V manual": "31.1 Configuration -Config Mode-", Setting/changing password: "31.4 Changing Password"

PROCEDURE Power ON

1. Press **{ON}**.



When the power is switched on, a self-check is run to make sure the instrument is operating normally.

- When password is set, the display appears as at right. Input password and press **{ENT}**.

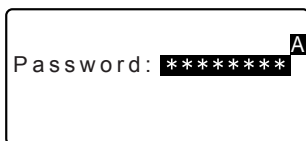

Then, the electric circular level is displayed in the screen. After leveling the instrument, press **[OK]** to enter into the OBS mode.


☞ "7.2 Levelling"

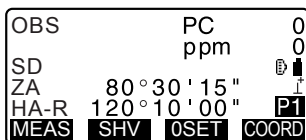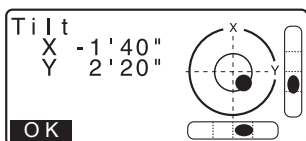

Note


- When "V manual" is set to "Yes", the display appears as at right after leveling the instrument and press **[OK]**.

☞ Manually indexing the vertical circle by face 1, face 2 measurements:
"36. EXPLANATION"

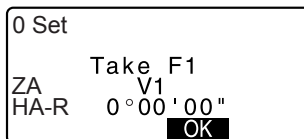

- If "Out of range" or the Tilt screen is displayed, level the instrument again.
- "Tilt cm" in "Obs. condition" should be set to "No" if the display is unsteady due to vibration or strong wind.
☞ "31.1 Configuration -Config Mode-"

 

9. POWER ON/OFF

- When "Resume" in "Instr. config" is set to "On", the screen previous to power off is displayed (except when missing line measurement was being performed).
 "31.1 Configuration -Config Mode-"

PROCEDURE Power OFF

1. Long push {ON} button.



- When there is almost no battery power remaining, the  symbol will be displayed every 3 seconds. In this event, stop measurement, switch off the power and charge the battery or replace with a fully charged battery.
- To save power, power to the CX is automatically cut off if it is not operated for a fixed period of time. This time period can be set in "Power off" in <Instr.config.>.
 "31.1 Configuration -Config Mode-"

10. ANGLE MEASUREMENT

This section explains the procedures for basic angle measurement.

 
10.1 Measuring the Horizontal Angle between Two Points (Horizontal Angle 0°)

Use the "0SET" function to measure the included angle between two points. The horizontal angle can be set to 0 at any direction.

PROCEDURE

1. Sight the first target as at right.

1st target



Instrument Station

2. In the first page of the OBS mode screen, press [0SET].

[0SET] will flash, so press [0SET] again.

The horizontal angle at the first target becomes 0°.

OBS	PC	0
	ppm	0
SD		
ZA	89° 59' 50"	
HA-R	0° 00' 00"	P1
MEAS	SHV	0SET
		COORD

3. Sight the second target.

2nd Target



The displayed horizontal angle (HA-R) is the included angle between two points.


OBS	PC	0
	ppm	0
SD		
ZA	89° 59' 50"	
HA-R	117° 32' 20"	P1
MEAS	SHV	0SET
		COORD

10.2 Setting the Horizontal Angle to a Required Value (Horizontal Angle Hold)


You can reset the horizontal angle to a required value and use this value to find the horizontal angle of a new target.


PROCEDURE Entering the horizontal angle


1. Sight the first target.
2. Press **[H-SET]** on the second page of the OBS mode and select "Angle."

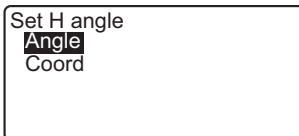

3. Enter the angle you wish to set, then press **[OK]**.
 The value that is input as the horizontal angle is displayed.

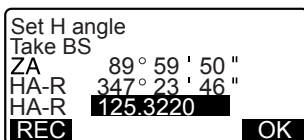


- Press **[REC]** to set and record the horizontal angle.
 "27.2 Recording Backsight Point"

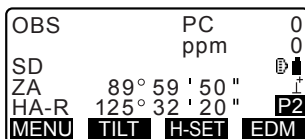

4. Sight the second target.
 The horizontal angle from the second target to the value set as the horizontal angle is displayed.

Note

- Pressing **[HOLD]** performs the same function as above.
- Press **[HOLD]** to set the displayed horizontal angle. Then, set the angle that is in hold status to the direction you require.
 Allocating **[HOLD]**: "31.3 Allocating Key Functions"

PROCEDURE Entering the coordinate

1. Press **[H-SET]** on the second page of the OBS mode and select "Coord."


```
Set H angle
Angle
Coord
```

2. Set the known point coordinate. Enter the coordinate for the first point, and press **[OK]**.

Press **[YES]** to set the horizontal angle.

```
SET H angle/BS
NBS:      100.000
EBS:      100.000
ZBS:      <Null>
```

LOAD **OK**

- Press **[REC]** to set and record the horizontal angle.
 "27.2 Recording Backsight Point"

 
```
Set H angle
Take BS
ZA      89° 59' 50"
HA-R    125° 32' 20"
Azimuth 45° 00' 00"
```

REC **NO** **YES**

3. Sight the second target. The horizontal angle from the set coordinate is displayed.


10.3 Angle Measurement and Outputting the Data

The following explains angle measurement and the features used to output measurement data to a computer or peripheral equipment.

 Interface cables: "34.2 Optional accessories"

Output format and command operations: "Communication manual"

 PROCEDURE

1. Connect CX and host computer.
2. Allocate the **[HVOUT-T]** or **[HVOUT-S]** softkey to the OBS mode screen.
 "31.3 Allocating Key Functions"



- Pressing the softkey outputs data in the following format.

[HVOUT-T] : GTS format

[HVOUT-S] : SET format

3. Sight the target point.
4. Press **[HVOUT-T]** or **[HVOUT-S]**.
Output measurement data to peripheral equipment.


11. DISTANCE MEASUREMENT

Perform the following settings as preparation for distance measurement.

- Distance measurement mode
- Target type
- Prism constant correction value
- Atmospheric correction factor
- EDM ALC

 "31.1 Configuration -Config Mode-"/"31.2 EDM Settings"

CAUTION

- When using the Laser-pointer function, be sure to turn OFF the output laser after distance measurement is completed. Even if distance measurement is canceled, the Laser-pointer function is still operating and the laser beam continues to be emitted. (After turning ON the Laser-pointer, the laser beam is emitted for 5 minutes, and then automatically switches OFF. But in the Status screen and when target symbol (ex. ) is not displayed in the OBS mode, the laser beam is not automatically turned off.)



- Make sure that the target setting on the instrument matches the type of target used. CX automatically adjusts the intensity of the laser beam and switches the distance measurement display range to match the type of target used. If the target does not correspond to the target settings, accurate measurement results cannot be obtained.
- Accurate measurement results cannot be obtained if the objective lens is dirty. Dust it off with the lens brush first, to remove minute particles. Then, after providing a little condensation by breathing on the lens, wipe it off with the wiping cloth.
- During reflectorless measurement, if an object obstructs the light beam used for measurement or an object is positioned with a high reflective factor (metal or white surface) behind the target, accurate measurement results may not be received.
- Scintillation may affect the accuracy of distance measurement results. Should this occur, repeat measurement several times and use the averaged value of the obtained results.

11.1 Returned Signal Checking

- Check to make sure that sufficient reflected light is returned by the reflective prism sighted by the telescope. Checking the returned signal is particularly useful when performing long distance measurements.




- When the light intensity is sufficient even though the center of the reflective prism and the reticle are slightly misaligned (short distance etc.), “**” will be displayed in some cases, but in fact, accurate measurement is impossible. Therefore make sure that the target center is sighted correctly.


PROCEDURE

1. Allocate the **[S-LEV]** softkey to the OBS mode screen.
☞ "31.3 Allocating Key Functions"

2. Accurately sight the target.

3. Press **[S-LEV]**.
<Aiming> is displayed.
The intensity of the light of the returned signal is displayed by a gauge.

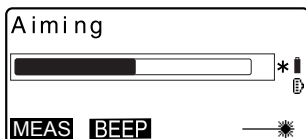

- The more  displayed, the greater the quantity of reflected light.
- If “**” is displayed, only enough light for the measurement is returned.
- When “**” is not displayed, accurately resight the target. Press **[BEEP]** to make a buzzer sound when measurement is possible. Press **[OFF]** to shut off the buzzer.
- Press **[MEAS]** to start distance measurement.

- Press **{ESC}** to finish signal checking and return to Obs Mode.



- When ████████ is displayed persistently, contact your local dealer.
- If no key operations are performed for two minutes, the display automatically returns to the OBS mode screen.

11.2 Distance and Angle Measurement

An angle can be measured at the same time as the distance.

PROCEDURE

- Sight the target.
- In the first page of Obs Mode, press **[MEAS]** to start distance measurement.

When measurement starts, EDM information (distance mode, prism constant correction value, atmospheric correction factor) is represented by a flashing light.

A short beep sounds, and the measured distance data (SD), vertical angle (ZA), and horizontal angle (HA-R) are displayed.



OBS	PC	0
	ppm	0
SD		
ZA	80°30'15"	↑
HA-R	120°10'00"	P1
MEAS	SHV	OSET COORD

Dist	PC	0
Fine" r "	ppm	0
		STOP


OBS	PC	0
	ppm	0
SD	525.450m	
ZA	80°30'10"	↑
HA-R	120°10'00"	
		STOP

11. DISTANCE MEASUREMENT

- Press **[STOP]** to quit distance measurement.
 - Each time **[SHV]** is pressed, SD (Slope distance), HD (Horizontal distance) and VD (Height difference) are displayed alternately.

OBS	PC	0
	ppm	0
SD	525.450m	
HD	518.248m	
VD	86.699m	P1
MEAS	SHV	OSET
		COORD

Note


- If the single measurement mode is selected, measurement automatically stops after a single measurement.
- During fine average measurement, the distance data is displayed as S-1, S-2, ... to S-9. When the designated number of measurements has been completed, the average value of the distance is displayed in the [S-A] line.
- The distance and angle that are most recently measured remain stored in the memory until the power is off and can be displayed at any time.
 "11.3 Recalling the Measured Data"
- If the tracking measurement is conducted with the target type "reflectorless", the measured data for a distance exceeding 250m is not displayed.

11.3 Recalling the Measured Data

The distance and angle that are most recently measured remain stored in the memory until the power is off and can be displayed at any time.

The distance measurement value, vertical angle, horizontal angle, and the coordinates can be displayed. Distance measurement values converted into the horizontal distance, elevation difference, and the slope distance can also be displayed.

PROCEDURE

- Allocate the **[CALL]** softkey to the OBS mode screen.
 "31.3 Allocating Key Functions"

2. Press **[CALL]**.

The stored data that is most recently measured is displayed.


- If you have pressed **[SHV]** beforehand, the distance values are converted into the horizontal distance, elevation difference, and the slope distance and recalled.

SD	525.450m
HD	518.248m
VD	86.699m
N	-128.045
E	-226.237
Z	30.223

3. Press **{ESC}** to return to OBS mode.


11.4 Distance Measurement and Outputting the Data

The following explains distance measurement and the features used to output measurement data to a computer or peripheral equipment.

 Interface cables: "34.2 Optional accessories"

Output format and command operations: "Communication manual"

PROCEDURE

1. Connect CX and host computer.
2. Allocate the **[HVDOUT-T]** or **[HVDOUT-S]** softkey to the OBS mode screen.
 -  "31.3 Allocating Key Functions"



- Pressing the softkey outputs data in the following format.
 - [HVDOUT-T]**: GTS format
 - [HVDOUT-S]**: SET format

 
3. Sight the target point.

11. DISTANCE MEASUREMENT

4. Press **[HVDOUT-T]** or **[HVDOUT-S]** to measure the distance and output the data to peripheral equipment.
5. Press **[STOP]** to stop outputting data and return to Obs Mode.


11.5 Coordinate Measurement and Outputting the Data

The following explains coordinate measurement and the features used to output measurement data to a computer or peripheral equipment.

 Interfaces: "34.2 Optional accessories"

Output format and command operations: "Communication manual"

PROCEDURE

1. Connect CX and host computer.
2. Allocate the **[NEZOUT-T]** or **[NEZOUT-S]** softkey to the OBS mode screen.
 "31.3 Allocating Key Functions"

Note

- Pressing the softkey outputs data in the following format.
[NEZOUT-T]: GTS format
[NEZOUT-S]: SET format

3. Sight the target point.

4. Press **[NEZOUT-T]** or **[NEZOUT-S]** to measure the distance and output the data to peripheral equipment.



- When the Distance Measurement mode is set to "Tracking" in the EDM Settings, the measured data cannot be output by pressing **[NEZOUT-T]**.
5. Press **[STOP]** to stop outputting data and return to Obs Mode.

11. DISTANCE MEASUREMENT


11.6 REM Measurement

An REM measurement is a function used to measure the height to a point where a target cannot be directly installed such as power lines, overhead cables and bridges, etc.

The height of the target is calculated using the following formula.

$$H_t = h_1 + h_2$$


$$h_2 = S \sin \theta_{z1} \times \cot \theta_{z2} - S \cos \theta_{z1}$$

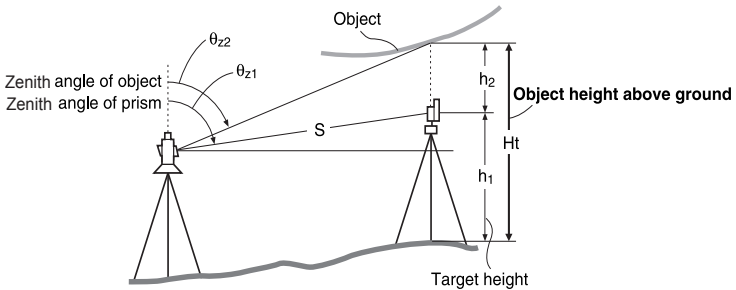

- The items displayed as <Null> in the coordinate data are excluded from the calculation (Null is different from 0).

PROCEDURE

1. Set the target directly under or directly over the object and measure the target height with a tape measure etc.

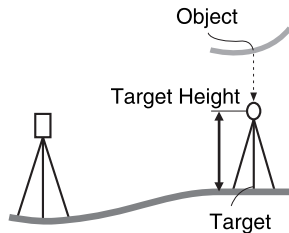

2. After inputting the target height, accurately sight the target.


"Note"

Press **[MEAS]** in page 1 of Obs Mode to carry out measurement.


The measured distance data (SD), vertical angle (ZA), and horizontal angle (HA-R) are displayed.

Press **[STOP]** to stop the measurement.



- In the second page of OBS mode screen, press **[MENU]**, then select "REM".

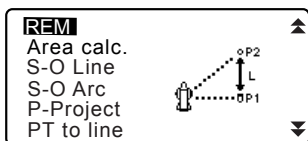


- Enter into the REM menu. Select "REM."

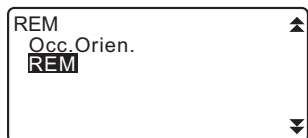


- Sight the target. Pressing **[REM]** starts REM measurement. The height from the ground to the object is displayed in "Ht."

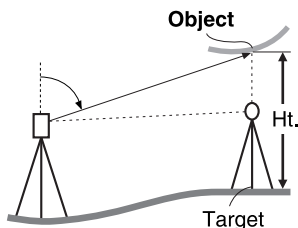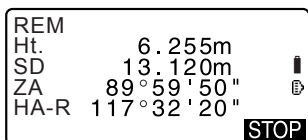

- Press **[STOP]** to terminate the measurement operation.
 - To re-observe the target, sight the target, then press **[MEAS]**.

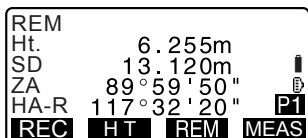



11. DISTANCE MEASUREMENT

- Press **[HT]** to enter an instrument height (HI) and a target height (HR).
- When **[REC]** is pressed, REM data is saved.
 "27. RECORDING DATA - TOPO MENU -"

Height	
HI	0.000m
HR	0.000m
	OK

- Press **[HT/Z]** on the second page of the REM measurement to display the Z coordinate for the height from the ground to the target. Pressing **[HT/Z]** again returns to the height display.
7. Press **{ESC}** to finish measurement and return to the OBS mode screen.

Note

- It is also possible to perform REM measurement by pressing **[REM]** when allocated to the OBS mode screen.
 "31.3 Allocating Key Functions"
- Inputting instrument and target height: Press **[HT]** to set instrument and target height. It can be set also in "Occ. Orientation" of coordinate measurement.
 "12.1 Entering Instrument Station Data and Azimuth Angle"

12. SETTING INSTRUMENT STATION

It is possible to set from the instrument station data to the backsight angle in a series of procedures.

Setting Instrument Station Data

- Key input
 - ☞ "12.1 Entering Instrument Station Data and Azimuth Angle" Step 3
- Reading the registered coordinate
 - ☞ "12.1 Entering Instrument Station Data and Azimuth Angle" PROCEDURE Reading in Registered Coordinate Data
- Calculating data by resection measurement
 - ☞ "12.2 Setting Instrument Station Coordinate with resection measurement"

Setting backsight angle

- Inputting the backsight angle
 - ☞ "12.1 Entering Instrument Station Data and Azimuth Angle" Step 3
- Calculating from the backsight coordinate
 - ☞ "12.1 Entering Instrument Station Data and Azimuth Angle" Step 3
- Calculating the direction angle by assuming the known point (first point) at the time of resection measurement as the backsight point.
 - ☞ "12.2 Setting Instrument Station Coordinate with resection measurement" Step 9



- When performing measurement in which the reduced data is output, be sure to record the instrument station data before the measurement. If a correct instrument station data is not recorded, it may cause output of an unintended measurement result.
 - ☞ Reduced data : "30.1 Outputting JOB Data to Host Computer"

12. SETTING INSTRUMENT STATION

12.1 Entering Instrument Station Data and Azimuth Angle

Before coordinate measurement, enter instrument station coordinates, the instrument height, target height, and azimuth angle.


PROCEDURE



1. First measure the target height and instrument height with a tape measure, etc.
2. Select the calculation program from the Observation menu. (The explanation below is an example of when "coordinate measurement" is selected.)
3. Select "Occ.orien."
Input the following data items.
 - (1) Instrument station coordinates (Occupied point coordinates)
 - (2) Point name (PT)
 - (3) Instrument height (HI)
 - (4) Code (CD)
 - (5) Operator
 - (6) Date
 - (7) Time
 - (8) Weather
 - (9) Wind
 - (10) Temperature
 - (11) Air pressure
 - (12) Atmospheric correction factor

Coord.
Occ. Orien.
Observation
EDM

N0:	0.000
E0:	0.000
Z0:	<Null>
PT	AUTO100000
HI	1.200m
LOAD	BS AZ BS NEZ RESEC

 - When you wish to read in the registered coordinate data, press **[LOAD]**.

 "PROCEDURE Reading in Registered Coordinate Data"

- Press **[RESEC]** to measure instrument station coordinates by resection measurement.
-  "12.2 Setting Instrument Station Coordinate with resection measurement"
4. Press **[BS AZ]** in the screen of step 3 to proceed to azimuth angle input.
- Press **[BS NEZ]** to calculate azimuth angle from backsight coordinates.
-  "12.1.1 Setting Azimuth Angle from Backsight Coordinates"
5. Input azimuth angle and press **[OK]** to set the input values. <Coord> is displayed again.

Backsight	
Take BS	
ZA	40° 23 ' 13 "
HA-R	40° 42 ' 15 "
HA-R	<input type="text"/>
REC	OK

- Press **[REC]** to record the following data.
Instrument station data, RED (Reduced) data, backsight station data, and angle measurement data

Press **[OK]** to set the input values and return to <Coord>.

Note


- Maximum point name size: 14 (alphanumeric)
- Input range of instrument height: -9999.999 to 9999.999 (m)
- Maximum code/operator size: 16 (alphanumeric)
- Weather selection: Fine, Cloudy, Light rain, Rain, Snow
- Wind selection: Calm, Gentle, Light, Strong, Very strong
- Temperature range: -35 to 60 (°C) (in 1°C step)/-31 to 140 (°F) (in 1°F step)
- Air pressure range: 500 to 1400 (hPa) (in 1 hPa step)/375 to 1050 (mmHg) (in 1mmHg step)/14.8 to 41.3 (inch Hg) (in 0.1 inch Hg step)
- Atmospheric correction factor range (ppm): -499 to 499

12. SETTING INSTRUMENT STATION

PROCEDURE Reading in Registered Coordinate Data

Known point data, coordinate data and instrument station data in the current JOB and Coordinate Search JOB can be read in.


Confirm that the correct JOB containing the coordinates you want to read in is already selected in Coordinate Search JOB in Data Mode.

 "29.1 Registering/Deleting Known Point Data", "28.1 Selecting a JOB"

1. Press **[LOAD]** when setting Instrument Station.
The list of registered coordinates is displayed.


PT : Known point data saved in the current JOB or in the Coordinate Search JOB.

Crd./ Occ: Coordinate data saved in the current JOB or in the Coordinate Search JOB.

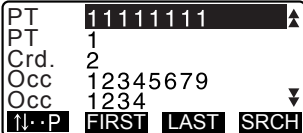


```
PT 11111111
PT 1
Crd. 2
Occ 12345679
Occ 1234
[↑↓...P] [FIRST] [LAST] [SRCH]
```

2. Align the cursor with the required point name and press **{ENT}**.
The point name that was read and its coordinates are displayed.

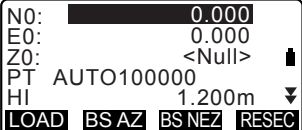

```
N0: 0.000
E0: 0.000
Z0: <Null>
PT AUTO100000
HI 1.200m
[LOAD] [BS AZ] [BS NEZ] [RESEC]
```

- **[↑↓...P]** = Use **{▲}**/**{▼}** to move from page to page.
- **[↑↓...P]** = Use **{▲}**/**{▼}** to select individual point.
- Press **[FIRST]** to move to the first point name on the first page.
- Press **[LAST]** to move to the last point name on the last page.
- Press **[SRCH]** to move to the "Coordinate Data Search Screen."

 " 12.1.1 Setting Azimuth Angle from Backsight Coordinates"

- You can edit the coordinate data that was read in. Editing does not affect the original coordinate data. After editing, the point name is no longer displayed.



- The point name that was read in is displayed until the current JOB is changed.
- When **[SRCH]** is pressed, CX searches data in the current JOB first, then in the Coordinate Search JOB.
- If more than two points with the same point name exist in the current JOB, CX finds the newer data only.

PROCEDURE Coordinate Data Search (Complete match)

- Press **[Search]** on the registered coordinate data list screen.
- Enter search criteria.
Enter following items.
 - Coordinate point name
 - Search condition (complete match)
 - Search direction
- Press **[OK]** to display the details of searched data.

PT	100
Criteria:	Complete
Direct.:	▲
OK	



Searching the coordinate point name

Data is saved according to the time it was recorded. When there is more than one coordinate point name matching the search, "the point nearest to the currently selected data" is selected. See the Note below for search method options.



Options for the setting items are as follows. (* is the setting when the power is turned to ON.)

- * Search method: ▼ (searches backward from the current point name) */
▲ (searches forward from the current point name)

12. SETTING INSTRUMENT STATION

PROCEDURE Coordinate Data Search (Partial match)

1. Press **[Search]** in the registered coordinate data list screen.
All coordinate data that includes characters and numbers entered in step 2 is displayed.


2. Enter search criteria.
Enter the following items.
 - (1) Partial coordinate point name
 - (2) Search condition (partial match)

PT	100
Criteria:	Partiale
OK	


3. Press **[OK]** to display data that matches the search information.
4. Select the data and press **{ENT}** to display the details.

12.1.1 Setting Azimuth Angle from Backsight Coordinates

Set the azimuth angle of the backsight station by calculating by the coordinates.

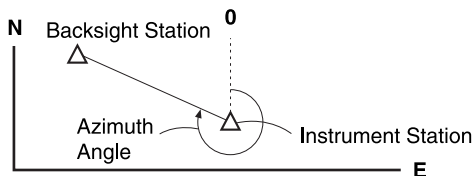

PROCEDURE

1. Enter the instrument station data.
 "12.1 Entering Instrument Station Data and Azimuth Angle"


 
2. Press **[BS NEZ]** after entering the instrument station data to enter a backsight point coordinate.

Backsight	
NBS:	100.000
EBS:	100.000
ZBS:	<Null>
LOAD	OK

- When you wish to read in the registered coordinate data, press **[LOAD]**.

☞ "12.1 Entering Instrument Station Data and Azimuth Angle" PROCEDURE
Reading in Registered Coordinate Data"


3. Input the backsight station coordinates and press **[OK]**.
4. The backsight angle is displayed in "Azimuth". Press **[YES]**, set an azimuth angle and return to <Coord>.

Backsight	
Take BS	
ZA	89° 59' 55" 
HA-R	117° 32' 20" 
Azimuth	45° 00' 00"
REC	MEAS NO YES

- Pressing **[NO]** returns to the step 2 screen.
- Pressing **[MEAS]** after collimating the backsight point initiates measurement. When measuring is completed, the backsight distance check screen is displayed. The difference between the calculated value and the measured height distance value is displayed. After confirming, press **[OK]**.
- Press **[HT]** to set instrument and target height.
- Press **[REC]** to store check data in the current JOB

BS Hdist check	
calc HD	15.000m
obs HD	13.000m
dHD	2.000m
REC	HT OK

12. SETTING INSTRUMENT STATION

- Press **[REC]** to record the following data.
Instrument station data, backsight station data, known point data, and angle measurement data (distance measurement data when **[MEAS]** is pressed)
- When storing the azimuth angle in the current JOB, press **[REC]**.
 "27.2 Recording Backsight Point",

12.2 Setting Instrument Station Coordinate with resection measurement

Resection is used to determine the coordinates of an instrument station by performing multiple measurements of points whose coordinate values are known. Registered coordinate data can be recalled and set as known point data. Residual of each point can be checked, if necessary.

Entry

Coordinates of known point : (X_i, Y_i, Z_i)


Observed horizontal angle : H_i

Observed vertical angle : V_i

Observed distance : D_i

Output

Station point coordinates : (X_0, Y_0, Z_0)

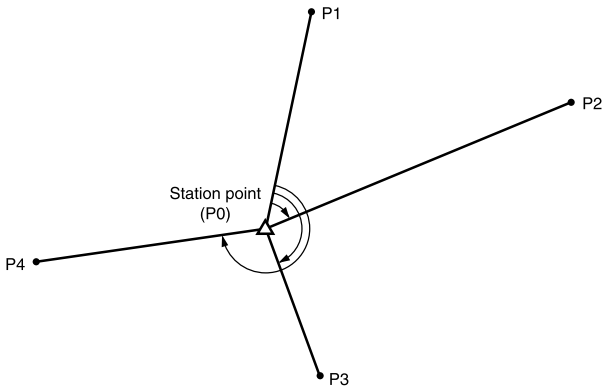

- All the N, E, Z or only Z data of an instrument station is calculated by measuring the known points.
- Coordinate resection measurement overwrites the N, E and Z data of the instrument station, but height resection does not overwrite N and E. Always perform resection measurement in the sequence described in "12.2.2 Coordinate Resection Measurement" and "12.2.4 Height Resection Measurement".
- Input known coordinate data and calculated instrument station data can be recorded in the current JOB.

 "28. SELECTING/DELETING A JOB"

12. SETTING INSTRUMENT STATION

12.2.1 Observation setting

Perform observation setting prior to resection measurement.

1. Select "Occ. Orient."

```
Coord.  
Occ.Orien.  
Observation  
EDM
```

2. Press [RESEC].

```
NO: 0.000  
EO: 0.000  
ZO: <Null>  
PT PNT-001  
HI 1.200m  
LOAD BS AZ BS NEZ RESEC
```

3. Select "Setting".


```
Resection.  
NEZ  
Elevation  
Setting
```

4. Set for resection measurement.

Set the following items:

- (1) RL observation (F1/F2 Obs):

Observe every point in Face 1 and 2 in resection.

 "12.2.3 RL observation in resection measurement"

Set "F1/F2 Obs" to "Yes" when performing RL observation.

```
Setting  
F1/F2 Obs : No  
Z : On
```

- (2) Display σZ (Z)

Set "Z" to "On" to display standard deviation σZ in the instrument station coordinate calculation screen and result (standard deviation) screen of coordinate resection.

12. SETTING INSTRUMENT STATION

- Press [**σ NEZ**] to display standard deviation which describes the measurement accuracy. Press [**NEZ**] to return to the instrument station coordinate screen.

N	100.001			
E	100.000			
Z	9.999			
<table border="0"> <tr> <td>RESULT</td> <td>σNEZ</td> <td>OK</td> </tr> </table>		RESULT	σNEZ	OK
RESULT	σNEZ	OK		

σ N	0.0014m			
σ E	0.0007m			
σ Z	0.0022m			
<table border="0"> <tr> <td>RESULT</td> <td>NEZ</td> <td>OK</td> </tr> </table>		RESULT	NEZ	OK
RESULT	NEZ	OK		

- σ Z can be displayed by pressing **▶** in the result screen in which **▶▶** is displayed.

	σ N	σ E	▶▶				
1st	-0.001	0.001					
2nd	0.005	0.010					
3rd	-0.001	0.001					
<table border="0"> <tr> <td>OMIT</td> <td>RE CALC</td> <td>RE MEAS</td> <td>ADD</td> </tr> </table>				OMIT	RE CALC	RE MEAS	ADD
OMIT	RE CALC	RE MEAS	ADD				

◀	σ Z				
1st	-0.003				
2nd	0.005				
3rd	-0.001				
<table border="0"> <tr> <td>OMIT</td> <td>RE CALC</td> <td>RE MEAS</td> <td>ADD</td> </tr> </table>		OMIT	RE CALC	RE MEAS	ADD
OMIT	RE CALC	RE MEAS	ADD		

Note

- Choices of the setting are as follows (*is the default setting):
 - RL observation: Yes / No *
 - Display σ Z: On* / Off

12. SETTING INSTRUMENT STATION

12.2.2 Coordinate Resection Measurement

Observe existing points with known coordinate data to calculate the coordinate value for the instrument station.

- Between 2 and 10 known points can be measured by distance measurement, and between 3 and 10 known points by angle measurement.

PROCEDURE

1. Select "Occ.orien." from the coordinate measurement menu.

```
Coord.  
Occ.Orien  
Observation  
EDM
```

2. Press **[RESEC]**.

```
NO: 0.000  
EO: 0.000  
ZO: <Null>  
PT PNT-001  
HI 1.200m  
LOAD BS AZ BS NEZ RESEC
```

3. Select "NEZ".

```
Resection.  
NEZ  
Elevation  
Setting
```

4. Sight the first known point and press **[MEAS]** to begin measurement.
The measurement results are displayed on the screen.

```
Resection 1st PT  
SD  
ZA 80° 30' 10"  
HA-R 120° 10' 00"  
ANGLE MEAS
```

- When **[BS AZ]** has been selected, the distance cannot be displayed.

5. Press **[YES]** to use the measurement results of the first known point.


```
Resection 1st PT  
SD 525.450m  
ZA 80° 30' 10"  
HA-R 120° 10' 00"  
HR 1.400m  
NO YES
```

- You can also input target height here.

12. SETTING INSTRUMENT STATION

6. Input coordinates for the first known point and press **[NEXT]** to move to the second point.

- When **[LOAD]** is pressed, registered coordinates can be recalled and used.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

- Press **{ESC}** to return to the previous known point.

1st PT	
Np :	20.000
Ep :	30.000
Zp :	40.000
HR :	10.000m
LOAD	REC NEXT

7. Repeat procedures 4 to 6 in the same way from the second point. When the minimum quantity of observation data required for the calculation is present, **[CALC]** is displayed.

8. Press **[CALC]** to automatically start calculations after observations of all known points are completed. Instrument station coordinate and standard deviation, which describes the measurement accuracy, are displayed.

3rd PT	
Np :	20.000
Ep :	30.000
Zp :	40.000
HR :	10.000m
LOAD	REC NEXT CALC

9. Press **[RESULT]** to check the result.

- Pressing **{ESC}** returns to the previous screen.

N	100.001
E	100.000
Z	9.999
σ N	0.0014m
σ E	0.0007m
RESULT	OK

- Press **[ADD]** when there is a known point that has not been measured or when a new known point is added.

		σ N	σ E
1st	-0.001	0.001	
* 2nd	0.005	0.010	
3rd	-0.001	0.001	
4th	-0.003	-0.002	▼
OMIT	RE CALC	RE MEAS	ADD

12. SETTING INSTRUMENT STATION

10. If there are problems with the results of a point, align the cursor with that point and press **[OMIT]**. “*” is displayed on the left of the point. Repeat for all results that include problems.

	σN	σE
1st	-0.001	0.001
* 2nd	0.005	0.010
3rd	-0.001	0.001
4th	-0.003	-0.002

11. Press **[RE_CALC]** to perform calculation again without the point designated in step 10. The result is displayed.

If there are no problems with the result, go to step 12.

If problems with the result occur again, perform the resection measurement from step 4.

- Press **[RE_MEAS]** to measure the point designated in step 10. If no points are designated in step 10, all the points or only the final point can be observed again.

Resection
Start point
Last point

12. Press **[OK]** in the screen of step 9 to finish resection measurement. The instrument station coordinate is set.

Press **[YES]** when you want to set the azimuth angle of the first known point as the backsight point (except for omitted points). It returns to the instrument station setting screen.

Resection
Set azimuth
<input type="button" value="NO"/> <input type="button" value="YES"/>

Pressing **[OK]** sets the direction angle and instrument station data, and then returns to <Coord.>.

N0:	100.001	
E0:	100.009	
Z0:	9.999	<input type="checkbox"/>
PT	PNT-001	
HI	1.200m	<input type="checkbox"/>

12. SETTING INSTRUMENT STATION

- Pressing **[REC]** displays the backsight point recording screen. Press **[OK]** to the following data.
Instrument station data, backsight station data, known point data, and angle measurement data (distance measurement data when **[MEAS]** is pressed)

ZA	80° 30' 10"
HA-R	120° 10' 00"
HR	1.400m
CD	
	OK


Pressing **[NO]** returns to the instrument station setting screen without setting the direction angle. From here, set the backsight point again.

NO:	100.001
E0:	100.009
Z0:	9.999
PT	PNT-001
HI	1.200m
LOAD	BS AZ
BS NEZ	RESEC

Note

- Even if "inch" is selected in Config mode, standard deviation is displayed in "feet" or "US feet" depending on the feet unit selected.

 12.2.3 RL observation in resection measurement

- Set "F1/F2 Obs" to "Yes" in observation setting.
 "12.2.1 Observation setting"
- Press **[RESEC]**.

Setting	
F1/F2 Obs	: Yes
Z	: Yes

NO:	0.000
E0:	0.000
Z0:	<Null>
PT	PNT-001
HI	1.200m
LOAD	BS AZ
BS NEZ	RESEC

12. SETTING INSTRUMENT STATION



3. Select "NEZ".

Resection.
NEZ
Elevation
Setting

4. Measure the first known point in Face 1.

"R" is displayed in the screen title.

Press **[MEAS]** to start measuring. The measurement results are displayed on the screen.

Resection 1st R
SD
ZA 80° 30' 10" 
HA-R 120° 10' 00" 
ANGLE MEAS

5. Press **[Yes]** to use the measurement results of the first known point in Face 1.



- You can input target height here.

Resection 1st R
SD 525.450m
ZA 80° 30' 10"
HA-R 120° 10' 00"
HR
NO YES

6. Measure the first known point in Face 2.

"L" is displayed in the screen title.

Press **[MEAS]** to start measuring. The measurement results are displayed on the screen.

Resection 1st L
SD
ZA 80° 30' 10" 
HA-R 120° 10' 00" 
ANGLE MEAS

7. Press **[Yes]** to use the measurement results of the first known point in Face 2.


Resection 1st L
SD 525.450m
ZA 80° 30' 10"
HA-R 120° 10' 00"
HR 1.400m
NO YES

12. SETTING INSTRUMENT STATION

8. Input coordinates for the first known point and press **[NEXT]** to move to the second point.



- When **[LOAD]** is pressed, registered coordinates can be recalled and used.

1st PT	
Np :	20.000
Ep :	30.000
Zp :	40.000
HR :	10.000m
LOAD	REC NEXT

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

- Press **{ESC}** to return to the previous known point.

9. Repeat steps 4 to 8 in the same way from the second point.

Resection 2nd L	
SD	
ZA	80° 30' 10" 
HA-R	120° 10' 00" 
ANGLE	MEAS

When the minimum quantity of observation data required for the calculation is present, **[CALC]** is displayed.

Perform the following procedure referring " 12.2.2 Coordinate Resection Measurement" steps 8 to 12.

3rd PT	
Np :	60.000
Ep :	20.000
Zp :	50.000
HR :	10.000m
LOAD	REC NEXT CALC

Note

- Order of RL observation in resection measurement is as follows:
 - (1) 1st point (R1 → L1 → coordinates input)
 - (2) 2nd point (L2 → R2 → coordinates input)
 - (3) 1st point (R3 → L3 → coordinates input)

When re-observe the 1st point, the order is as follows:

- (1) 1st point (R1 → L1 → press **{ESC}** to cancel the result)
- (2) 1st point (L1 → R1 → coordinates input)

12. SETTING INSTRUMENT STATION


12.2.4 Height Resection Measurement


Only Z (height) of an instrument station is determined by the measurement.

- Known points must be measured by distance measurement only.
- Between 1 and 10 known points can be measured.

PROCEDURE


1. Select "Occ.orien." from the coordinate measurement menu.
2. Press **[RESEC]** in the "Occ.orien."
3. Select "Elevation".

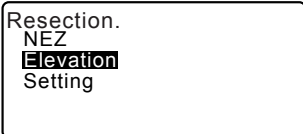

- The tilt screen is displayed if the instrument is out of level.
Level the instrument.
 "7.2 Levelling"




Resection.
NEZ
Elevation
Setting

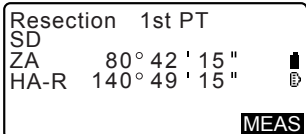
4. Sight the first known point and press **[MEAS]** to begin measurement. Press **[STOP]**. The measurement results are displayed on the screen.
5. Press **[YES]** to use the measurement results of the first known point.



Resection 1st PT
SD
ZA 80° 42' 15" 
HA-R 140° 49' 15" 
MEAS

6. Input the known point. After setting the elevation for the first known point, press **[NEXT]** to move to the second point.

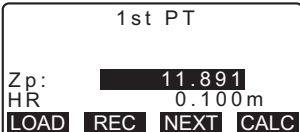

1st PT
Zp:  11.891
HR 0.100m
LOAD REC NEXT CALC

12. SETTING INSTRUMENT STATION

7. If measuring two or more known points, repeat procedures 4 to 6 in the same way from the second point.
 - Press **{ESC}** to return to the previous known point.
8. Press **[CALC]** to automatically start calculations after observations of all known points are completed. Instrument station elevation and standard deviation, which describes the measurement accuracy, are displayed.
9. Press **[RESULT]** to check the result.

If there are no problems in the result, press **{ESC}** and go to step 10.
10. If there are problems with the results of a point, align the cursor with that point and press **[OMIT]**. “*” is displayed on the left of the point.
11. Press **[RE_CALC]** to perform calculation again without the point designated in step 10. The result is displayed.

If there are no problems with the result, go to step 12.

If problems with the result occur again, perform the resection measurement from step 4.
12. Press **[OK]** to finish resection measurement. Only Z (elevation) of the instrument station coordinate is set. N and E values are not overwritten.

Z	10.000
σZ	0.0022m
RESULT	OK


	σZ	
1st	-0.003	
2nd	-0.003	
3rd	0.000	
4th	0.002	▼
OMIT	RE_CALC	RE_MEAS ADD

12. SETTING INSTRUMENT STATION



Resection calculation process

The NE coordinates are found using angle and distance observation equations, and the instrument station coordinates are found using the method of least squares. The Z coordinate is found by treating the average value as the instrument station coordinates.

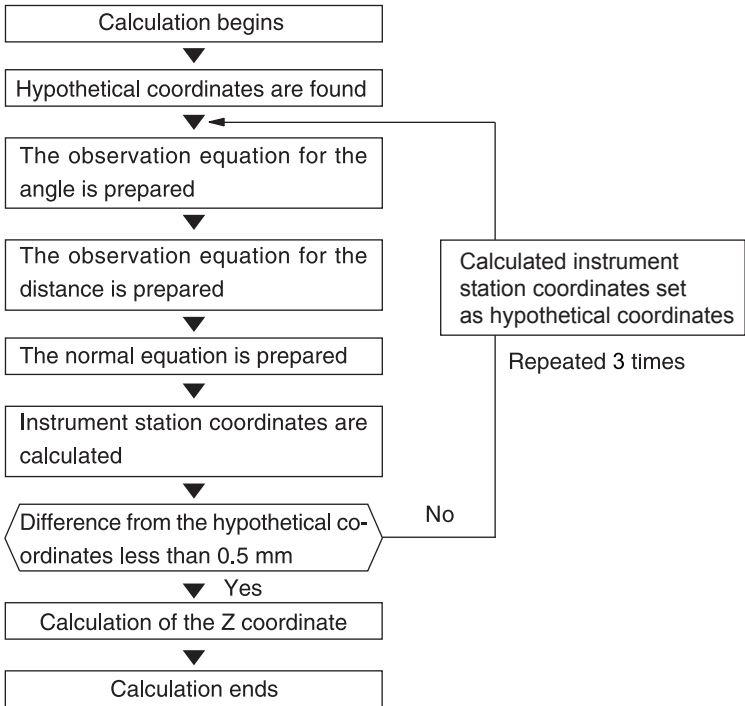




Precaution when performing resection

In some cases it is impossible to calculate the coordinates of an unknown point (instrument station) if the unknown point and three or more known points are arranged on the edge of a single circle.

An arrangement such as that shown below is desirable.






 It is sometimes impossible to perform a correct calculation in a case such as the one below.



When they are on the edge of a single circle, take one of the following measures.

   
- (1) Move the instrument station as close as possible to the center of the triangle.
- (2) Observe one more known point which is not on the circle.
- (3) Perform a distance measurement on at least one of the three points.



- In some cases it is impossible to calculate the coordinates of the instrument station if the included angle between the known points is too small. It is difficult to imagine that the longer the distance between the instrument station and the known points, the narrower the included angle between the known points. Be careful because the points can easily be aligned on the edge of a single circle.

13. COORDINATE MEASUREMENT

By performing coordinate measurements it is possible to find the 3-dimensional coordinates of the target based on station point coordinates, instrument height, target height, and azimuth angles of the backsight station which are entered in advance.

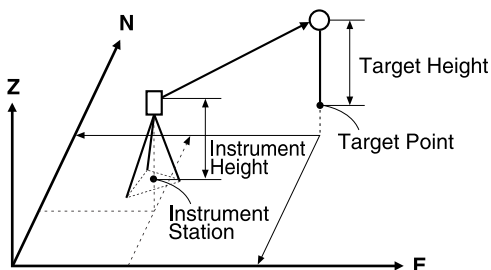

- EDM setting can be done in coordinate measurement menu.
 🔧 Setting items: "31.2 EDM Settings"

PROCEDURE 3-D Coordinate Measurement

The coordinate values of the target can be found by measuring the target based on the settings of the instrument station and backsight station.

The coordinate values of the target are calculated using the following formulae.

$$N1 \text{ Coordinate} = N0 + S \times \sin Z \times \cos Az$$

$$E1 \text{ Coordinate} = E0 + S \times \sin Z \times \sin Az$$

$$Z1 \text{ Coordinate} = Z0 + S \times \cos Z + ih - th$$


N0: Station point N coordinate S: Slope distance ih: Instrument height

E0: Station point E coordinate Z: Zenith angle th: Target height

Z0: Station point Z coordinate Az: Direction angle



Z (zenith angle) is calculated as $360^\circ - Z$ when the telescope is in the face 1 position.

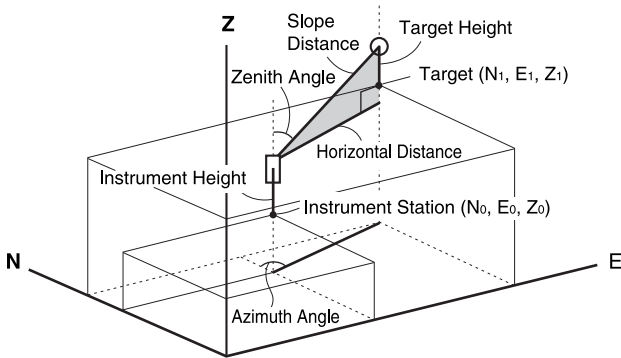

- If not measured or the space is left blank "Null" will be displayed.
If station point Z coordinate is set to "Null" the observation result for the Z coordinate is automatically set to "Null".

PROCEDURE

1. Sight the target at the target point.
2. In the third page of OBS mode screen, press **[MENU]**, then select "Coordinate".
3. Select "Occ.orien." to set the instrument station data and azimuth angle of the backsight point.
4. In <Coord>, select "Observation". Pressing **[MEAS]** will start measurement, and the coordinate value of the target will be displayed. Press **[STOP]** to quit measurement.


Coord.
Occ.Orien.
 Observation
 EDM

Coord.
 Occ.Orien.
Observation
 EDM

13. COORDINATE MEASUREMENT

- The tilt screen is displayed if the instrument is out of level.

Level the instrument.

 "7.2 Levelling"



- Enter a target height, point name and code as needed.

- **[REC]**: records measurement results

- **[AUTO]**: starts measurement and automatically records results after **[STOP]** has been pressed.

 Recording method:

"27. RECORDING DATA -
TOPO MENU -"

N	240.490	
E	340.550	
Z	305.740	
HR	0.000m	
PT	P01	
REC	OFFSET	AUTO MEAS

5. Sight the next target and press **[MEAS]** or **[AUTO]** to begin measurement. Continue until all targets have been measured.

- When coordinate measurement is completed, press **{ESC}** to return to <Coord>.

Note

- In the screen displaying **[AUTO]**, press trigger key to perform automatic operation from distance measurement to recording.

14. SETTING-OUT MEASUREMENT

Setting-out measurement is used to set out the required point.

The difference between the previously input data to the instrument (the setting-out data) and the measured value can be displayed by measuring the horizontal angle, distance or coordinates of the sighted point.

The horizontal angle difference and distance difference are calculated and displayed using the following formulae.

Horizontal angle difference

dHA = Horizontal angle of setting-out data - measured horizontal angle

Distance difference

Distance Displayed item

Sdist: S-O S = measured slope distance - slope distance of setting-out data

Hdist: S-O H = measured horizontal distance - horizontal distance of setting-out data

Vdist: S-O V = measured height difference - height difference of setting-out data


- Setting out data can be input in various modes: coordinates, horizontal distance, slope distance, height difference and REM measurement.
- In slope distance, horizontal distance, height difference, and coordinate mode, registered coordinates can be recalled and used as setting-out coordinates. In slope distance, horizontal distance and height difference, S/H/V distances are calculated from the read in setting-out coordinate, instrument station data, instrument height, and target height.
- EDM settings can be set in the Setting-out measurement menu.
- If not measured or the space is left blank "Null" will be displayed.
If distance or angle of setting-out data is set to "Null" the Distance difference is automatically set to "Null"



- If the S-O data is set in the display other than <S-O Coord>, when the display is returned to <S-O Coord>, the data that has been input will be deleted.

14.1 Coordinates Setting-out Measurement

After setting the coordinates for the point to be set out, the CX calculates the setting-out horizontal angle and horizontal distance. By selecting the horizontal angle and then the horizontal distance setting-out functions, the required coordinate location can be set out.

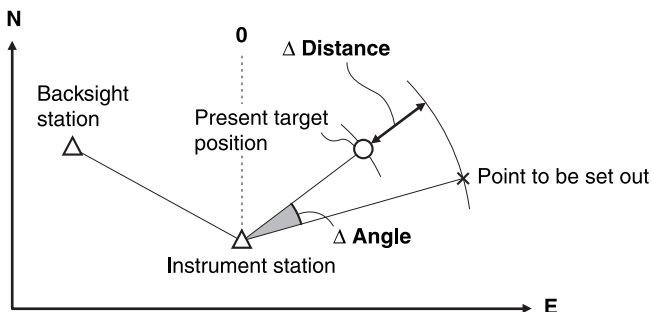

- To find the Z coordinate, attach the target to a pole etc. with the same target height.


PROCEDURE

1. Press [**S-O**] on the third page of the OBS mode screen to display <S-O>.
2. Select "Occ.orien." to set the instrument station data and azimuth angle of the backsight point.
☞ "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"
3. Select "S-O data". <S-O Coord> is displayed.

S-O
Occ.Orien
S-O data
Observation
EDM


4. Enter the coordinates of the setting-out point.
- When **[LOAD]** is pressed, registered coordinates can be recalled and used as setting-out coordinates.

S-O Coord	
Np:	100.000
Ep:	100.000
Zp:	50.000
HR	1.400m
[LOAD]	[DISP] [OK]

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"



- Pressing **[DISP]** switches between the distance input modes.




S-O HD	
Hdist:	3.300m
H ang:	40.0000
	P1
[LOAD]	[DISP] [OK]

5. Press **[OK]** to set the setting-out data.
- The tilt screen is displayed if the instrument is out of level.
Level the instrument.
-  "7.2 Levelling"

6. The difference in the distance and angle calculated with the set instrument station and the target point is displayed.
Rotate the top of the instrument until "dHA" is 0° and place the target on the sight line.

7. Press **[MEAS]** to begin setting-out measurement.
The target and the distance of the point to be set out is displayed (S-OΔHD).


S-OΔHD	0.820m	
dHA	0°09'40"	
HD	2.480m	
ZA	75°20'30"	
HA-R	39°05'20"	
[REC]	[DISP]	[← →] [MEAS]

S-OΔHD	0.820m	
dHA	0°09'40"	
HD	2.480m	
ZA	75°20'30"	
HA-R	39°05'20"	
—		[STOP]

14. SETTING-OUT MEASUREMENT

8. Move the prism forward and backward until the setting-out distance is 0m. If S-O Δ HD is "+", move the prism toward yourself, if it is "-", move the prism away from yourself.

- By pressing [$\leftarrow \rightarrow$], an arrow pointing to the left or right displays which direction the target should be moved.

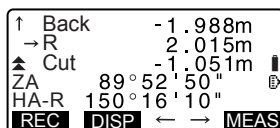


- ← : Move the prism to left.
- : Move the prism to right.
- ↓ : Move the prism forward.
- ↑ : Move the prism away.
- ▲ : Move the prism upward.
- ▼ : Move the prism downward.


When the target is within measurement range, all four arrows are displayed.

9. Press {ESC} to return to step 4.

- When [LOAD] was used in step 4, the list of registered coordinates is restored. Continue setting-out measurement.


- [REC]: records measurement results

 Recording method:
"27. RECORDING DATA -
TOPO MENU -"

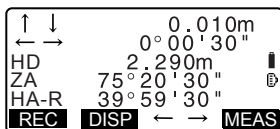

14.2 Distance Setting-out Measurement

The point to be found based on the horizontal angle from the reference direction and the distance from the instrument station.

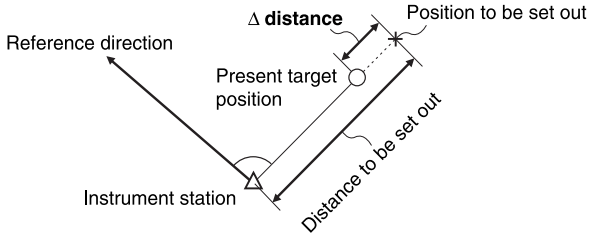


PROCEDURE

1. Press **[S-O]** in the third page of the OBS mode screen to display <S-O>.
2. Select "Occ.orien." to set the instrument station data and azimuth angle of the backsight point.
 - ☞ "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"
3. Select "S-O data."
4. Press **[DISP]** to change the distance input mode to <S-O H>.
 - Each time **[DISP]** is pressed: S-O Coord (coordinates), S-O HD (horizontal distance), S-O SD (slope distance), S-O VD (height difference), S-O Ht. (REM measurement).
 - ☞ 14.1 Coordinates Setting-out Measurement, 14.3 REM Setting-out Measurement

S-O HD	
H dist:	0.000m
H ang:	0°00'00" P1
LOAD	DISP OK

14. SETTING-OUT MEASUREMENT

- When [**LOAD**] is pressed, registered coordinates can be recalled and used. Distance and angle are calculated using the coordinate value.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

5. Set the following items.

- (1) Sdist/Hdist/Vdist: distance from the instrument station to the position to be set out.
- (2) H ang: included angle between the direction of the reference and the point to be set out.

S-O HD	
Hdist:	3.300m
H ang:	40.0000
LOAD	DISP P1 OK

- Pressing [**COORD**] in the second page allows you to enter the coordinates of the point to be set out.


S-O HD	
Hdist:	3.300m
H ang:	40° 00' 00"
COORD	P2

S-O HD	
Np:	100.000
Ep:	100.000
Zp:	50.000
HR	1.400m
REC	OK

6. Press [**OK**] to set the input values.



- The tilt screen is displayed if the instrument is out of level.


Level the instrument.

 "7.2 Levelling"

7. Rotate the top of the instrument until "dHA" is 0° and place the target on the sight line.

8. Press **[MEAS]** to start distance measurement. The target and the distance of the point to be set out is displayed (S-O Δ HD).
9. Move the prism to find the point to be set out.
10. Press **{ESC}** to return to <S-O>.

S-O Δ HD	0.820m	
dHA	0° 09' 40"	
HD	2.480m	
ZA	75° 20' 30"	
HA-R	39° 05' 20"	
REC	DISP	← → MEAS

- When **[LOAD]** was used in step 4, the list of registered coordinates is restored. Continue setting-out measurement.
- **[REC]**: records measurement results
 Recording method:
 "27. RECORDING DATA -
 TOPO MENU -"

14.3 REM Setting-out Measurement

To find a point where a target cannot be directly installed, perform REM setting-out measurement.


 11.6 REM Measurement

PROCEDURE

1. Install a target directly below or directly above the point to be found, then use a measuring tape etc. to measure the target height (height from the survey point to the target).

2. Press **[S-O]** in the OBS mode screen to display <S-O>.

3. Enter the instrument station data.

 "12.1 Entering Instrument Station Data and Azimuth Angle "

4. Select "S-O data" and press **[DISP]** until <S-O Ht.> is displayed.


5. Input height from the survey point to the position to be set out in "SO dist".


S-O Ht.	
Height:	<input type="text" value="3.300m"/>
HR	<input type="text" value="1.000m"/>
<input type="button" value="DISP"/>	<input type="button" value="OK"/>



6. After inputting the data, press **[OK]**.

- The tilt screen is displayed if the instrument is out of level.
Level the instrument.

 "7.2 Levelling"

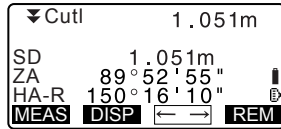7. Press **[REM]** to begin REM setting-out measurement. Move the telescope to find the point to be set out.
-  "14.2 Distance Setting-out Measurement" steps 9 to 10




-  : Move the telescope near the zenith.
-  : Move the telescope near the nadir.

8. When measurement is complete, press **[STOP]**. Pressing **[ESC]** returns to the screen in step 5.

15. SETTING-OUT LINE

Setting-out line is used for setting out a required point at a designated distance from the baseline and for finding the distance from the baseline to a measured point.

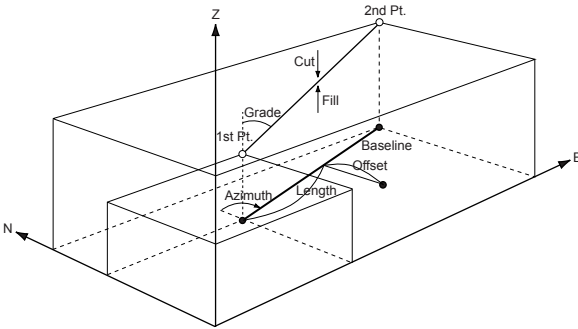

15.1 Defining Baseline


To perform setting-out line measurement, first, define the baseline. The baseline can be defined by inputting the coordinates of, or by observing the two points. The scale factor value is the difference between the input coordinates and the observed coordinates.

$$\text{Scale (X, Y)} = \frac{\text{Hdist}' \text{ (horizontal distance calculated from the measured value)}}{\text{Hdist} \text{ (horizontal distance calculated from the input coordinates)}}$$


- When not observing first or second points, scale factor is set to "1".
- Defined baseline can be used in both setting-out line measurement and point projection.

PROCEDURE Defining by inputting coordinates


1. In the second page of OBS mode screen, press [MENU], then select "S-O line".

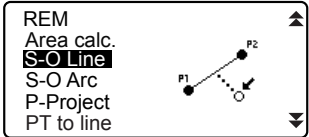

2. Enter the instrument station data.


 "12.1 Entering Instrument Station Data and Azimuth Angle"


3. Select "Define baseline" in <Set-out line>.

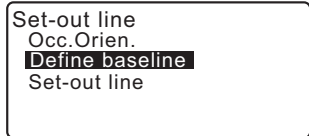


4. Enter the first point data and press **[OK]**.

- When **[LOAD]** is pressed, registered coordinates can be recalled and used.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

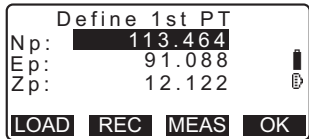


5. Enter the second point data.

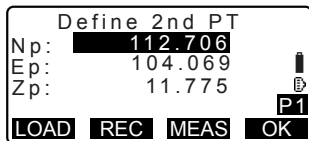

6. Press **{FUNC}**. **[OBS]** is displayed.

- When not observing the first point and the second point, go to step 11.

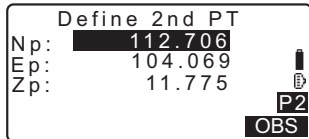

7. Press **[OBS]** on the screen of step 6 to move to observation of the first point.

15. SETTING-OUT LINE


8. Sight the first point and press **[MEAS]**.

The measurement results are displayed on the screen.

- Press **[STOP]** to stop the measurement.
- You can input target height here.
- The tilt screen is displayed if the instrument is out of level.

Level the instrument.


 "7.2 Levelling"

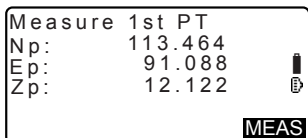

Measure 1st PT
Np: 113.464
Ep: 91.088
Zp: 12.122
[MEAS]

9. Press **[YES]** to use the measurement results of the first point.

- Press **[NO]** to observe the first point again.

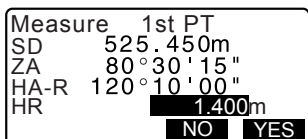


Measure 1st PT
SD 525.450m
ZA 80°30'15"
HA-R 120°10'00"
HR 1.400m
[NO] [YES]

10. Sight the second point and press **[MEAS]**.

11. Press **[YES]** to use the measurement results of the second point.


The distance between the two measured points, the distance calculated from inputting the coordinates of two points and the scale factors are displayed.

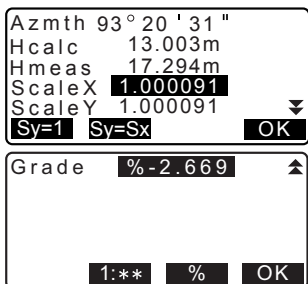

Azmth 93°20'31"
Hcalc 13.003m
Hmeas 17.294m
ScaleX 1.000091
ScaleY 1.000091
[Sy=1] [Sy=Sx] [OK]

Grade %-2.669
[1:] [%] [OK]**

12. Press **[OK]** on the screen of step 11 to define the baseline. <Set-out line> is displayed. Move to setting-line measurement.


 "15.2 Setting-out Line Point"/
"15.3 Setting-out Line Line"




Set-out line
Point
Line

- Press **[Sy=1]** to set scale factor y to "1".
- Press **[1 : **]** to change the grade display mode to "1 : * * = elevation : horizontal distance".

Note

- It is also possible to perform setting-out line measurement by pressing **[S-O LINE]** when allocated to the OBS mode screen.
 Allocating **[S-O LINE]**: "31.3 Allocating Key Functions".


PROCEDURE Defining by observation

1. In the second page of OBS mode screen, press **[MENU]**, then select "S-O line".
2. Enter the instrument station data.
 "12.1 Entering Instrument Station Data and Azimuth Angle"
3. Select "Define baseline" in <Set-out line>.
4. Sight the first point and press **[MEAS]**.

- Press **[STOP]** to stop the measurement.

- The tilt screen is displayed if the instrument is out of level.
Level the instrument.

 "7.2 Levelling"

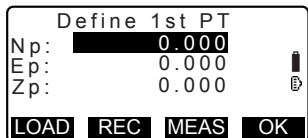

Define 1st PT
Np: 0.000
Ep: 0.000
Zp: 0.000
LOAD REC MEAS OK

15. SETTING-OUT LINE

5. Press **[OK]** to use the measurement results of the first point.
 - Press **[MEAS]** to observe the first point again.
 - Press **[HT]** to input instrument and target height.

6. Sight the second point and press **[MEAS]**.

7. Press **[OK]** to use the measurement results of the second point.
 - Press **[MEAS]** to observe the second point again.
 - Press **[HT]** to input instrument and target height.
 - Scale factor settings can be set in the screen shown at right.

8. Press **[OK]** on the third screen of step 7 to define the baseline. <Set-out line> is displayed. Move to setting-line measurement.
 - ☞ "15.2 Setting-out Line Point"/
"15.3 Setting-out Line Line"
 - Press **[Sy=1]** to set scale factor y to "1".

Np:	113.464
Ep:	91.088
Zp:	12.122
ZA	90° 00' 00"
HA-R	120° 10' 00"
REC	HT MEAS OK

Define 2nd PT	
Np:	0.000
Ep:	0.000
Zp:	0.000
LOAD	REC MEAS OK

Np:	113.464
Ep:	145.874
Zp:	13.212
ZA	90° 00' 00"
HA-R	120° 10' 00"
REC	HT MEAS OK

Azimuth	93° 20' 31"
Hcalc	13.003m
Hmeas	17.294m
ScaleX	1.000091
ScaleY	1.000091
Sy=1	Sy=Sx OK

Grade	%-2.669
1:**	% OK

Set-out line
Point
Line

- Press [1 : **] to change the grade display mode to “1 : * * = elevation : horizontal distance”.




- It is also possible to perform setting-out line measurement by pressing [S-O LINE] when allocated to the OBS mode screen.
 Allocating [S-O LINE]: "31.3 Allocating Key Functions".

15.2 Setting-out Line Point


Setting-out line point measurement can be used to find the required point coordinate by inputting the length and offset based on the baseline.

- Before performing setting-out line point, the baseline must be defined.

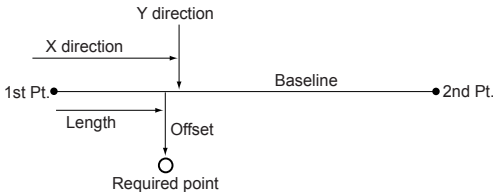


PROCEDURE

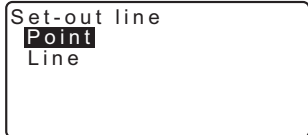

1. Select "Point" in <Set-out line>

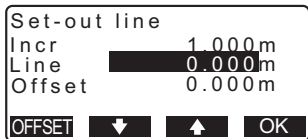

2. Set the following items.
 - (1) Incr: Increment by which line length and offset can be decreased/increased using the arrow softkeys.




15. SETTING-OUT LINE

- (2) Line: Distance along the baseline from the first point to the position at which a line extending from the required point intersects the baseline at right angles (X direction).
 - (3) Offset: Distance from the required point to the position at which a line extending from the required point intersects the baseline at right angles (Y direction).
 - **[↓]/[↑]**: Press to decrease/increase the value by the amount set in "Incr".
3. Press **[OK]** on the screen of step 2. The coordinate value of the required point is calculated and displayed.
- **[REC]**: records the coordinate value as a known point data.
 -  Recording method:
"29.1 Registering/Deleting Known Point Data"
 - Press **[S-O]** to move to setting-out measurement of the required point.
 -  "14. SETTING-OUT MEASUREMENT"
4. Press **{ESC}**. Continue the measurement (repeat steps from 2).

Set-out line	
N	111.796
E	94.675
Z	12.024
REC	S-O

PROCEDURE Offsetting the baseline

The baseline can be offset in three dimensions using four methods: lengthwise offset, lateral offset, height offset, and rotation angle offset.

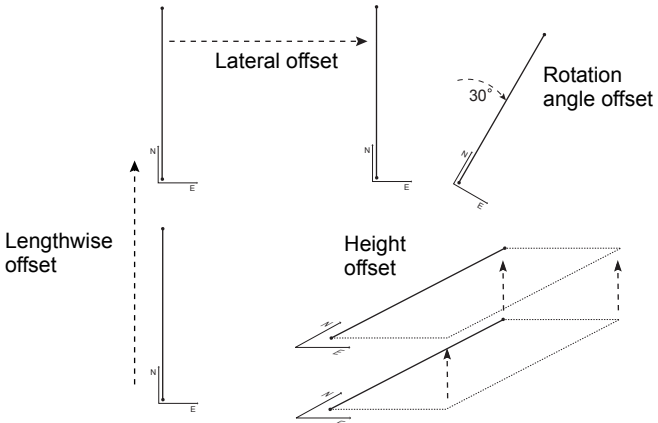

1. Select "Point" in <Set-out line>

Set-out line
Point
Line

2. Press **[OFFSET]** to display <Baseline offset>.

Set-out line
Incr 1.000m
Line 0.000m
Offset 0.000m
OFFSET ↓ ↑ OK

3. Set the following items.
 - (1) Incr: Increment by which offsets can be decreased/increased using the arrow softkeys.
 - (2) Length: Lengthwise offset
 - (3) Lateral: Lateral offset
 - (4) Height: Elevation offset
 - (5) Rt.ang: Rotation angle offset
 - **[↓]/[↑]**: Press to decrease/increase the value by the amount set in "Incr".

Baseline offset
Incr 1.000m
Length 0.000m
Lateral 0.000m
Height 0.000m ↓
MOVE ↓ ↑ OK

Rt.ang 0.0000 ↑
MOVE OK

15. SETTING-OUT LINE


- Press **[OK]** to return to the screen in step 2.
 - [MOVE]**: Permanently moves the baseline coordinates by the amount set in <Baseline offset>.
- Press **[OK]** on the screen of step 2. The coordinate value of the required point is calculated, taking into account the movement of the baseline, and displayed.

Set-out line	
N	185.675
E	102.482
Z	9.662
REC	S-O

15.3 Setting-out Line Line

Setting-out line line measurement tells how far horizontally the measured point is from the baseline and how far vertically the measured point is from the connected line. The baseline can be offset in a horizontal direction if necessary.

- Before performing setting-out line line, the baseline must be defined.

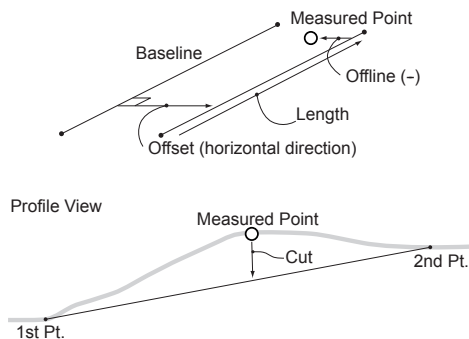


PROCEDURE

- Select "Line" in <Set-out line>.

Set-out line
Point
Line


2. Enter the offset value.


- Offset: How much to move the baseline.
A positive value indicates right side and a negative value indicates left side.
- When not setting offset value, go to step 3.

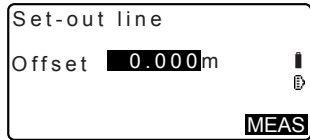3. Sight the target and press **[MEAS]** on the screen of step 2.
The measurement results are displayed on the screen.
Press **[STOP]** to stop the measurement.

- The tilt screen is displayed if the instrument is out of level.

Level the instrument.

 "7.2 Levelling"

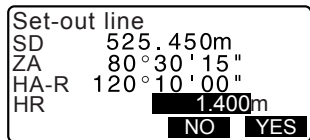
4. Press **[YES]** to use the measurement results.
Displays the difference between the measured point and the baseline.

- Offline: A positive value indicates the point is on the right of the baseline and a negative value indicates it is on the left.
- "Cut" indicates that the point is below the baseline.
- "Fill" indicates that the point is above the baseline.
- Length: Distance along the baseline from the first point to the measured point.
- Press **[NO]** to observe the target again.

15. SETTING-OUT LINE

5. Sight the next target and press **[MEAS]** to continue the measurement.

- Press **[REC]**: records measurement results.


 Recording method:
"27. RECORDING DATA -
TOPO MENU -"

Set-out line	
Offline	-0.004m
Cut	0.006m
Length	12.917m

[REC] **[MEAS]**

16. SETTING-OUT ARC

This mode allows the operator to define an arc from various arc parameters, such as From Pt. coordinates, and set out this arc as well as points (offsets) along it.

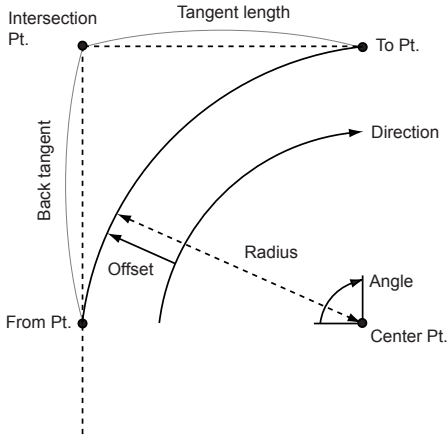


16.1 Defining an Arc

An arc can be defined by inputting arc parameters such as arc radius, angle, coordinates for the From point, Center point, To point etc. An arc can also be defined by observation of the From point, Center point, To point etc.

PROCEDURE Defining by inputting coordinates


1. In the second page of the OBS mode screen, press **[MENU]**, then select "S-O arc".
2. Enter the instrument station data.
☞ "12.1 Entering Instrument Station Data and Azimuth Angle"

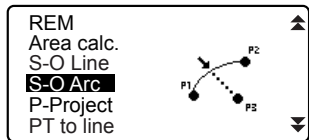

16. SETTING-OUT ARC

3. Select "Define arc" in <Set-out arc>.

- When **[LOAD]** is pressed, registered coordinates can be recalled and used.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

```
Set-out arc
Stn.Orien.
Define arc
Set-out arc
```

4. Enter the arc From point data and press **[OK]**.

5. Press **[▶]**/**[◀]** to select coordinates then press **[OK]**.

```
From Pt.
Np : ██████████ 0.000
Ep : 0.000
Zp : 0.000
LOAD REC MEAS OK
```

To : Enter arc To point.

To/Center : Enter arc To point and Center point.

To/Intersect : Enter arc To point and Intersect point (intersection of the tangents).

Center : Enter arc Center point.

Intersect : Enter arc Intersect point.

Center/Intersect: Enter arc Center point and Intersect point (intersection of the tangents).

```
Select Pt.
To
OK
```

6. Enter the coordinates specified in step 5.

7. Press **[OK]** to proceed to arc parameter input.

```
To Pt.
Np : ██████████ 0.000
Ep : 0.000
Zp : 0.000
LOAD REC MEAS OK
```

- When entering multiple coordinates, **[NEXT]** is displayed instead of **[OK]**. Press **[NEXT]** to input data for the next point.

8. Enter other arc parameters.

- Direction (whether the arc turns right/left from the From point)
- Radius (radius of the arc)
- Angle (subtended angle)
- Arc (distance along the arc)
- Chord (straight line distance between the From and To points)
- Tan In (tangent length)
- Bk tan (back tangent length)

Direction:	Left
Radius:	<Null>
Angle :	<Null>
Arc :	<Null>
Chord :	141.421m
OK	

Tan In:	<Null>
Bk tan:	<Null>
OK	



Parameters that can be entered may be restricted depending on the coordinates specified in step 5.



"Specifying coordinates and curve parameters"

9. Enter curve parameters then press **{ENT}**. Other parameters will be calculated.

- [TO]**: Calculated coordinates for To point can be recorded.


[CENTER]: Calculated coordinates for Center point can be recorded.

[INTSCT]: Calculated coordinates for Intersect point can be recorded.

Direction:	Right
Radius :	100.000m
Angle :	90°00'00"
Arc :	157.080m
Chord :	141.421m
CENTER	INTSCT
OK	


16. SETTING-OUT ARC

10. Press **[OK]** on the screen of step 9 to define the arc. <Set-out arc> is displayed. Move to setting-out arc measurement.

 "16.2 Setting-out Arc" step 2




- It is also possible to perform setting-out arc measurement by pressing **[S-O ARC]** when allocated to the OBS mode screen.

 Allocating **[S-O ARC]**: "31.3 Allocating Key Functions"

PROCEDURE Defining by observation

1. In the second page of OBS mode screen, press **[MENU]**, then select "Set-out arc".

2. Enter the instrument station data.


 "12.1 Entering Instrument Station Data and Azimuth Angle"

3. Select "Define arc" in <Set-out arc>.

4. Sight the From point and press **[MEAS]**.

- Press **[STOP]** to stop the measurement.
- The tilt screen is displayed if the instrument is out of level.
Level the instrument.

 "7.2 Levelling"

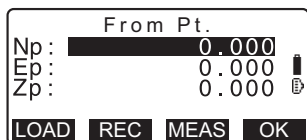

5. Press **[OK]** to use the measurement results of the From point.

- Press **[MEAS]** to observe the first point again.
- Press **[HT]** to input instrument and target height.

Np:	113.464
Ep:	91.088
Zp:	12.122
ZA	90° 00' 00"
HA-R	120° 10' 00"
REC	HT MEAS OK

6. Press **[→]/[←]** to select coordinates then press **[OK]**.

Select Pt.
To
OK

7. Sight the To/Center/Intersect point and press **[MEAS]**.

To Pt.	
Np:	0.000
Ep:	0.000
Zp:	0.000
LOAD	REC MEAS OK

8. Press **[OK]** to use the measurement results of the To/Center/Intersect point.

- Press **[MEAS]** to observe the second point again.
- Press **[HT]** to input instrument and target height.
- When entering multiple points, **[NEXT]** is displayed instead of **[OK]**. Press **[NEXT]** to observe the next point.

Np:	113.464
Ep:	91.088
Zp:	12.122
ZA	90° 00' 00"
HA-R	120° 10' 00"
REC	HT MEAS OK


16. SETTING-OUT ARC



9. Enter other arc parameters.

- (1) Direction (whether the arc turns right/left from the From point)
- (2) Radius (radius of the arc)
- (3) Angle (subtended angle)
- (4) Arc (distance along the arc)
- (5) Chord (straight line distance between the From and To points)
- (6) Tan In (tangent length)
- (7) Bk tan (back tangent angle)

Direction:	Left
Radius:	<Null>
Angle :	<Null>
Arc :	<Null>
Chord :	141.421m
	OK

Tan In:	<Null>
Bk tan:	<Null>
	OK

 Parameters that can be entered may be restricted depending on the coordinates specified in step 5.

  "Specifying coordinates and curve parameters"

10. Enter curve parameters then press **{ENT}**. Other parameters will be calculated.


- **[TO]**: Observation data for To point can be recorded.

[CENTER]: Observation data for Center point can be recorded.

[INTSCT]: Observation data for Intersect point can be recorded.


Direction:	Right
Radius :	100.000m
Angle :	90°00'00"
Arc :	157.080m
Chord :	141.421m
	CENTER INTSCT OK

11. Press **[OK]** on the screen of step 10 to define the arc. <Set-out arc> is displayed. Move to setting-out arc measurement.

 "16.2 Setting-out Arc" step 2



- It is also possible to perform setting-out arc measurement by pressing **[S-O ARC]** when allocated to the OBS mode screen.

 Allocating **[S-O ARC]**: "31.3 Allocating Key Functions"



Specifying points and curve parameters

Parameters that can be entered may be restricted depending on the points specified in step 5/6. Parameters that can be entered are marked with a circle (○). Those that cannot are marked with a cross (×).

Parameters Set coord	Radius	Angle	Arc	Chord	Tan In	Bk tan	Directi on
To pt Center pt	×	×	×	×	×	×	○
To pt Intersect pt	×	×	×	×	×	×	○
Center pt Intersect pt	×	×	×	×	×	×	○
To pt	○	○	○	×	○	○	○
Center pt	×	○	○	○	○	×	○
Intersect pt	○	○	×	○	×	×	○



Precaution when performing setting-out arc

In the following cases parameters cannot be calculated:

when Radius < $\frac{\text{Chord}}{2}$


When Arc < Chord

When Tan In × 2 < Chord

When the included angle between the back tangent and the azimuth angle between the From Pt. and To Pt is 0°, or exceeds 180°.

16.2 Setting-out Arc

Setting-out arc measurement can be used to find the coordinates of required points along the arc by inputting the arc (or chord) length and offset based on the arc.

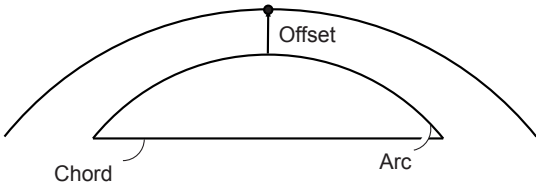

- Before performing setting-out arc, the arc must be defined.

PROCEDURE

1. Select "Set-out arc" in <Set-out arc>.
2. Set the following items.
 - (1) Incr: Increment by which values can be decreased/ increased using the arrow softkeys.
 - (2) Arc: Distance along the defined arc from the From point to the required point.
 - (2) Chord: Distance along the chord of the defined arc from the From point to the required point.

```

Set-out arc
Stn.Orien.
Define arc
Set-out arc
    
```

```


Set-out arc
Incr : 1.000m
Arc : 20.000m
Offset: 5.000m
CHORD [DOWN] [UP] OK P1
    
```

(3) Offset: Distance from the required point to the position on a curve parallel to the original defined arc. A positive value indicates an offset arc to the right, and a negative value indicates an arc to the left.

- Press **[CHORD]** to switch to Chord input.
- **[↓]/[↑]**: Press to decrease/increase the value by the amount set in "Incr".

Set-out arc			
Incr :	1.000m		
Chord :	0.000m		
Offset :	0.000m		
P1			
ARC	↓	↑	OK

3. Press **[OK]** on the screen of step 2. The coordinate value of the required point is calculated and displayed.

- **[REC]**: records the coordinate value as a known point data.
 Recording method:
 "29.1 Registering/Deleting Known Point Data"
- Press **[S-O]** to move to setting-out measurement of the required point.

 "14. SETTING-OUT MEASUREMENT"


Set-out arc	
N	118.874
E	106.894
Z	12.546
REC	S-O

4. Press **{ESC}**. Continue the measurement (repeat steps from 2).

16. SETTING-OUT ARC

PROCEDURE Offsetting the arcline

The arcline can be offset in three dimensions using four methods: lateral offset, rotation angle offset, lengthwise offset, and height offset.

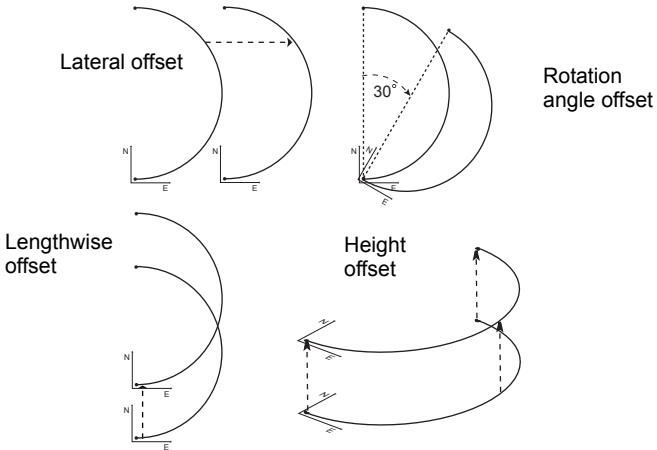

1. Select "Set-out arc" in <Set-out arc>.

2. Press **{FUNC}**, and then press **[OFFSET]** to display <Arcline offset>.

Set-out arc	
Incr :	1.000m
Arc :	20.000m
Offset :	5.000m
P2	
OFFSET	

3. Set the following items.

(1) Incr: Increment by which offsets can be decreased/increased using the arrow softkeys.

(2) Length: Lengthwise offset

(3) Lateral: Lateral offset

(4) Height: Elevation offset

(5) Rt.ang: Rotation angle offset

• **[↓]/[↑]**: Press to decrease/increase the value by the amount set in "Incr".

Arcline offset			
Incr	1.000m		
Length	0.000m		
Lateral	0.000m		
Height	0.000m		
MOVE	↓	↑	OK


Rt.ang	0.0000	↑
MOVE	OK	

4. Press **[OK]** to return to the screen in step 2.
 - **[MOVE]**: Permanently moves the baseline coordinates by the amount set in <Arcline offset>.
5. Press **[OK]** on the screen of step 2. The coordinate value of the required point is calculated, taking into account the movement of the arcline, and displayed.

Set-out arc	
N	118.874
E	106.894
Z	12.546
REC	S-O

17. POINT PROJECTION

Point projection is used for projecting a point onto the baseline. The point to project can be either measured or input. Displays the distances from the first point and point to project to the position at which a line extending from point to project intersects the baseline at right angles.

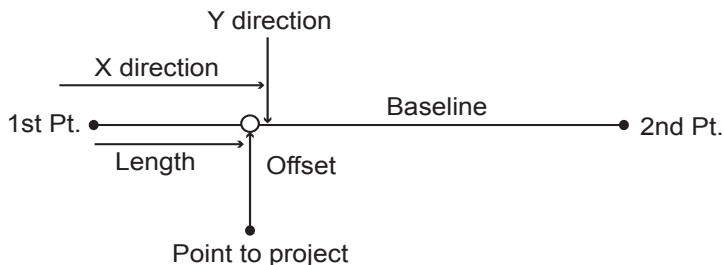


17.1 Defining Baseline

- Defined baseline can be used in both setting-out line measurement and point projection.


PROCEDURE

1. In the second page of OBS mode screen, press **[MENU]**, then select "P-Project".

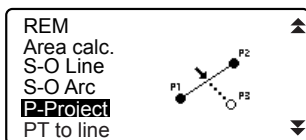

2. Enter the instrument station data then define the baseline.
 "15.1 Defining Baseline" step 2 to 12

3. Press **[OK]** to define the baseline.
<Point projection> is displayed.
Move to point projection measurement.
 "17.2 Point Projection"

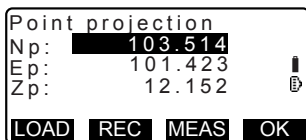



- It is also possible to perform point projection measurement by pressing **[P-PROJ]** when allocated to the OBS mode screen.


Allocating the function key: "31.3 Allocating Key Functions"

17.2 Point Projection


Before performing point projection, the baseline must be defined.

PROCEDURE

- Define the baseline.
 - "17.1 Defining Baseline"
- Select "Point Projection" in <Point Projection>.

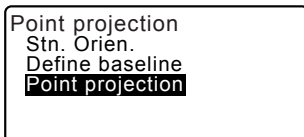

- Enter the point coordinate.
 - Press **[MEAS]** to observe the point to project.
 - The tilt screen is displayed if the instrument is out of level.

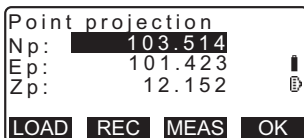

Level the instrument.

"7.2 Levelling"

- Press **[REC]** to record the data as a known point.

Recording method:
"29.1 Registering/Deleting
Known Point Data"


17. POINT PROJECTION

4. Press **[OK]** on the screen of step 3.


The following items are calculated and displayed.

Point projection	
Length	10.879m
Offset	9.340m
d.Elev	0.321m
REC	XYZ
	S-O

 - Length: Distance along the baseline from the first point to the projected point (X direction).
- Offset: Distance from point to project to the position at which a line extending from point of project intersects the baseline at right angles. (Y direction).
- d.Elev: Elevation between the baseline and the projected point.
- Press **[XYZ]** to switch the screen display to coordinate values.
- Press **[OFFSET]** to switch the screen display to distance values.
- Press **[REC]**: records the coordinate value as a known point data.

 Recording method:
"29.1 Registering/Deleting
Known Point Data"

 - Press **[S-O]** to move to setting-out measurement of the projected point.

 "14. SETTING-OUT
MEASUREMENT"

5. Press **{ESC}**. Continue the measurement (repeat steps from 3).


18. TOPOGRAPHY OBSERVATION

In topography observation, the instrument observes each target point once, clockwise from the backsight direction and record the observed data. It is also possible to conduct topography RL observation which observes the target point once from each of the "Right" and the "Left" of the scope.

Topography observation

Order of observation


- (1) R1
- (2) R2
- (3) BR3

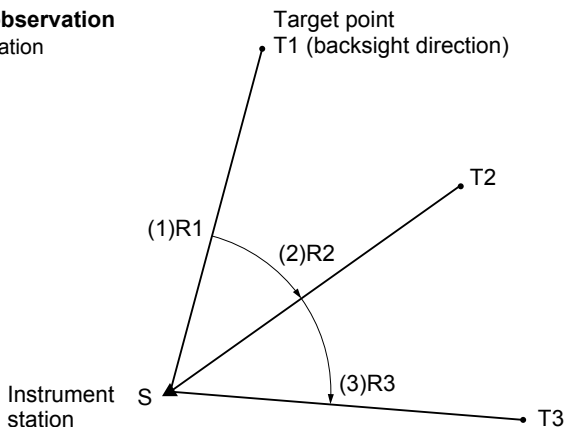

Topography RL observation


Order of observation

- (1) R1
- (2) L1
- (3) R2
- (4) L2
- (5) R3
- (6) L3

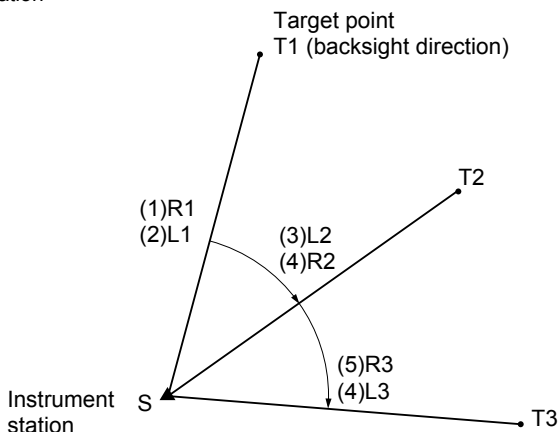

18. TOPOGRAPHY OBSERVATION

The flow of topography observation is as follows:

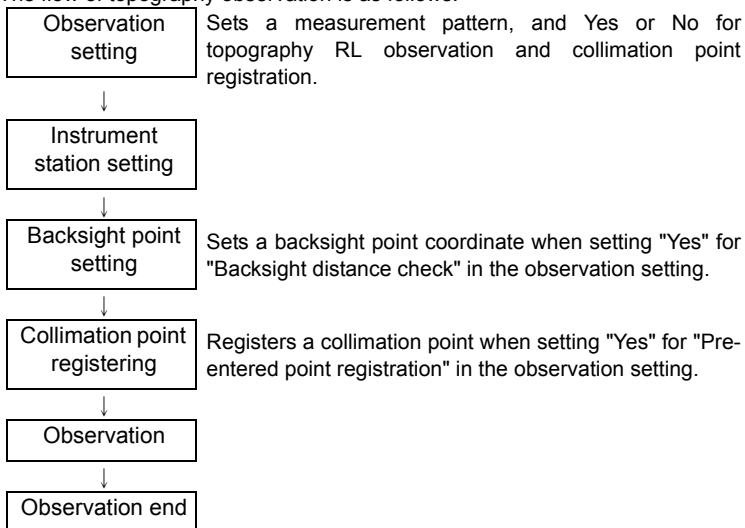


18.1 Observation Setting

Perform observation setting prior to topography observation.

- Up to 40 collimation points can be registered.
- It is possible to register up to 8 combination patterns for the number of distance sets, the number of distance readings, Yes or No for RL observation, pre-entered point registration, backsight distance measurement and backsight distance check.

PROCEDURE

1. Enter the topography observation menu screen.
On the second page of the OBS mode, press **[Menu]**, then select "Topography".

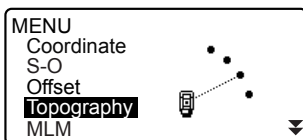

2. Set for topography observation.

Set the following items:

- (1) Number of distance sets (No. of SETs)
- (2) Number of distance readings (No. of Obs)
- (3) RL observation (F1/F2 Obs)
- (4) Pre-entered point registration (PreenterPt)
- (5) Backsight distance measurement (BS Obs-Dist)
- (6) Backsight distance check (BS DistCheck)

 
PTTRN: HOU2
No of SETs :1
No of Obs :1
F1/F2 Obs :No
PreenterPt :Yes
PTTRN OK ▼

BS Obs-Dist :Yes
BS HDistChc :Yes
PTTRN OK ▲

- Press **[PTTRN]** to register the combination of settings as a pattern or to read the registered patterns.
- Position the cursor and press **[REC]** to register the currently-set pattern.


Select Obs pattern
01: HOU2
02: RL1
03:
04:
REC OK ▼

3. Press **[OK]** to confirm the setting.4. Enter the instrument station data. Press **[OK]** to confirm the entered data.

 "27.1 Recording Instrument Station Data"

N0:	0.000
E0:	0.000
Z0:	0.000
PT T2	
HI	0.000m
LOAD RESEC OK ▼	

- Press **[RESEC]** allows you to set only the instrument station by resection measurement.

 "12.2 Setting Instrument Station Coordinate with resection measurement"

18. TOPOGRAPHY OBSERVATION

5. Enter backsight point coordinates.

Enter the coordinates for the backsight point and press **[OK]**.
If "No" is set for (5) Backsight distance measurement (BS Obs-Dist) or (6) Backsight distance check (BS DistCheck) in the observation setting, this screen is not displayed.

Topography	
BS coord	
NBS:	0.000
EBS:	0.000
PT AUTO1000	
LOAD	OK

6. Register collimation point.

Set the name for the collimation point in advance. Press **[ADD]**, enter the point name and press **[OK]** to register.

After registering the point to be measured, press **[OK]** to move to measurement.

 "18.2 Observation"


PreenterPt			
01: T-1			
02: T-3			
03:			
04:			
ADD	DEL	EDIT	OK

PreenterPt	
PT	T-4

If "No" is set for (4) Pre-entered point registration (PreenterPt) in the observation setting, this screen is not displayed.

- Pressing **[DEL]** deletes the selected point.
- Pressing **[EDIT]** enables to change the name of the selected point.

 Note

- Pressing **[TOPO II]** in the OBS mode also enables the same procedure.
 **[TOPO II]** allocation: "31.3 Allocating Key Functions"
- Number of characters, range and choices of the setting are as follows (*is the default setting):
 - Number of distance sets: 1 * /2
 - Number of distance readings: 1 * (Fixed)
 - RL observation: Yes / No *
 - Pre-entered point registration: Yes / No *


- Backsight distance measurement (BS Obs-Dist): Yes (the distance is to be measured in the backsight direction) / No (only the angle is measured in the backsight direction) *
- Backsight distance check (BS DistCheck): Yes (Compares the backsight point coordinate and the measured value for the backsight point) / No *
- If "No" is set for "RL observation", "number of distance sets" is fixed at "1".
- If "Yes" is set for "RL observation", a choice for the "number of distance sets" is 1* / 2.
- "BS DistCheck" is set only when "Yes" is set for "BS Obs-Dist".

18.2 Observation

Begin topography observation according to the setting specified in "18.1 Observation Setting".

PROCEDURE Topography Observation

1. Perform observation setting following steps 1 to 6 in the "18.1 Observation Setting".
2. Measure the first direction. Collimate the first target. Press **[ANGLE]** or **[MEAS]** to start measuring. In "D=", the setting value for the Number of distance readings (No. of Obs) is displayed.

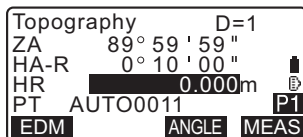

- Target height, point name and code can be entered before the measurement.
- If "No" is set for (5) Backsight distance measurement (BS Obs-Dist), **[MEAS]** is not displayed on the Topography screen.

18. TOPOGRAPHY OBSERVATION

- If "Yes" is set for (6) Backsight distance check (BS DistCheck), the variance for horizontal distance between the calculated value and the measured value is displayed after the measurement of the first point has been completed.
- Pressing **{ESC}** cancels the topography observation after checking is completed.

Topography	
BS HDistCheck	
calc HD	15.000m
Obs HD	13.000m
dHD	2.000m
OK	

3. Record measured data.

If a target height and code have not been set, enter the data here. Press **[OK]** to save the data. The screen for step 2 is displayed to measure the next point.

Topography	
PT AUTO0011	
HR	<input type="text" value="0.000"/> m
CD	
:	
OK	

Topography	
ZA	89° 59' 59"
HA-R	0° 10' 00"
SD	123.456m
D=1	
OK	

During the measurement for the second point and thereafter, if: (1) Number of distance sets (No. of SETs) is set to "1"; (2) Number of distance readings (No. of Obs) is set to "1"; and (3) RL observation (F1/F2 Obs) is set to "No"; **[OFFSET]** is displayed. Pressing **[OFFSET]** enables offset measurement of the target point.

[ESC] "19. OFFSET
MEASUREMENT"

Topography		D=1
ZA	89° 59' 59"	
HA-R	0° 10' 00"	
HR	<input type="text" value="0.000"/> m	
PT	AUTO0011	P1
EDM	OFFSET	ANGLE MEAS


4. End topography observation measurement.
After completing the observation, pressing **{ESC}** displays the completion confirmation message. Press **[YES]** to record the topography observation.
 - When the collimation point is registered, this message does not appear.



PROCEDURE Topography RL Observation

1. Perform observation setting following procedures 1~6 in the "18.1 Observation Setting". Set "YES" for "RL observation" in the observation setting.

2. Measure the target point in the R direction.
"R" appears next to the "Topography observation (Topography)"

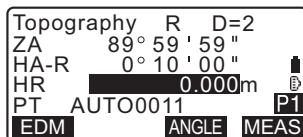


"PROCEDURE Topography Observation" step 2

3. Record the measured data.
 "PROCEDURE Topography Observation" step 3

4. Measure the target point in the L direction.

"L" appears next to the "Topography observation (Topography)." Record the measured data after the observation is completed.

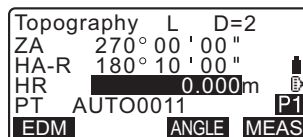

Steps 2 to 3

5. End the topography observation.
 "PROCEDURE Topography Observation" step 4



- In the screen displaying **[MEAS]**, pressing **{ENT}** or the trigger key functions in the same manner as pressing **[MEAS]**. Pressing the trigger key during successive measurement stops the measurement. In the measurement record screen, pressing the trigger key functions in the same manner as pressing **[OK]**.
- When "No" is set for "Pre-entered point registration (PreenterPt)", the point name must be entered in the screen recording measured data.
- In the screen recording measured data, items displayed vary according to the observation setting.


19. OFFSET MEASUREMENT

Offset measurements are performed in order to find a point where a target cannot be installed directly or to find the distance and angle to a point which cannot be sighted.

- It is possible to find the distance and angle to a point you wish to measure (target point) by installing the target at a location (offset point) a little distance from the target point and measuring the distance and angle from the survey point to the offset point.
- The target point can be found in the five ways explained below.

19.1 Single-distance Offset Measurement

Finding it by entering the horizontal distance from the target point to the offset point.

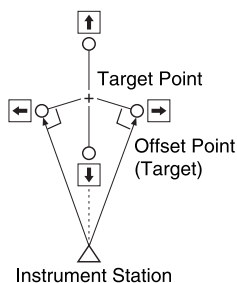


- When the offset point is positioned to the left or right of the target point, make sure the angle formed by lines connecting the offset point to the target point and to the instrument station is almost 90° .
- When the offset point is positioned in front of or behind the target point, install the offset point on a line linking the instrument station with the target point.

PROCEDURE

1. Set the offset point close to the target point and measure the distance between them, then set up a prism on the offset point.

19. OFFSET MEASUREMENT

2. Enter the instrument station data.

 "12.1 Entering Instrument Station Data and Azimuth Angle"


3. Press [**OFFSET**] in page three of OBS mode to display <Offset>.

4. Select "Offset/Dis".

- The tilt screen is displayed if the instrument is out of level.


Level the instrument.

 "7.2 Levelling"

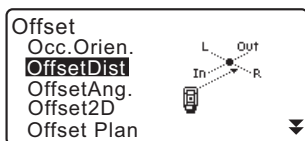

5. Sight the offset point and press [**MEAS**] in the first page of the OBS mode screen to begin measurement.

The measurement results are displayed. Press [**STOP**] to stop the measurement.

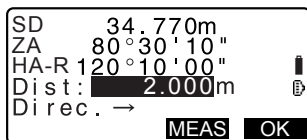

6. Input the following items.

- (1) Horizontal distance from the target point to the offset point.
- (2) Direction of the offset point.

- Direction of offset point

← : On the left of the target point.


→ : On the right of the target point.

↓ : Closer than the target point.

↑ : Beyond the target point.

- Press [**MEAS**] to re-observe the offset point.

7. Press **[OK]** on the screen of step 5 to calculate and display the distance and angle of the target point.

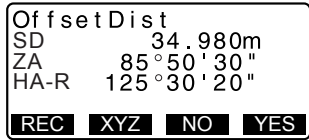

8. Press **[YES]** to return to <Offset>.


- Press **[XYZ]** to switch the screen display from distance values to coordinate values. Press **[HVD]** to return to distance values.
- Press **[NO]** to return to the previous distance and angle.
- To record the calculation result, press **[REC]**.

"27. RECORDING DATA - TOPO MENU -"

19.2 Angle Offset Measurement

Sighting the direction of the target point to find it from the included angle.

Install offset points for the target point on the right and left sides of and as close as possible to the target point and measure the distance to the offset points and the horizontal angle of the target point.

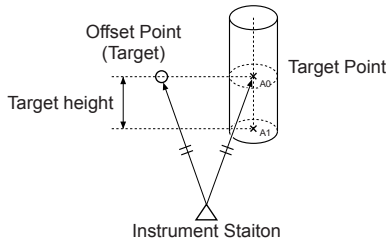


- During collimation of the measured point A0, the vertical angle can be fixed at the prism position or set to be moved according to the upward/downward movement of the telescope.
- If the vertical angle is set to be moved according to the movement of the telescope, slope distance (SD), vertical direction (VD), Z coordinate (Z) vary depending on the collimation height.

19. OFFSET MEASUREMENT

PROCEDURE

1. Set the offset points close to the target point (making sure the distance from the instrument station to the target point and the height of the offset points and the target point are the same), then use the offset points as the target.

 2. Enter the instrument station data.


 "12.1 Entering Instrument Station Data and Azimuth Angle"

- When directly calculating A1, the ground-level coordinate of the measured position A0:
Set the instrument and collimation heights.
- When calculating the coordinate of the measured position A0:
Set the instrument height only.
(Leave the collimation height at 0.)

3. Press **[OFFSET]** in page three of OBS mode to display <Offset>.



4. Select "OffsetAng." in <Offset>.

- The tilt screen is displayed if the instrument is out of level.
Level the instrument.

 "7.2 Levelling"



5. Sight the offset point and press **[MEAS]** in the first page of the OBS mode screen to begin measurement.
The measurement results are displayed. Press **[STOP]** to stop the measurement.
6. Accurately sight the direction of the target point and press **[OK]**.
The distance and angle of the target point are displayed.
7. After finishing measurement, press **[YES]** to return to <Offset>.

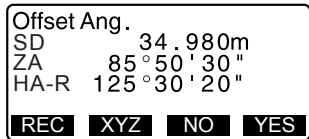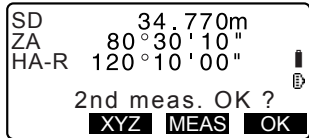


19.3 Two-distance Offset Measurement

By measuring the distances between the target point and the two offset points. Install two offset points (1st target and 2nd target) on a straight line from the target point, observe the 1st target and 2nd target, then enter the distance between the 2nd target and the target point to find the target point.


- It is possible to make this measurement easily using the optional equipment: the 2-point target (2RT500-K). When using this 2-point target, be sure to set prism constant to 0.

"7.2 Levelling"

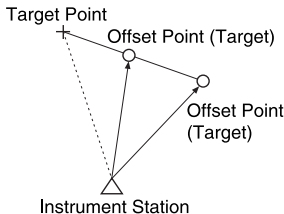

19. OFFSET MEASUREMENT

How to use 2-point target (2RT500-K)

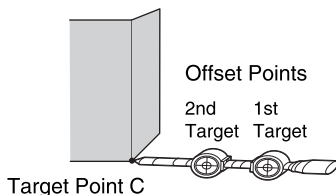

- Install the 2-point target with its tip at the target point.
- Face the targets toward the instrument.
- Measure the distance from the target point to the 2nd target.
- Set the reflector type to “sheet”.

PROCEDURE

1. Install two offset points (1st target, 2nd target) on a straight line from the target point and use the offset points as the target.

2. Press **[OFFSET]** in page three of OBS mode to display <Offset>.

3. Enter the instrument station data.
 "12.1 Entering Instrument Station Data and Azimuth Angle"

4. Select “Offset/2D” in <Offset>.



- The tilt screen is displayed if the instrument is out of level.
Level the instrument.

"7.2 Levelling"

5. Sight the 1st target and press **[MEAS]**.

Observation begins and the measurement results are displayed.

Press **[YES]**. The “2nd Target Observation Screen” is displayed.

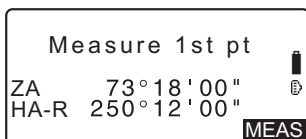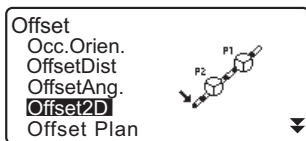

6. Sight the 2nd target and press **[MEAS]**.
The measurement results are displayed. Press **[YES]**.

N	10.480
E	20.693
Z	15.277
Confirm?	
	NO YES

7. Enter the distance from the 2nd target to the target point and press **[ENT]**. The coordinates of the target point are displayed.

B-C:	1.2000m
------	----------------


8. Press **[YES]**. <Offset> is restored.
- When **[HVD]** is pressed, display mode is switched from coordinates to SD, ZA, HA-R.

Of f set 2D	
N	10.480
E	20.693
Z	15.277
REC	HVD NO YES

19.4 Plane Offset Measurement

Find distance and coordinate of a edge of a plane where direct measuring can not be done.

Measure three random prism points to define the plane then sight the target point (P0) to calculate distance and coordinate of the cross point between telescope axis and of the defined plane.

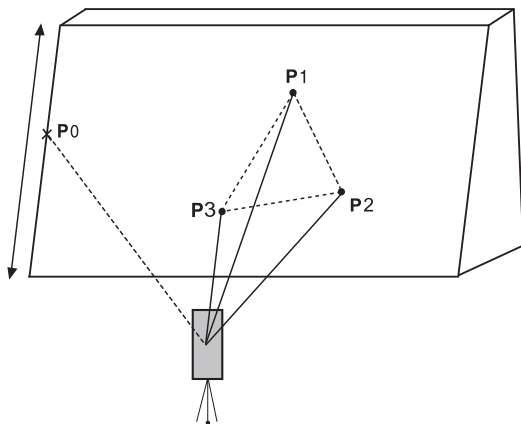



- Target height of P1 to P3 is set to 0 automatically.

PROCEDURE

1. Enter the instrument station data.
☞ "12.1 Entering Instrument Station Data and Azimuth Angle"
2. Press **[OFFSET]** in page three of OBS mode to display <Offset>.
3. Select "Offset Plan" in <Offset>.





4. Sight the first point (P1) on the plane and press **[MEAS]** to begin measurement.
The measurement results are displayed. Press **[YES]**.

Measure 1st pt		
ZA	73° 18' 00"	
HA-R	250° 12' 00"	
		MEAS

N	10.480
E	20.693
Z	15.277
Confirm?	
NO YES	

5. Sight the second point (P2) and the third point (P3) on the plane and press **[MEAS]**.
The measurement results are displayed. Press **[YES]** to define the plane.

Measure 3rd pt		
ZA	73° 18' 00"	
HA-R	250° 12' 00"	
		MEAS

6. Accurately sight the direction of the target point.
The distance and angle of the target point are displayed.

Offset Plane		
N	10.480	
E	20.693	
Z	15.277	
4th meas. OK ?		
REC	HVD	OK

- When **[HVD]** is pressed, display mode is switched from coordinates to SD, ZA, HA-R.
- To record the calculation result, press **[REC]**.

 "27. RECORDING DATA - TOPO MENU -"


Sight the next target point.

7. After finishing measurement, press **[OK]** in the screen of step 6 to return to <Offset>.

19.5 Column Offset Measurement

Find distance and coordinates of the center of the column.


If circumscription point (P1) and two circumscription points (P2, P3) of a column can be measured directly, the distance to the center of the column (P0), coordinates and azimuth angle are calculated and displayed.

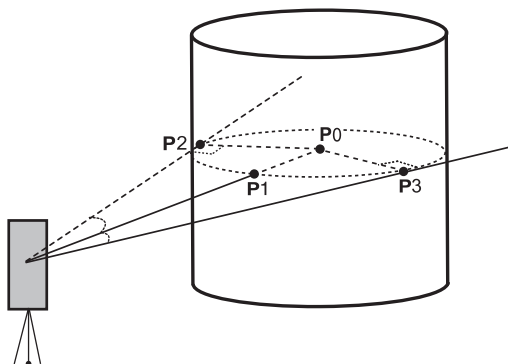


- The azimuth angle of the center of the column is 1/2 of total azimuth angle of circumscription points (P2) and (P3).

PROCEDURE


1. Enter the instrument station data.
 ☞ "12.1 Entering Instrument Station Data and Azimuth Angle"
2. Press **[OFFSET]** in page three of OBS mode to display <Offset>.
3. Select "Offset Clum" in <Offset>.

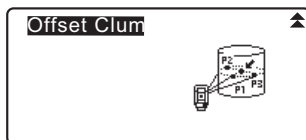


4. Sight the circumscription point (P1) and press **[MEAS]** to begin measurement.
The measurement results are displayed. Press **[YES]**.

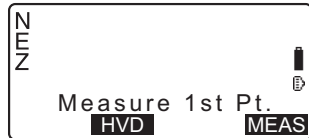


- When **[HVD]** is pressed, display mode is switched from coordinates to SD, ZA, HA-R.

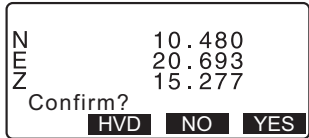


5. Sight the left circumscription point (P2) and press **[OK]**.

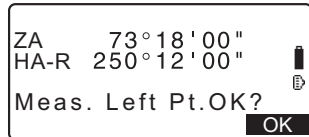

6. Sight the right circumscription point (P3) and press **[OK]**.

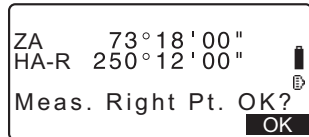

7. The coordinates of the target point (the center of the column P0) are displayed. Press **[REC]** to record the calculation result.
Press **[OK]** in the recording screen to return to <Offset>.

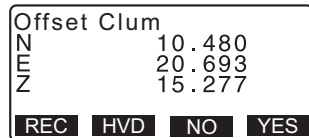


- Press **[YES]** to return to <Offset> without recording the calculation result.
- Press **[NO]** to return to step 3.

20. MISSING LINE MEASUREMENT

Missing line measurement is used to measure the slope distance, horizontal distance, and horizontal angle to a target from the target which is the reference (starting point) without moving the instrument.

- It is possible to change the last measured point to the next starting position.
- Measurement result can be displayed as the gradient between two points.

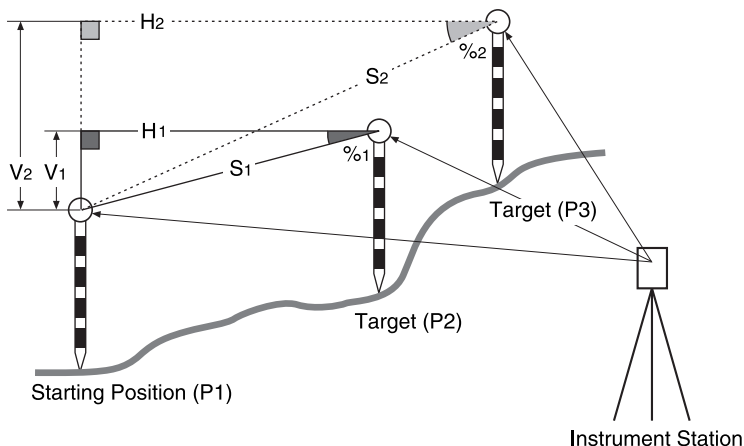

20.1 Measuring the Distance between 2 or more Points

The distance between two or more points can either be measured by observing the targets in question or calculating from input coordinates. A combination of these two methods (e.g. observing the 1st target and inputting 2nd target coordinates) is also possible.


PROCEDURE Measuring using observation

1. In the third page of OBS mode screen, press **[MLM]**, then select "MLM".

```
MLM
Occ.Orien.
MLM
```

2. Sight the 1st target and press **[MEAS]**.


- If the distance measurement data remains, the last measured distance data is set as the starting point, and the screen in step 3 is displayed.

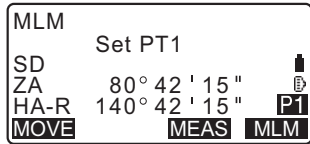

- The tilt screen is displayed if the instrument is out of level.
 Level the instrument.
 [F7] "7.2 Levelling"


3. Sight the second target and press **[MLM]** to begin observation.

- **[REC]**: records 1st target measurement results.

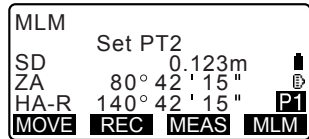

The following values are displayed:


- SD: Slope distance of the starting position and 2nd target.
- HD: Horizontal distance of the starting position and 2nd position.
- VD: Height difference of the starting position and 2nd target.

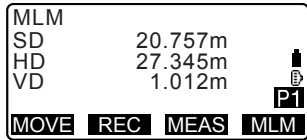

- Target height of the starting position and 2nd target can be input.


Press **[Tgt.h]** on the second page.

Input the target heights and press **[OK]**.

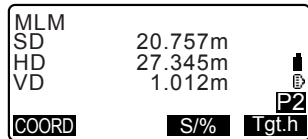

- Press **[COORD]** to input coordinates.

[F7] "PROCEDURE
 Calculating from input coordinates"

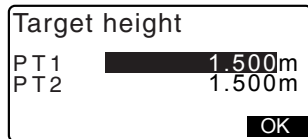

20. MISSING LINE MEASUREMENT

- Pressing **[REC]** displays the screen shown in right. Pressing **[OK]** records the measured results for the second point.

N	10.000	
E	20.000	
Z	30.000	
HR	1.500 m	
PT	1010	▼
OK		

Press **[OK]** to record missing line measurement results and return to the results screen.

HD	27.345m	A
VD	1.012m	2
PT1		3
PT2		
CD	1010	
ADD	LIST	SRCH OK


Press **{ESC}** to continue measurement without saving 2nd target or missing line measurement results.

MLM		
SD	20.757m	
HD	27.345m	
VD	1.012m	
		P1
MOVE	REC	MEAS MLM



- Missing line measurement results cannot be recorded when point names for 1st and/or 2nd target are null. Always input point names for both targets.
4. Sight the next target and press **[MLM]** to begin observation. Slope distance, horizontal distance and height difference between multiple points and the starting position can be measured this way.
- When **[S/%]** is pressed, the distance between two points (S) is displayed as the gradient between two points.
 - Press **[MEAS]** to re-observe the starting position. Sight the starting position and press **[MEAS]**.

 - When **[MOVE]** is pressed, the last target measured becomes the new starting position to perform missing line measurement of the next target.

 "20.2 Changing the Starting Point"

- Press **{ESC}** to end missing line measurement.

PROCEDURE Calculating from input coordinates

- In the third page of OBS mode screen, press **[MLM]**, then select "MLM".

```

MLM
Occ.Orien.
MLM
  
```

 
- Press **[COORD]** on the second page.

```

MLM          Set PT1
SD
ZA          80° 42' 15"
HA-R       140° 42' 15"
COORD      S/%  Tgt.h
  
```

- Input coordinates for the 1st target and press **[OK]**.

- When you wish to read in and set coordinate data from memory, press **[LOAD]**.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

```

PT1
N          20.000
E          30.000
Z          40.000
LOAD  REC  OK
  
```

- Select "PT2" and press **{ENT}** to proceed to 2nd target input.

```

Input Coord
PT1
PT2
  
```

20. MISSING LINE MEASUREMENT

5. Input coordinates for the 2nd target and press **[OK]**.

The following values are displayed:

SD: Slope distance of the starting position and 2nd target.

HD: Horizontal distance of the starting position and 2nd position.

VD: Height difference of the starting position and 2nd target.


MLM		
SD	20.757m	
HD	27.345m	
VD	1.012m	
		P1
MOVE	REC	MEAS MLM

- Target height of the starting position and 2nd target can be input.


Press **[Tgt.h]** on the second page.

Input the target heights and press **[OK]**.

Target height	
PT 1	1.500m
PT 2	1.500m
	OK

- Press **[COORD]** to re-input coordinates for the first or 2nd targets.
- Pressing **[REC]** displays the result recording screen for missing line measurement. Pressing **[OK]** records the measured results.
- When **[S/%]** is pressed, the distance between two points (S) is displayed as the gradient between two points.
- Press **[MEAS]** to observe the starting position.
 "PROCEDURE Measuring using observation"

- When **[MOVE]** is pressed, the last target measured becomes the new starting position to perform missing line measurement of the next target.

 "20.2 Changing the Starting Point"


6. Press **{ESC}** to end missing line measurement



Missing line measurement results cannot be recorded when point names for 1st and/or 2nd target are null. Always input point names for both targets.

20.2 Changing the Starting Point


It is possible to change the last measured point to the next starting position.

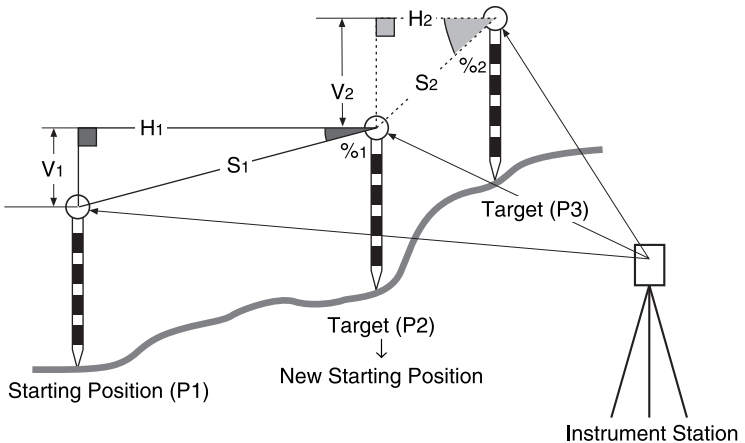

20. MISSING LINE MEASUREMENT

PROCEDURE

1. Observe the starting position and target.



 "20.1 Measuring the Distance between 2 or more Points"

2. After measuring the targets, press

[MOVE].

Press **[YES]**.


- Press **[NO]** to cancel measurement.

MLM		
SD	20.757m	
HD	27.345m	
VD	1.012m	
		P1
MOVE	REC	MEAS MLM

MLM	
	Move 1st meas ?
SD	34.980m
ZA	85°50'30"
HA-R	125°30'20"
	NO YES

3. The last target measured is changed to the new starting position.

 Perform missing line measurement.

 "20.1 Measuring the Distance between 2 or more Points".

21. SURFACE AREA CALCULATION


You can calculate the area of land (slope area and horizontal area) enclosed by three or more known points on a line by inputting the coordinates of the points.

Input

Output

Coordinates : P1 (N1, E1, Z1) Surface area: S (slope area and horizontal area)

...
P5 (N5, E5, Z5)

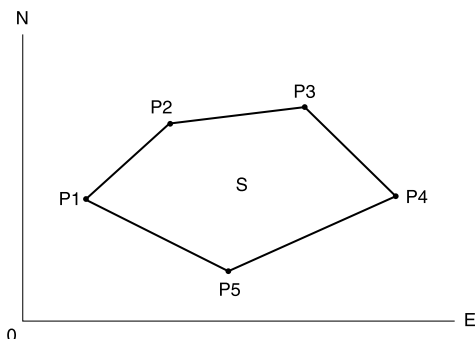

- Number of specified coordinate points: 3 or more, 50 or less
- Surface area is calculated by observing the points on a line enclosing an area in order or reading in the previously registered coordinates in order.



- If two or less points are used to measure an area, an error will occur.
- Be sure to observe (or recall) points on an enclosed area in a clockwise or counterclockwise direction. For example, the area specified by entering (or recalling) point names 1, 2, 3, 4, 5 or 5, 4, 3, 2, 1 implies the same shape. However, if points are not entered in numerical order, the surface area will not be calculated correctly.




Slope area

The first three points specified (measured/read-in) are used to create the surface of the slope area. Subsequent points are projected vertically onto this surface and the slope area calculated.

21. SURFACE AREA CALCULATION


PROCEDURE Surface area calculation by observing points

1. In the second OBS mode screen, press **[MENU]**, then select "Area calc."

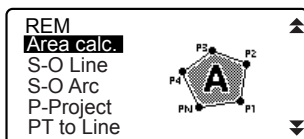

2. Enter the instrument station data.
 "12.1 Entering Instrument Station Data and Azimuth Angle"


3. Select "Area calculation" in <Area calculation>.

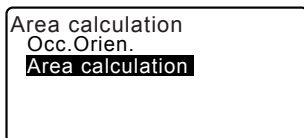


4. Sight the first point on the line enclosing the area, and press **[OBS]**.

- The tilt screen is displayed if the instrument is out of level.
Level the instrument.


"7.2 Levelling"

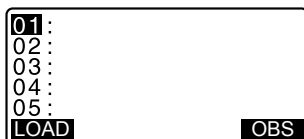

5. Press **[MEAS]** to begin observation.
The measured values are displayed.

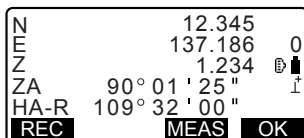


6. Press **[OK]** to enter the value of the first point in "01".
 - Press **[REC]** in the second screen of step 5 to record code, target height, and point name.
The point name recorded here will be displayed in "01".

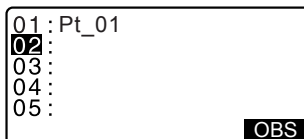

7. Repeat steps 4 to 6 until all points have been measured. Points on an enclosed area are observed in a clockwise or counterclockwise direction.

For example, the area specified by entering point names 1, 2, 3, 4, 5 or 5, 4, 3, 2, 1 implies the same shape.

After all known points necessary to calculate the surface area have been observed, **[CALC]** is displayed.

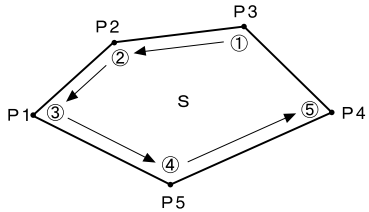

8. Press **[CALC]** to display the calculated area.

PT: number of set points
 SArea: slope area
 HArea: horizontal area

01 : Pt_01
02 : Pt_02
03 : Pt_03
04 : Pt_04
05 : Pt_05
CALC OBS

PT	5	
SArea	468.064 m ²	0.0468 ha
HArea	431.055 m ²	0.0431 ha
REC	OK	

9. Press **[REC]** in the screen of step 8 to record results and return to <Menu>.
 Press **[OK]** to return to <Menu> without recording results.

PROCEDURE Surface area calculation by reading in the points' coordinates

1. In the second OBS mode screen, press **[MENU]**, then select "Area calc."
2. Enter the instrument station data.
3. Select "Area calculation" in <Area calculation>.

21. SURFACE AREA CALCULATION

4. Press **[LOAD]** to display the list of coordinate data.

PT : Known point data saved in the current JOB or in the Coordinate Search JOB.

Crd./ Occ: Coordinate data saved in the current JOB or in the Coordinate Search JOB.

```
01: Pt_01
02:
03:
04:
05:
LOAD OBS
```

5. Select the first point in the list and press **{ENT}**.

The coordinates of the first point is set as "Pt.001".

```
Pt. Pt.001
Pt. Pt.002
Pt. Pt.004
Pt. Pt.101
Pt. Pt.102
↑↓·P FIRST LAST SRCH
```

6. Repeat steps 4 to 5 until all points have been read in.

Points on an enclosed area are read in a clockwise or counterclockwise direction.

After all known points necessary to calculate the surface area have been observed, **[CALC]** is displayed.

```
01: Pt.004
02:
03:
04:
05:
LOAD
```

7. Press **[CALC]** to display the calculated area.

```
PT 3
SArea 468.064 m2
0.0468 ha
HArea 431.055 m2
0.0431 ha
REC OK
```

8. Press **[REC]** in the screen of Step 7 to record results and return to <Menu>.

Press **[OK]** to return to <Menu> without recording results.




- It is also possible to perform area calculation by pressing **[AREA]** when allocated to the OBS mode screen.

Allocating **[AREA]**: "31.3 Allocating Key Functions"



22. INTERSECTIONS

It is possible to find an intersection point between 2 reference points by specifying the length or azimuth angle of either point.

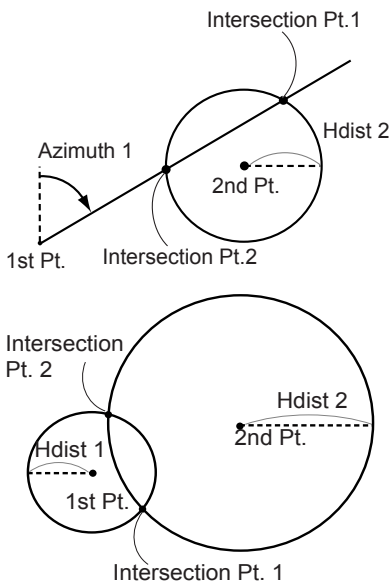


PROCEDURE

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Intersect."
2. Enter the 1st point data and press **[NEXT]**.

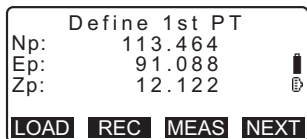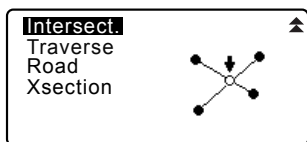

22. INTERSECTIONS


- When [**LOAD**] is pressed, registered coordinates can be recalled and used.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

- [**REC**]: records the coordinate value as a known point data.

N E Z PT	rec 3991
	5
OK	

- Press [**MEAS**] to observe the selected point.
- The tilt screen is displayed if the instrument is out of level.
Level the instrument.

 "7.2 Levelling"

- Enter the 2nd point data and press [**OK**].

- Press [**MEAS**] to observe the selected point.

Define 2nd PT	
Np:	112.706
Ep:	104.069
Zp:	11.775
LOAD REC MEAS OK	

- Enter azimuth angle (or horizontal distance) of the 1st point and 2nd point.



Both the azimuth angle and horizontal distance of the 1st (or 2nd) point cannot be input.

Azimuth1 :	45° 00' 00"
H.dist1 :	<Null>
Azimuth2 :	
H.dist2 :	50.000m
COORD OK	

- When the cursor is on "Azmth1" or "Azmth2", **[COORD]** is displayed. Press **[COORD]** to set the azimuth angle for each point by inputting coordinates.


1st PT	
Np:	0.000
Ep:	0.000
Zp:	<Null>
LOAD	REC MEAS NEXT

- Press **[MEAS]** to observe the selected point.


- Press **[OK]**. The coordinate value of the intersection point is calculated and displayed.

Azmth1:	45°00'00"
H.dist1:	<Null>
Azmth2:	<Null>
H.dist2:	50.000m
OK	

 - When there are 2 intersections, **[OTHER]** is displayed.

 "2 Intersections"

 
- Press **[S-O]** to move to setting-out measurement of the required point.

 "14. SETTING-OUT MEASUREMENT"

- Press **{ESC}**. Continue the measurement (repeat steps from 2).

Intersection1	
N	176.458
E	176.458
Z	<Null>
OTHER	REC S-O

Note

- It is also possible to perform intersection measurement by pressing **[INTSCT]** when allocated to the OBS mode screen.
-  Allocating **[INTSCT]**: "31.3 Allocating Key Functions"



2 Intersections

2 intersections are defined according to 1st Pt. and 2nd Pt. as shown below
Intersections created from Azmth 1 and H.dist 2 (or H.dist 1 and Azmth 2):
An azimuth angle has already been set for a point. The furthest point from this point is set as Intersection Pt. 1, and the closest point set as Intersection Pt. 2.

- Intersections created from H.dist 1 and H.dist 2:
Intersection to the right of the straight line between 1st point and 2nd point set as Intersection Pt. 1 and the point to the left set as Intersection Pt. 2.



Precaution when performing intersection measurement

In the following cases the coordinates of intersection points cannot be calculated.

When Azimuth 1 = Azimuth 2.

When Azimuth 1 – Azimuth 2 = $\pm 180^\circ$.

When H.dist 1 = 0, or H.dist 2 = 0.


When the coordinates for 1st Pt. and 2nd Pt are the same.

23. TRAVERSE ADJUSTMENT

Measurement of a traverse begins with observation of the backsight station and foresight station. The instrument station is then moved to the foresight station and the previous instrument station becomes the backsight station. Observation is performed again at the new position. This process is repeated for the length of the route.

This adjustment function is used to calculate the coordinates of such a sequence of consecutively-observed points (traverse points and points observed from traverse points (see P3-1 to P3-3 below)). When calculation is complete, the CX displays the precision of the traverse and, when necessary, traverse adjustment can be performed.

☞ For types of traverse that can be calculated with the CX, see "☐ Types of traverse"

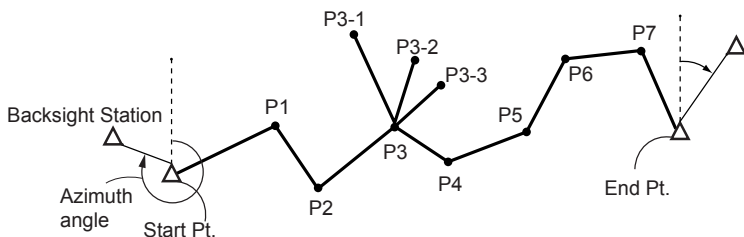


PROCEDURE

1. Before starting traverse calculation, observe the sequence of traverse points and record the results.

☞ "27.4 Recording Distance Measurement Data"/
"27.6 Recording Distance and Coordinate Data"


2. In the second page of the OBS mode screen, press [MENU], then select "Traverse".

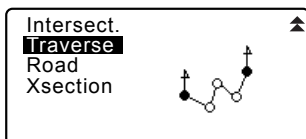

23. TRAVERSE ADJUSTMENT

3. Enter the start point name and press **{ENT}**.

- When **[LIST]** is pressed, a list of instrument stations saved in the current JOB is displayed. A point from this list can be recalled and used.

 For using softkeys in this screen, see "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data"

- Enter values manually when there are no coordinates saved for the specified instrument station.
Press **[OK]** to proceed to step 4.

4. Enter the point name of the backsight station for the start point and press **{ENT}**.

When there are saved coordinates for the backsight station, the calculated azimuth angle is displayed.

- Enter values manually when there are no coordinates saved for the specified start point backsight station.
Press **[OK]** to display the calculated azimuth angle.

Traverse start pt.
Occ:
Bs :
Azimuth: <Null>
[LIST] **[OK]**

Occ **T-0001**
Occ T-0002
Occ T-0003
Occ T-0004
Occ T-0005
↑↓...P **[FIRST]** **[LAST]** **[SRCH]**

Occ:
N 0.000
E 0.000
Z <Null>
PT T-0001
[LOAD] **[REC]** **[OK]**

Traverse start pt.
Occ:T-0001
Bs : **BS**
Azimuth: <Null>
[LIST] **[OK]**

Traverse start pt.
Occ:T-0001
Bs :T-000Z
Azimuth: **357° 27' 46"**
[OK]

- To enter azimuth angle without entering backsight station coordinates, press **{▼}** to move the cursor down to "Azimuth" then enter an angle value.

5. When **[OK]** is pressed in the screen in step 4, the CX will search for a traverse route. The points from step 1 will be displayed in the order in which they were observed.

001:T-0001


Searching

- This search can be stopped by pressing **{ESC}**. If **{ESC}** is pressed, a route can be computed using only the points found prior to the search being stopped.

Exit Searching

confirm?

NO **YES**

- When a traverse point with recorded known point coordinates is found, or there are multiple foresight stations for a point, the automatic route search will stop. Press **[LIST]** and select which foresight station to use as the next point.
 "Automatic route search"

6. Press **[OK]** to confirm the traverse route.

006:T-0006 ▲

007:T-0007

008:T-0001

009: XXXXXXXXXX

LIST **OK**

23. TRAVERSE ADJUSTMENT

7. Enter the point name of the backsight station for the end point and press **{ENT}**.
The calculated azimuth angle is displayed.

```
Traverse end pt.
Occ:T-0001
Fs :T-0002
Azmth: 335°27'46"
LIST OK
```

Enter the azimuth angle when there are no recorded coordinates for the end point backsight station.

8. When **[OK]** is pressed in the screen in step 7, the CX will display the precision of the traverse.

```
Traverse precision
d.Ang: 0°00'20"
d.Dist: 0.013
Precision: 42714
OPTION ADJUST
```

```
Traverse precision
d.North: 0.013
d.East: 0.000
d.Elev: -0.002
OPTION ADJUST
```



d.Ang: Angular closure error
d.Dist: Horizontal closure distance
Precision: Precision of the traverse as a ratio of the total horizontal distance traversed to the closure distance
d.North: Closure distance in Northing coordinates
d.East: Closure distance in Easting coordinates
d.Elev: Closure distance in elevation

- Press **[OPTION]** to change the method by which the traverse adjustments are distributed.

Adjustment options	
Method	: Compass
Angular	: Weighted
Elev	: Weighted

(*:Factory setting)

- (1) Method (coordinate adjustment):
Compass*, Transit
- (2) Angular:
Weighted*, Linear, None
- (3) Elev (Elevation):
Weighted*, Linear, None

 For all options, see " Adjustment methods"

9. Angular adjustment will be performed first. Press **[ADJUST]** to start adjustment using the method selected in "(2) Angular" in step 8.

After angle adjust	
d.Ang :	0° 00' 00"
d.Dist :	0.006
precision :	89788 ▼
OPTION	ADJUST

- When "None" is selected in "(2) Angular" in step 8, only coordinate and elevation adjustment will be performed.

10. After confirming the results, press **[ADJUST]** again to start coordinate and elevation adjustment using the methods selected in "(1) Method" and "(3) Elev" respectively. All adjusted instrument data will be in saved in the currently selected JOB and traverse adjustment will be finished.

Traverse adjustment	
Recording...	7

23. TRAVERSE ADJUSTMENT




- It is also possible to perform traverse adjustment by pressing **[TRAV]** when allocated to the OBS mode screen.
 - ☞ Allocating **[TRAV]**: "31.3 Allocating Key Functions"
- Traverse adjustment results of traverse points, points observed from traverse points and traverse adjustment data will be saved in the currently selected JOB as Notes data. Data including the distributed closure error will also be saved in the currently selected JOB as ordinary coordinate data.

Traverse line record (3):	1. point names of start and end points 2. backsight station name and azimuth to said backsight station 3. foresight station name and azimuth to said foresight
Adjustment setting record (1):	The selected method for distributing closure error.
Closure error record (2x2):	1. precision and closure error for angle/ distance 2. coordinate closure error
Coordinate adjustment record (No. of included points between start and end points):	Coordinates



Types of traverse

CX can calculate closed-loop and closed traverses. In both cases, the azimuth for the start point (and for the end point in the case of a closed traverse) must be set.

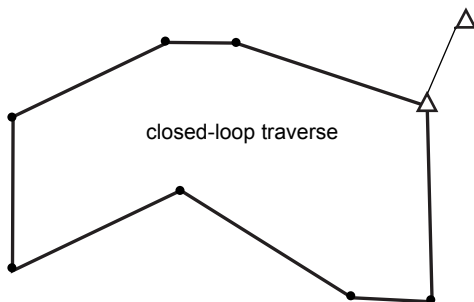



Automatic route search

This function searches for consecutively-observed traverse points already stored on the CX and presents them as potential traverse routes.

This function is activated when the following conditions are met. When a point has been observed more than once, the most recent data will be used for the search.

- At least one backsight station and one foresight station are observed from an instrument station.
- The foresight station becomes the instrument station for the subsequent measurement.
- The instrument station becomes the backsight station for the subsequent measurement.

If one of the following conditions is met, the automatic route search will terminate. The same search can be resumed by specifying the name of the next point in the route.

- There is more than one potential foresight station for an instrument station. (Route search terminates as a juncture appears in the route.)
- The foresight station for the previous measurement was the Start pt. (Route search terminates as this measurement is judged to have closed a closed-loop traverse.)
- The most recently measured point has the same point name as a recorded known point. (Route search terminates as this point is judged to be the End pt.)

The automatic route search function cannot be used in the following case.

- The final measurement is to a traverse point on the traverse route other than the Start pt.



Adjustment methods

Adjustment is applied to results for traverse points and points observed from traverse points.

Adjustment methods and distribution options selected in step 8 are described below.

Method

Compass: The Compass method distributes the coordinate error in proportion to the length of the traverse lines.

$$\text{Northing adjustment} = \frac{L}{TL} \times \text{closure north}$$

$$\text{Easting adjustment} = \frac{L}{TL} \times \text{closure east}$$

Where: L = length of the traverse line to the point
TL = sum of the traverse line lengths

Transit: The Transit method distributes the coordinate error in proportion to the northing and easting ordinates of each traverse line.

$$\text{Northing adjustment} = \frac{|\Delta N|}{\Sigma |\Delta N|} \times \text{closure north}$$

$$\text{Easting adjustment} = \frac{|\Delta E|}{\Sigma |\Delta E|} \times \text{closure east}$$

Where: ΔN = change in northing for the traverse line
 ΔE = change in easting for the traverse line
 $\Sigma |\Delta N|$ = sum of the absolute value of all the changes in northings of all the traverse lines
 $\Sigma |\Delta E|$ = sum of the absolute value of all the changes in eastings of all the traverse lines

Angular adjustment

Weighted: Any angular closure is distributed among the angles of the traverse route based on the sum of the inverses of the forward and back traverse line lengths at each angle. The backsight and foresight lines are considered to have infinite lengths for the purposes of this weighting computation.

$$\angle\text{adjustment} = \frac{\left(\frac{1}{\text{todist}} + \frac{1}{\text{fromdist}}\right)}{\Sigma\left(\frac{1}{\text{todist}} + \frac{1}{\text{fromdist}}\right)} \times \angle\text{closure}$$

Linear: Any angular closure is distributed evenly among the angles of the traverse route.

None: No angular adjustment performed.

Elev adjustment

Weighted: Any closure in the elevations is distributed in proportion to the length of the traverse line leading to the point (like the Compass method for coordinate adjustment).

Linear: Any closure in the elevations is distributed evenly in each leg of the traverse route.

None: No elevation adjustment performed.

24. ROUTE SURVEYING

This mode allows a variety of route surveying options widely used in civil engineering measurement. Each menu allows the operator to initiate a string of successive configuration/calculation/record/setting-out operations.


- The orientation of the instrument station and backsight station can be set as necessary.
 - ☞ For backsight station settings, see "12.1 Entering Instrument Station Data and Azimuth Angle".
- EDM settings can be set in the Route Surveying menu.
 - ☞ "31.2 EDM Settings"
- The point names and codes set when measurement results were recorded can only be used in the Route Surveying menu.



- The Z-axis coordinate value in all Route Surveying work is always "Null" ("Null" is not the same as "0").



Symbols and terms used in Route Surveying

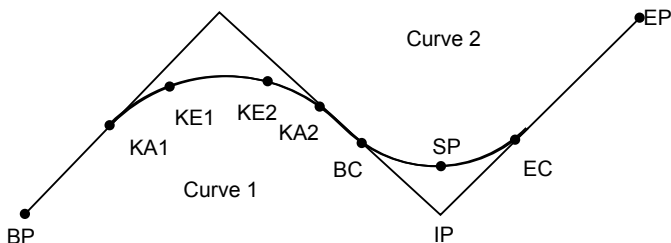

BP Point: route origin
KA Point: clothoid curve origin
BC Point: circular curve origin
IP Point: point of intersection
Offset: reference point
follow-up distance

EP Point: route end-point
KE Point: clothoid end-point
EC Point: circular curve end-point
SP Point: circular curve midpoint
Follow-up distance: target point
follow-up distance

24.1 Instrument Station Settings


The instrument station to be used as the reference point is recorded, as necessary, prior to starting surveying.

☞ For instrument station settings, see "12.1 Entering Instrument Station Data and Azimuth Angle"

24.2 Straight Line Calculation

The coordinates of the center peg and width pegs for a straight line can be found from the coordinates of the reference point and IP point.

It is then possible to proceed with the setting-out of the center peg and width pegs.

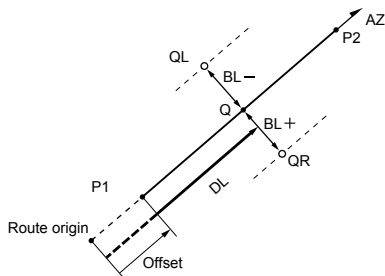



Reference point (P1)
 IP point (P2)
 Follow-up distance (DL)
 Route width (BL)
 Target point (Q)
 Width peg (QR, QL)

PROCEDURE

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "Line" to enter the Straight Line menu.
3. Input the coordinates of the reference point, then press **[OK]**.


- Press **[LOAD]** to read in the already registered coordinate data and set as the coordinates of the reference point.

"12.1 Entering Instrument Station Data and Azimuth Angle
 PROCEDURE Reading in
 Registered Coordinate Data"

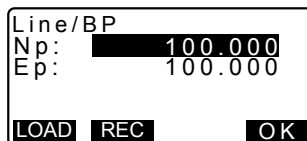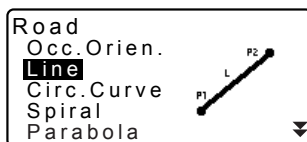

24. ROUTE SURVEYING

- The reference point coordinates can be stored as the coordinates for a known point in the current job by pressing **[REC]**.

 "29.1 Registering/Deleting Known Point Data"

- Input the coordinates of the IP point, then press **[OK]**.

- The azimuth angle to the IP point can be set by pressing **[AZMTH]** on the second page. Press **[COORD]** to return to coordinate input.

Line/IP	
Np:	200.000
Ep:	200.000
P2 AZMTH	

Line/IP	
Azmth	45.0005
COORD OK	

- Input the reference point follow-up distance in "St. ofs". Input the target point follow-up distance in "Sta..ing".

Line/CL peg	
St. ofs	0.000m
Sta..ing	25.000m
OK	

- Press **[OK]** in the screen shown in step 5 to calculate the center peg coordinates. The coordinates and azimuth angle are then displayed on the screen.

Line/CL peg	
N	117.678
E	117.678
Azmth	45°00' 00"
WIDTH REC S-O CENTER	


- Press **{ESC}** twice to finish Straight Line calculation and return to <Road>.

- Press **[WIDTH]** to move to the width peg setting screen. The coordinates of the width peg can be found by inputting the route width and pressing **[OK]**.


Line/WidthPeg	
Sta..ing	25.000m
CL ofs	5.000m
OK	

Line/WidthPeg	
N	114.142
E	121.213
WIDTH REC S-O CENTER	

- The center peg can be stored as a known point in the current job by pressing **[REC]**.

 "29.1 Registering/Deleting Known Point Data"

- The center peg can be set-out by pressing **[S-O]**.

 "14. SETTING-OUT MEASUREMENT"

- Press **[CENTER]** to return to the center peg setting screen.


Note

- When the azimuth angle is set after the coordinates have been input in step 4, if the coordinates are deleted the azimuth angle is given priority.
- Offset/Follow-up distance input range: 0.000 to 99999.999 (m)
- Route width input range: -999.999 to 999.999 (m)

24.3 Circular Curve Calculation

The coordinates of the center peg and width pegs on a circular curve can be found from the coordinates of the BC point and IP point.

It is then possible to proceed with the setting-out of the center peg and width pegs.

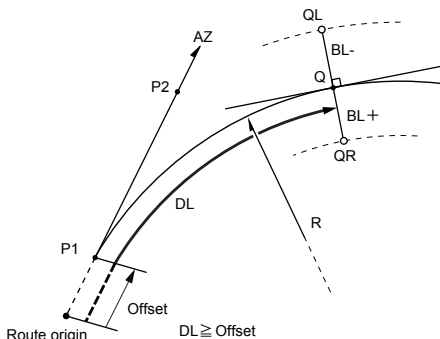

BC point (P1)
 IP point (P2)
 Circular curve radius (R)
 Follow-up distance (DL)
 Route width (BL)
 Target point (Q)
 Width peg (QR, QL)




24. ROUTE SURVEYING



PROCEDURE

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "Circ.Curve" to enter the Circular Curve menu.
3. Input the coordinates of the BC point (reference point), then press **[OK]**.
4. Input the coordinates of the IP point, then press **[OK]**.

- The azimuth angle to the IP point can be set by pressing **[AZMTH]** on the second page. Press **[COORD]** to return to coordinate input.

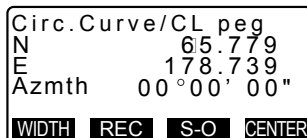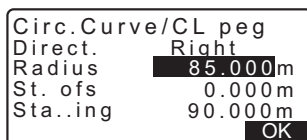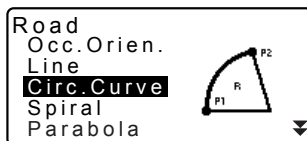5. Enter the curve direction, curve radius, offset, and follow-up distance.
6. Press **[OK]** in the screen shown in step 5 to calculate the center peg coordinates. The coordinates and azimuth angle are then displayed in this screen.



7. Press **{ESC}** twice to finish Circular Curve calculation and return to <Road>.
- Press **[WIDTH]** to move to the width peg setting screen.
 "24.2 Straight Line Calculation"
 - The center peg can be set-out by pressing **[S-O]**
 "14. SETTING-OUT MEASUREMENT"

 **Note**

- Curve direction: right/left
- Radius input range: 0.000 to 9999.999 (m)


24.4 Spiral Curve

The coordinates of the center peg and width pegs on a spiral (clothoid curve) can be found from the coordinates of the reference point and curve properties. It is then possible to proceed with the setting-out of the center peg and width pegs

- Select a calculation menu depending on the section of the spiral to be calculated.
- Clothoid curve is calculated by the following formula.


$$A^2=RL$$

Calculation using KA Point as reference: "KA→KE Calculation 1"

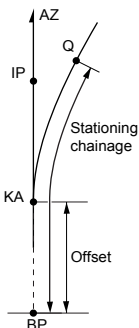


- KA point (P1)
- IP point (P2)
- Clothoid parameter A
- Follow-up distance (DL)
- Route width (BL)

Calculation using arbitrary point between KA1 and KE1 as reference: "KA→KE Calculation 2"

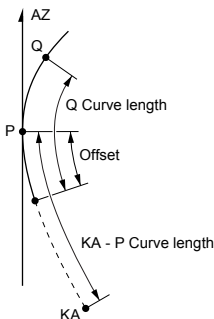

- Reference point (P1)
- Point on line tangential to P1 (P2)
- Clothoid parameter A
- KA to P1 curve length (L)
- P1 to target point (QR, QL)
- Curve length (DL1, DL2)
- Route width (BL)

Calculation using KE2 as reference: "KE→KA Calculation"

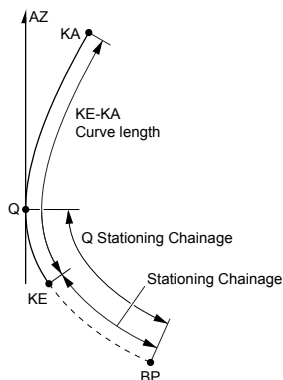

KE point (P1)
 KE tangential angle (AZ)
 Clothoid parameter A
 KE to KA curve length (L)
 KE follow-up distance (DL1)
 Target point follow-up distance (DL2)
 Route width (BL)



- If the following conditions are not met, coordinate calculation cannot be performed.


"KA→KE Calculation 1": $0 \leq \text{curve length} \leq 2A$

"KA→KE Calculation 2": $0 \leq \text{KA} - \text{reference point curve length} \leq 3A$
 $0 \leq \text{KA} - \text{target point curve length} \leq 2A$

"KE→KA Calculation": $0 \leq \text{KA} - \text{KE curve length} \leq 3A$
 $0 \leq \text{KA} - \text{target point curve length} \leq 2A$

PROCEDURE Calculation using KA Point as reference

- In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
- Select "Spiral" to enter the spiral menu then select "KA-KE 1".

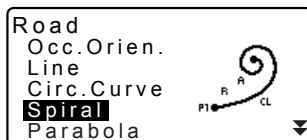

24. ROUTE SURVEYING

- Input the coordinates of the KA point (reference point). Press **[OK]** to set the input values.

- Input the coordinates of the IP point, then press **[OK]**.

- The azimuth angle to the IP point can be set by pressing **[AZNTH]** on the second page. Press **[COORD]** to return to coordinate input.

Spiral/IP	
Np:	100.000
Ep:	100.000
LOAD	REC
OK	

- Enter the curve direction, parameter A, offset, and follow-up distance.


Spiral/CL peg	
Direct.	Right
Para A	80.000m
St. ofs	0.000m
Sta..ing	25.000m
OK	

- Press **[OK]** in the screen shown in step 5 to calculate the center peg coordinates. The coordinates and azimuth are then displayed in this screen.


Spiral/CL peg	
N	120.859
E	113.755
Azmth	00°00'00"
WIDTH	REC
S-O	CENTER

- Press **{ESC}** three times to finish spiral calculation and return to <Road>.

 - Press **[WIDTH]** to move to the width peg setting screen.

 "24.2 Straight Line Calculation"

 - The center peg can be set-out by pressing **[S-O]**

 "14. SETTING-OUT MEASUREMENT"

Note

- Curve direction: right/left
- Parameter A input range: 0.000 to 9999.999 (m)
- Station offset /Stationing chainage input range: 0.000 to 99999.999 (m)

PROCEDURE Calculation using arbitrary point between KA1 and KE1 as reference

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "Spiral" to enter the spiral menu then select "KA-KE 2".

```
Spiral
KA-KE 1
KA-KE 2
KE-KA
```

3. Input the coordinates of the P point (reference point). Press **[OK]** to set the input values.

```
Spiral/Ref.PT.P
Np: 100.000
Ep: 100.000
LOAD REC OK
```

4. Input the coordinates of the arbitrary point on the line tangential to the P point, then press **[OK]**.

- The azimuth angle to the P point can be set by pressing **[AZMTH]** on the second page. Press **[COORD]** to return to coordinate input.

5. Enter the curve direction, parameter A, KA-P curve length (length of curve from KA to P point), offset, and P-target curve length (length of curve from P point to target point).

```
Spiral/CL peg
Direct. Right
Para A 80.000m
KA-P length 50.000m
OK
```

```
St. ofs 0.000m
P-SetOutPTlength 25.000m
OK
```

24. ROUTE SURVEYING

- Press **[OK]** in the screen shown in step 5 to calculate the center peg coordinates. The coordinates are then displayed in this screen.
- Press **{ESC}** three times to finish spiral calculation and return to <Road>.

```
Spiral/CL peg
N          119.371
E          115.706
Azimuth   58°59'18"
WIDTH REC S-O CENTER
```

Note

- KA-P curve length/ P-target point curve length input range: 0.000 to 99999.999 (m)

PROCEDURE Calculation using KE2 Point as reference

- In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
- Select "Spiral" to enter the spiral menu then select "KE-KA".
- Input the coordinates of the KE point (reference point). Press **[OK]** to set the input values.
- Input the azimuth angle of the arbitrary point on the line tangential to the KE point, then press **[OK]**.
 - Pressing **[COORD]** sets the coordinate toward the tangential direction. Pressing **[AZMTH]** on the second page returns to the screen for inputting the azimuth angle.

```
Spiral
KA-KE 1
KA-KE 2
KE-KA
```

```
Spiral/KE
Np: 167.731
Ep: 225.457
LOAD REC OK
```

5. Enter the curve direction, parameter A (clothoid parameter), KE-KA curve length (length of curve from KE to KA), KE follow-up distance, and target point follow-up distance.

```
Spiral/CL peg
Direct.      Right
Para A      50.000m
KA-KE length
            41.667m
            OK
```

```
KE Sta..ing 153.718m
SetOutpt. sta
            160.000m
            OK
```

6. Press **[OK]** in the screen shown in step 5 to calculate the center peg coordinates. The coordinates are then displayed in this screen.

```
Spiral/CL peg
N           164.837
E           231.004
Azimuth    125°32'48"
WIDTH REC S-O CENTER
```

7. Press **{ESC}** three times to finish spiral calculation and return to <Road>.

Note

- KE-KA curve length (length of curve from KE to KA)/KE follow-up distance/ target point follow-up distance input range: 0.000 to 99999.999 (m))

24.5 Parabola

The coordinates of the center peg and width pegs on a parabola can be found from the coordinates of the reference point and curve properties.

It is then possible to proceed with the setting-out of the center peg and width pegs

- Select a calculation menu depending on the section of the parabola to be calculated.
- Parabola is calculated by the following formula.

$$y = \frac{x^3}{6RX}$$





Abbreviations used in parabola calculation

- BTC: Beginning of transition curve
 BCC: Beginning of circular curve
 ETC: End of transition curve
 ECC: End of circular curve

Calculation using BTC Point as reference:

"BTC→BCC Calculation 1"


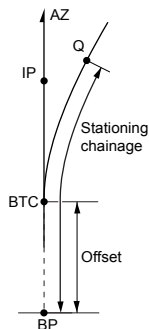


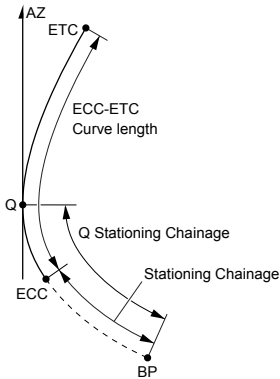


Calculation using BCC as reference:
"ECC→ETC Calculation"

PROCEDURE Calculation using BTC Point as reference

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "Parabola" to enter the Parabola menu then select "BTC→BCC Calc."

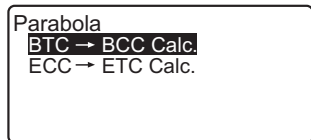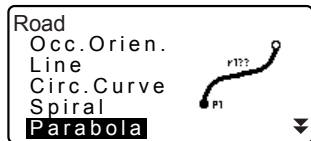

3. Input the coordinates of the BTC point (reference point). Press **[OK]** to set the input values.

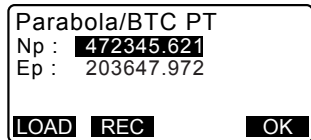

24. ROUTE SURVEYING


 
- Input the coordinates of the IP point, then press **[OK]**.
 - The azimuth angle to the IP point can be set by pressing **[AZMTH]** on the second page. Press **[COORD]** to return to coordinate input.
- Enter the curve direction, parameter X, radius, offset, and stationing chainage.

Parabola/CL peg	
Direct.	Right
Para X	133.000m
Radius	800.000m
St. ofs	0.000m
	▼
OK	

Sta..ing	20.000m	▲
OK		

- Press **[OK]** in the screen shown in step 5 to calculate the center peg coordinates. The coordinates are then displayed in this screen.
- Press **{ESC}** three times to finish Parabola calculation and return to <Road>.

Parabola/CL peg			
N	472365.620		
E	203648.215		
Azmth	0°46'03"		
WIDTH	REC	S-O	CENTER

- Press **[WIDTH]** to move to the width peg setting screen.
 "24.2 Straight Line Calculation"
- The center peg can be set-out by pressing **[CENTER]**.
 "14. SETTING-OUT MEASUREMENT"

Note

- Curve direction: right/left
- Parameter X/Radius input range: 0.000 to 9999.999 (m)
- Station offset/Stationing chainage input range: 0.000 to 99999.999 (m)

PROCEDURE Calculation using ECC Point as reference

- In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
- Select "Parabola" to enter the Parabola menu then select "ECC→ETC Calc."
- Input the coordinates of the ECC point (reference point). Press **[OK]** to set the input values.
 - Pressing **[COORD]** sets the coordinate toward the tangential direction. Pressing **[AZMTH]** on the second page returns to the screen for inputting the azimuth angle.
- Enter the curve direction, parameter X, ECC-ETC curve length, ECC stationing chainage and Q stationing chainage (Set out pt sta).

Parabola
BTC → BCC Calc.
ECC→ETC Calc.

Parabola/ECC PT
Np : 475073.398
Ep : 203897.770
LOAD REC OK

Parabola/2nd tan pt
Azmth 20.000
COORD OK

Parabola/CL peg
Direction. Right
Para X 133.000m
ECC-ETC Length
140.000m ▼
OK

ECC Sta..ing	0.000 m	▲
Set out pt sta	20.000m	
	OK	

24. ROUTE SURVEYING

- Press **[OK]** in the screen shown in step 5 to calculate the center peg coordinates. The coordinates are then displayed in this screen.
- Press **{ESC}** three times to finish Parabola calculation and return to <Road>.

Parabola/CL peg	
N	475090.311
E	203905.186
Azmth	26°58'26"
WIDTH	REC
S-O	CENTER


Note

- ECC-ETC curve length/ECC stationing chainage/Q stationing chainage (Set out pt sta) input range: 0.000 to 99999.999 (m)

24.6 3 Point Calculation

The coordinates of a cardinal point, an arbitrary centerline peg, and width pegs can be found from the coordinates of 3 IP points and curve properties.

It is then possible to proceed with the setting-out of the cardinal point, arbitrary centerline peg, and width pegs

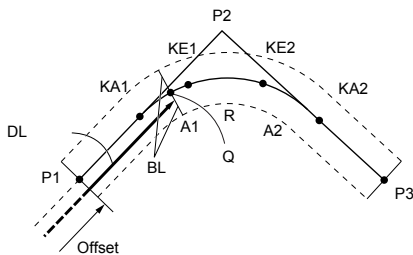


Parameters input:

- BP point (P1)
- IP point (P2)
- EP point (P3)
- Intersection angle
- Direction of curve
- BP-IP length
- IP-EP length
- Clothoid parameter A1
- Clothoid parameter A2
- Curve radius (R)
- Route width (BL)
- Route width (BL)
- Stationing to CL peg (DL)


- When parameter A1, parameter A2 and radius R have all been input a clothoid is created and the KA1, KE1, KE2 and KA2 points can be found.
- When parameter A1 and parameter A2 have been input and radius R is "Null", a clothoid without a transition curve is created and the KA1, KE1, and KA2 points can be found.
- When parameter A1 and parameter A2 are both "Null" and only radius R has been input, a circular curve is created and the BC point and EC point can be found.

PROCEDURE


1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "3PT Curve" to enter the 3 point calculation menu.

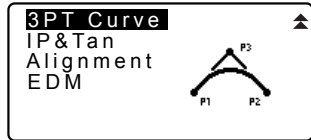

3. Input the coordinates of the BP point (reference point). Press **[OK]** to set the input values.

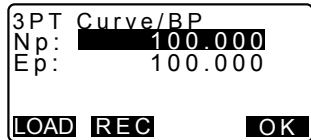


4. Input the coordinates of the IP point, then press **[OK]**.
5. Input the coordinates of the EP point, then press **[OK]**.

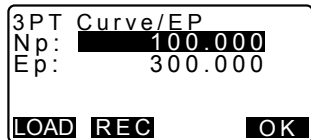


6. The IA ang (intersection angle), direction (of curve), BP-IP (BP-IP length), and IP-EP (IP-EP length) are calculated from the coordinates of the three input points. The results are then displayed on the screen.

Check the data, then press **[OK]**.

- Press **{ESC}** to return to the previous screen to make alterations to this data.

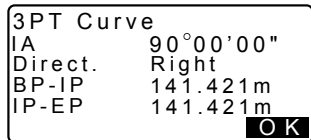

7. Input curve properties: parameter A1, parameter A2, curve radius, and St. ofs (BP Point offset).

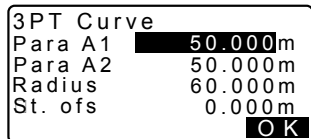

24. ROUTE SURVEYING

8. Press **[OK]** in the screen shown in step 7 to calculate the coordinates and follow-up distance of the KA1 point, KE1 point, KE2 point, KA2 point. The results are then displayed on the screens shown here. Press **[F5]**/**[F6]** to switch between <3PT Curve/KA1>/<3PT Curve/KE1>/<3PT Curve/KA2>/<3PT Curve/KA2>.

```
3PT Curve/KA1  ►►
N                142.052
E                142.052
Sta..ing         59.471m
WIDTH REC S-O CENTER
```

9. In the screens for the KA1 point, KE1 point, KE2 point, and KA point that have been found, press **[CENTER]** to move to centerline peg settings. Input Sta..ing (stationing to the CL peg) and press **[OK]** to calculate the coordinates of the arbitrary centerline peg. The results are then displayed on the screen.

 
```
◀◀ 3PT Curve/KA2
N                142.052
E                257.948
Sta..ing         195.386m
WIDTH REC S-O CENTER
```

```
3PT Curve/CL peg
Sta..ing         195.386m
OK
```


```
3PT Curve/CL peg
N                167.289
E                137.517
Sta..ing         100.000m
WIDTH REC S-O CENTER
```

10. Press **{ESC}** repeatedly to finish 3 Point calculation and return to <Road>.

- Press **[WIDTH]** to move to the width peg setting screen.

 "24.2 Straight Line Calculation"

 - The centerline peg can be set-out by pressing **[S-O]**.

 "14. SETTING-OUT MEASUREMENT"


Note

- In the case of a clothoid with no transition curve, the KA1 Point, KE1 Point, and KA2 Point can be found in step 8.
- In the case of a circular curve, the BCC Point and ECC Point can be found in step 8.

24.7 Intersection Angle/Azimuth Angle Calculation

The coordinates of a cardinal point, an arbitrary centerline peg, and width pegs can be found from an intersection angle, curve properties, and either the coordinates of 1 IP point of intersection or the azimuth angle from the BP Point to the IP point.



It is then possible to proceed with the setting-out of the cardinal point, centerline peg, and width pegs

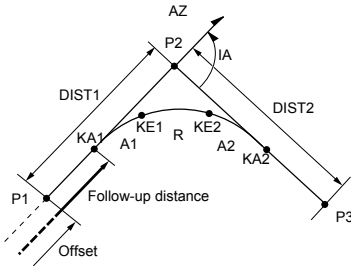

BP point (P1)
 IP intersection point (P2)
 Intersection angle (IA)
 BP to IP distance (DIST1)
 IP to EP distance (DIST2)
 Clothoid parameter A1
 Clothoid parameter A2
 Curve radius R

PROCEDURE

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "IP&Tan" to enter the intersection angle/azimuth angle calculation menu.
3. Input the coordinates of the BP point (reference point). Press **[OK]** to set the input values.

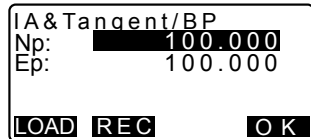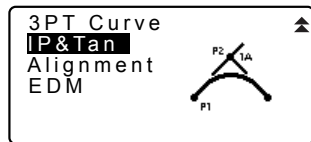

24. ROUTE SURVEYING

4. Input the coordinates of the IP point, then press **[OK]**.

- The azimuth angle can be set by pressing **[AZMTH]** on the second page.

5. Input curve properties: direction (of curve), IA (intersection angle), BP-IP (distance between BP Point and IP Point), IP-EP (distance between IP Point and EP Point), Para A1 (parameter A1), Para A2 (parameter A2), radius (of curve), and St. ofs (BP Point offset).

IP&Tan	
Direc.	Right
IA	90°00'00"
BP-IP	141.421m
IP-EP	141.421m
	OK

Para A1	50.000m
Para A2	50.000m
Radius	60.000m
St. ofs	0.000m
	OK

6. Press **[OK]** in the screen shown in step 5 to calculate the coordinates and follow-up distance of the KA1 point, KE1 point, KE2 point, and KA2 point. The results are then displayed on the screens shown here. Press **[>]**/**[<]** to switch between <IA&Tangent/KA1>/<IA&Tangent/KE1>/<IA&Tangent/KE2>/<IA&Tangent/KA2>.

IA&Tangent/KA1 ▶	
N	142.052
E	142.052
Sta..ing	59.471m
	WIDTH REC S-O CENTER

◀ IA&Tangent/KA2	
N	142.052
E	257.948
Sta..ing	195.386m
	WIDTH REC S-O CENTER

7. In the screens for the KA1 point, KE1 point, KE2 point, and KE2 point that have been found, press **[CENTER]** to move to centerline peg settings. Input Sta..ing (stationing to CL peg) and press **[OK]** to calculate the coordinates of the arbitrary centerline peg. The results are then displayed in this screen.

IA&Tangent/CL peg	
Sta..ing	195.386m
	OK

IA&Tangent/CL peg	
N	167.289
E	173.517
Sta..ing	100.000m
	WIDTH REC S-O CENTER


8. Press **{ESC}** repeatedly to finish calculation and return to <Road>.
 - Press **[WIDTH]** to move to the width peg setting screen.
 - ☞ "24.2 Straight Line Calculation"
 - The centerline peg can be set-out by pressing **[S-O]**.
 - ☞ "14. SETTING-OUT MEASUREMENT"

Note

- In the case of a clothoid with no transition curve, the KA1 Point, KE1 Point, and KA2 Point can be found in step 6.
- In the case of a circular curve, the BC Point and EC Point can be found in step 6.
- Intersection angle input range: $0^\circ < IA < 180^\circ$

24.8 Route Calculation


Route Calculation is used to find the center pegs and width pegs of a route which contains a series of curves. It is then possible to proceed with setting-out. (The illustration below is an example of a clothoid calculation)

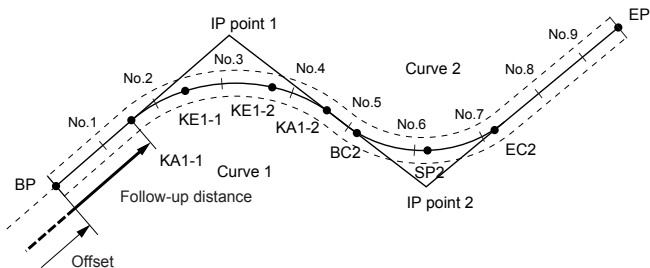

- Route Calculation includes the following:
 - Curve properties input, curve properties display, automatic calculation of cardinal points, arbitrary point calculation, and inverse width peg calculation.
- In the Route Calculation menu it is possible to set one route per JOB, each route containing a maximum of 16 curves.

24. ROUTE SURVEYING

- Up to 600 points, including all center pegs and width pegs, can be calculated using automatic calculation of cardinal points.
- Route data is retained even when the power has been cut off. However, the route data will be cleared if the JOB is deleted or memory data is initialized.

 Deleting a JOB: "28.2 Deleting a JOB"

Memory initialization: "31.5 Restoring Default Settings PROCEDURE
Restoring set items to initial settings and turning power on"






- Curve data is not set when curve properties (parameter A1, parameter A2, radius R) are all set to "Null".
- The rounding up of error values in curve calculation may create discrepancies (mm) in coordinates of peg No.

24.8.1 Inputting IPs (Intersection Points)

PROCEDURE

1. Enter the Route Calculation menu.
Press **[MENU]** on the third page of the OBS mode to enter the Route Calculation menu.
2. Enter the Alignment Calculation menu.
Select "Alignment".
3. Enter the Curve Element Setting menu.
Select "Define elements".
4. Enter the IP Inputting menu.
Select "Input IP".

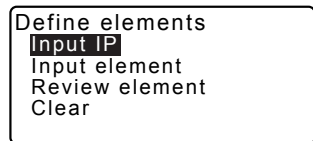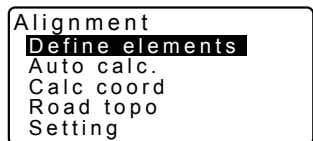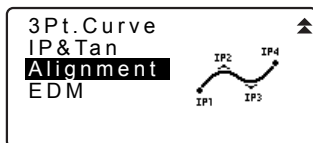

5. Set the base point (BP).
Input the coordinate for the BP, and press **[NEXT]**.

BP	
N p:	100.000
E p:	100.000
LOAD REC NEXT	

6. Set the IP 1.
Input the coordinate for the IP 1, and press **[NEXT]**.

IP 1	
N p:	200.000
E p:	200.000
LOAD REC NEXT	

7. Set the following IPs.
Input the following IPs in the same manner as step 6. To define the input IP as the end point (EP), press **[EP]**.

IP 3	
N p:	200.000
E p:	400.000
LOAD REC NEXT EP	

8. Check the EP.
Check the coordinate for the EP, and press **[OK]**.

EP	
N p:	200.000
E p:	400.000
<Curve number:2>	
OK	

9. Quit inputting the IPs.
Press **[OK]** in the screen shown in step 8.
The screen returns to <Curve Element Setting>.

24.8.2 Inputting Curve Elements

- Automatic setting of the BP (step 3): You can set the BP for the next curve as the IP or the EP for the previous curve (KA-2 or the EC point) in advance.
- If multiple curves overlap when the next curve is calculated based on the input curve elements (when **[OK]** is pressed), the screen below is displayed.

Element 2-Element3
1mm
Curve overlap
Continue?
YES NO

24. ROUTE SURVEYING


- If the element starting point is located before the BP, the distance between those two points is displayed with minus (-).

BP-Element1 -10mm Curve overlap Continue? YES NO

- If the element ending point exceeds the EP, the distance between those two points is displayed with plus (+).

Element n-ED 10mm Curve overlap Continue? YES NO

Pressing **[YES]** continues the calculation, ignoring the overlap of the curves.
Pressing **[NO]** stops the calculation and return to the Input Element screen.

1. Input the IPs.
 "24.8.1 Inputting IPs (Intersection Points)"

2. Enter the Input Element screen.
Select "Input element".

Define elements Input IP Input element Review element Clear

3. Input the elements for the curve 1.
Input the parameter A1, parameter A2, radius R, and offset (additional distance for the BP: if the BP is located before the route starting point, minus (-) is accompanied) and press **[OK]**.

Element1	
Para A1	50.000 m
Para A2	50.000m
Radius	60.000m
St. ofs	0.000m
	IP OK

- To set a dogleg, parameter A1 and A2 should be "Null" and radius should be 0.

- When **[IP]** is pressed, the intersection angle, turning direction, the lengths of the curves between BP-IP1 and IP1-IP2 are calculated from the BP, the IPs and the curve elements, and the results are displayed. After checking the results, press **[OK]**.

Element1	
IA	90° 00' 00"
Direct.	: Right
BP-IP1:	141.421m
IP1-IP2:	141.421m
[OK]	

4. Input the elements for the next curve. Input the parameter A1, parameter A2 and radius R for the next curve. The offset is automatically set.

Element2	
Para A1	<Null>
Para A2	<Null>
Radius	50.000 m
St. ofs	195.386m
[IP] [OK]	

- The offset is not displayed if "Next BP" described in "24.8.8 Setting parameters" is set to "IP".
- When **[IP]** is pressed, the intersection angle, turning direction, the lengths of the curves between IP1-IP2 and IP2-IP3 are calculated from the BP, the IPs and the curve elements, and the results are displayed. After checking the results, press **[OK]**.

5. Continue inputting the elements for the following curves.
Input the elements for the following curves in the same manner as shown in steps 3 and 4.
6. Quit inputting the curve elements.
When input of the elements for all curves is completed, press **[OK]**. The screen will return to <Curve Element Setting>.

24. ROUTE SURVEYING

24.8.3 Displaying curve properties

It is possible to check the curve properties set in "24.8.2 Inputting Curve Elements". To make alterations, follow the procedure described in "24.8.2 Inputting Curve Elements".

- The curve property data will be displayed in ascending order of curve number.

PROCEDURE

1. Input the IPs.
☞ "24.8.1 Inputting IPs (Intersection Points)"
2. Input the elements for the curve.
☞ "24.8.2 Inputting Curve Elements"

3. Align the cursor with "Review elements" and press **{ENT}**.
Use **▶**/**◀** to move through property screens in the following order: BP Point -> IP Point -> EP Point -> curve properties -> BP Point of the next curve.

```
Define elements
Input IP
Input element
Review elements
Clear
```

```
Element1/BP ▶▶
Np:          100.000
Ep:          100.000
OK
```

·
·
·

```
◀◀ Element1 ▶▶
Para A1      50.000m
Para A2      50.000m
Radius       60.000m
St. ofs      0.000m
OK
```


4. Press **[OK]** to return to <Define elements>.

24.8.4 Clearing Data

The route data set with the procedures in "24.8.1 Inputting IPs (Intersection Points)" and "24.8.2 Inputting Curve Elements" can be cleared.


PROCEDURE

1. Enter the Route Calculation menu.
Press **[MENU]** on the third page of the OBS mode to enter the Route Calculation menu.
2. Enter the Alignment Calculation menu.
Select "Alignment".
3. Enter the Curve Element Setting menu.
Select "Define elements".
4. Enter the Clearing menu.
Select "Clear".

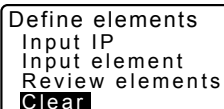

Define elements
Input IP
Input element
Review elements
Clear

5. Clear the route data.
Press **[YES]** to clear all the route data.
 - Pressing **[NO]** returns to the <Curve Element Setting> screen.



Clear All deletions
Confirm ?

NO **YES**

24.8.5 Automatic calculation of cardinal points

Perform automatic calculation of cardinal points based on the curve properties set in "24.8.2 Inputting Curve Elements". Center pegs (peg No.) and width pegs set up at intervals can be calculated at once.

- Up to 600 points, including all center pegs and width pegs, can be calculated using automatic calculation of cardinal points.
- The cardinal point calculated depends on the type of curve involved.
 - Clothoid: KA-1 Point, KE-1 Point, KE-2 Point, KA-2 Point
 - Clothoid with no transition curve: KA-1 Point, KE Point, KA-2 Point
 - Circular curve: BC Point, SP Point, EC Point

24. ROUTE SURVEYING

- The width pegs can be set up on both sides of the route and the left and right route widths calculated separately.
- A point name is automatically assigned to peg No. that can be calculated. The first part of the point name can be preset.
- The coordinates of calculated pegs are automatically stored in the current JOB. When a particular point name already exists in the current job the available option is possible to select whether or not to overwrite. It is possible to preset which procedure is used in this situation.

PROCEDURE

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "Alignment" to enter the Route Calculation menu.
3. Select "Auto calc." to enter the automatic calculation of cardinal points menu.

```
Alignment
Define elements
Auto calc.
Calc coord
Road topo
Setting
```

4. Set Sta incr (stationing increment), middle P, CL ofs1 (centerline offset 1), CL ofs2 (centerline offset 2), Existing (procedure used when the same point name already exists in the current JOB), and Autaname (automatically assigned suffix for point name).

```
Alignment
Sta incr 100.000m
midpitch 90.000m
CL ofs1 5.000m
CL ofs2 -5.000m
OK
```

```
ExistingPt Add
Autaname No.
OK
```


5. Press **[OK]** in the screen shown in step 4 to calculate the coordinates of the cardinal point, width pegs and peg No. The coordinates are then displayed on the screens shown here. Use **[▶]/[◀]** to switch between screens. (Screens right are examples of a clothoid curve calculation).

Results		▶▶
N	100.000	
E	100.000	
PT	BP *	
S-O		OK

Results		▶▶
N	96.465	
E	103.536	
PT	BPR *	
S-O		OK

Results		▶▶
N	107.071	
E	107.071	
PT	No.1	
S-O		OK

- When "Existing pt" in step 4 has been set to "Skip" a point with a point name which already exists in the current JOB will not be automatically stored. These points are marked with "*". At this stage of the process it is possible to store such a point under a new point name.


Results		
N	200.000	
E	400.000	
PT	EP *	
REC		S-O OK

6. The screen at right is displayed when the amount of set pegs exceeds 600 points. Press **[YES]** to continue using the initial 600 points. Press **[NO]** to return to the screen of step 4.

Memory over	
Continue?	
YES NO	

7. Press **[OK]** to return to <Alignment>.

 - The center peg can be set-out by pressing **[S-O]**.

 "14. SETTING-OUT MEASUREMENT"



- Peg No. pitch input range: 0.000 to 9999.999 (100.000*) (m)

24. ROUTE SURVEYING

- Middle pitch input range: 0.000 to 9999.999 (0.000*) (m)
- Route width input range: -999.999 to 999.999 (Null*) (m)
- Duplicate point name procedure: Add (record as separate point with same point name)*/Skip (no overwrite)
- Maximum point name length: 8 characters ("peg No.**")

- Cardinal point settings are retained even when the power has been cut off. However, the settings have been cleared if "RAM cleared" is displayed.



Rules regarding the assigning of point names to automatically calculated pegs.

- Clothoid curve cardinal point: the curve number is added at the end e.g. the KA1 Point of curve number 1 is written "KA1-1", and the KA1 Point of curve number 2 is written "KA2-1".
- Circular curve cardinal point: the curve number is added at the end e.g. the BC Point of curve number 1 is written "BC1", and the BC Point of curve number 2 is written "BC2".
- Width peg: "R" or "L" is added at the end of the center peg point name. "R" is added for positive (+) route widths (the route width from the center peg to the RIGHT width peg) and "L" is added for negative (-) route widths (route width from the center peg to the LEFT width peg). When both route widths are input as positive (+) "R" and "R2" are used. When both route widths are input as negative (-) "L" and "L2" are used.
- A blank space at the beginning and end of a point name will be ignored.
- If the length of the point name being input exceeds 16 characters, 1 character at the beginning will be deleted for each new character input at the end of the point name.


24.8.6 Arbitrary point calculation

The coordinates of arbitrary points on every calculated curve can be found using arbitrary point calculation.


PROCEDURE

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "Alignment" to enter the Route Calculation menu.


3. Select "Calc coord" to enter the arbitrary point calculation menu.

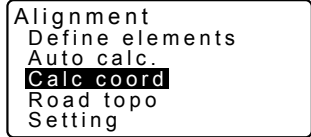

4. Input the arbitrary point follow-up distance.

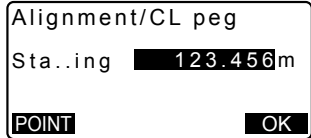

5. Press [OK] in the screen shown in step 4 to display the coordinates and point name of the arbitrary point.

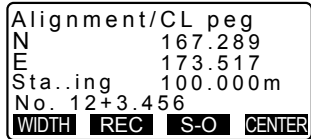

- The center point can be stored as a known point in the current job by pressing [REC].

6. Press {ESC} to return to <Alignment>.

- Press [OFF] to move to the width peg setting screen.

"24.2 Straight Line Calculation"

- The center peg can be set-out by pressing [CENTER].

"14. SETTING-OUT MEASUREMENT"



Rules regarding the automatic assigning of point names to arbitrary points

- Arbitrary point: The distance to the arbitrary point is given in terms of the closest peg No. from the front of the curve. The distance from the peg No. is added at the end.
- If the length of the point name being input exceeds 16 characters, 1 character at the beginning will be deleted for each new character input at the end of the point name.

24. ROUTE SURVEYING

24.8.7 Inverse width peg

The route widths and coordinates for center pegs on every calculated curve can be found by using inverse width peg calculation.

- There are two methods for specifying arbitrary width peg coordinates: key entry and observation.

PROCEDURE Using key entry to specify arbitrary width pegs

1. In the second page of the OBS mode screen, press **[MENU]**, then select "Road".
2. Select "Alignment" to enter the route calculation menu.
3. Select "Road topo" to enter the road topo menu.
4. Input the arbitrary width peg coordinates.
5. Press **[OK]** in the screen shown in step 4 to display the coordinates and point name of the center peg.
6. Press **[OK]** in the screen shown in step 5 to display the route width and point name of the width peg.

```
Alignment
Define elements
Auto calc.
Calc coord
Road topo
Setting
```

```
Alignment/Road topo
Np: 0.000
Ep: 0.000
LOAD MEAS OK
```

```
Road topo/CL peg
N 173.318
E 196.031
Sta..ing 123.456m
No. 12+3.456
REC S-O OK
```

```
Road topo/WidthPeg
N 173.318
E 196.031
CL ofs 5.000m
No. 12+3.456R
REC S-O OK
```


7. The next width peg can then be set by pressing **[OK]**.

- The center peg can be set-out by pressing **[S-O]**.

 "14. SETTING-OUT MEASUREMENT"

PROCEDURE Using observation to specify arbitrary width pegs

1. Enter the road topo menu in the same manner as shown above.

 "PROCEDURE Using key entry to specify arbitrary width pegs" steps 1 to 3

2. Sight the width peg and press **[MEAS]** to start measurement. The coordinates and measurement distance of the width peg, vertical angle and horizontal angle are displayed.

Press **[STOP]** to stop the measurement.

Alignment/Road topo	
Np:	0.000
Ep:	0.000
LOAD MEAS OK	

N	168.329
E	199.361
SD	3.780m
ZA	78°43'26"
HA-R	21°47'16"
STOP	

3. The coordinates and point name shown in this screen are used to display the results for the center peg.

Alignment/Road topo	
Np:	168.329
Ep:	199.361
Confirm?	
NO YES	

4. Press **[YES]** in the screen shown in step 3 to display the route width and point name of the width peg.

Road topo/CL peg	
N	173.318
E	196.031
Sta..ing	123.456m
No.2	
REC S-O OK	

5. The next width peg can then be set by pressing **[OK]**.

24. ROUTE SURVEYING



- The rules regarding the assigning of point names to width pegs and center pegs are the same as those for when calculating width pegs in automatic calculation of cardinal points.
 - ☞ "24.8.5 Automatic calculation of cardinal points" ☞ Rules regarding the assigning of point names to automatically calculated pegs"
- The rules regarding the assigning of point names to center pegs are the same as those for when calculating arbitrary points.
 - ☞ "24.8.6 Arbitrary point calculation" ☞ Rules regarding the automatic assigning of point names to arbitrary points"

24.8.8 Setting parameters

When configuring curve properties in "24.8.2 Inputting Curve Elements", it is possible to preset which curve (clothoid or parabola) to calculate and which point to use as the BP Point of the next curve: the IP Point of the previous curve or the end-point (KA-2 or EC Point) of the previous curve.

PROCEDURE


1. In the second page of the OBS mode screen, press [MENU], then select "Road".
2. Select "Alignment" to enter the Route Calculation menu.
3. Select "Setting" to enter the Setting Parameters menu.
4. Use / to select the automatic setting method for the BP Point of the next curve and curve type.

```
Alignment
Define elements
Auto calc.
Calc coord
Road topo
Setting
```

```
Alignment/Setting
Next BP : IP
Curve :Clothoid
```

- When curve properties are already input, curve type cannot be changed.

First clear all route data.

 "24.8.2 Inputting Curve Elements"

Alignment/Setting

Next BP : IP

Curve : **Clothoid**

Existing curve

Note

The automatic setting method can be selected from the following:


(*: Factory setting)

- BP Point of the next curve: "IP" (IP Point of the previous curve)*/"EC/KA2" (end-point of the previous curve (KA-2 or EC Point)).
- Curve: Clothoid* / Parabola

25. CROSS SECTION SURVEY

The purpose of this function is to measure and set out points along a cross-section of a road or linear feature already surveyed using the route surveying function. Cross-sections can be surveyed in a variety of directions depending on your requirements.

☞ For terminology: "24. ROUTE SURVEYING"

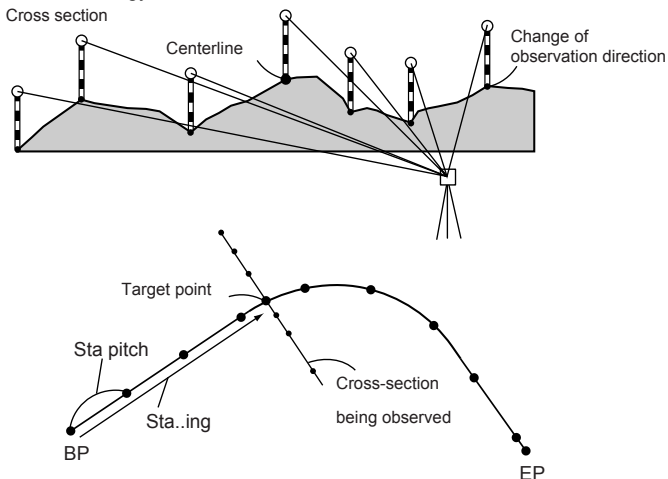

- EDM setting can be done in the cross section survey menu.

☞ Setting items: "31.2 EDM Settings"

PROCEDURE

1. In the second page of OBS mode screen, press **[MENU]**, then select "Xsection Survey".
2. Select "Occ.orien" in <Xsection Survey> and enter instrument station data
☞ "12.1 Entering Instrument Station Data and Azimuth Angle"

```
Xsection Survey
Occ.Orien
Xsection Survey
EDM
```


3. Select "Xsection Survey" in <Xsection Survey>

Xsection Survey
 Occ.Orien.
Xsection Survey
 EDM

4. Input road name for cross section survey, station pitch, station increment, stationing chainage and select direction. Then press **[OK]**.

Xsection Survey
 Road name: **Road3** **A**
 Sta pitch: 100.000m **OK**

- Press **[STA-]/[STA+]** to decrease/increase the pitch set in "Sta incr" from/to "Stationing chainage". Stationing chainage is displayed as "xx+xx.xx".

Sta incr: 10.000m **▲**
 Sta...ing: **55.200**m
 Direc.: Left → Right
STA- **STA+** **OK**

- In the event that stationing chainage was the same as the prior observation, cross-section survey is judged to have finished and a confirmation message window is displayed. Press **[YES]** to proceed to step 5. Press **[NO]** to set station pitch, station chainage, and direction again.

Same Sta...ing
NO **YES**

5. Sight the last point on the cross-section and press **[MEAS]**.

" Direction"

- Press **[HT]** to set instrument and target height.
- Press **[OFFSET]** on the second page to perform offset measurement for the last point.
- When observing the center point first, the center point needs to be set.

N
 E
 Z
 ZA 89°59'50" **P1**
 HA-R 125°32'20" **HT** **MEAS** **OK**

Step 8

25. CROSS SECTION SURVEY

6. Press **[REC]**. Enter target height, point name and code, then press **[OK]**.

N	103.514	
E	101.423	
Z	12.152	
ZA	89°59'50"	
HA-R	125°32'20"	P1
[REC]	[HT]	[MEAS] [OK]

N	344.284	
E	125.891	A
Z	15.564	
HR	2.000m	
PT	P01	
		[OK]


7. Repeat steps 5 to 6 for all points on the cross-section in the set observation direction until the centerline is reached.
8. Observe the center point. Then press **[OK]**.

N	150.514	
E	220.423	
Z	80.150	
ZA	89°59'50"	
HAR	125°32'20"	P1
[REC]	[HT]	[MEAS] [OK]

Enter center point name. Then press **[OK]**.

3+3.200	
Center:	
	No.3+3.200
Finished section:	
	No
[LOAD]	[OK]

- When the center point is set as the instrument station, press **[LOAD]** to read in already registered coordinate data and set as the coordinates of the instrument station.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data

9. Repeat steps 5 to 6 for all points on the cross-section occurring after the centerline.

10. After observing the last changing point, check that "Finished section" is set to "Yes", then press **[OK]**.

```

3+3.200
Center:
No. 3+3.200
Finished section:
Yes
LOAD OK

```

- Observation can be cancelled by pressing **{ESC}**. In this event, a confirmation message window is displayed. Press **[YES]** to discard measurement data observed up to that point and exit observation. Press **[NO]** to continue observation.

```

Stop observing
Delete RPOS data?
NO YES

```

11. Proceed to observation of the next cross-section.



- Road name: up to 16 characters
- Sta incr: -999999.999 to 999999.999 (m)
- Sta..ing: -99999.99999 to 99999.99999 (m)
- Sta pitch: 0.000 to 999999.999 (m)
- Direction: Left->Right/Right->Left/Left/Right



Direction

Cross-sections can be measured in the following directions depending on the setting selected in "Direction".


When "Left" or "Left -> Right" selected

Pattern 1: From left-most point to right-most point.

Pattern 2: Center point observed first. Then the point immediately to the left of the center point. Remaining points can then be observed in any order.

Pattern 3: Method using 2 prisms. Center point observed first followed by the point immediately to the left. Subsequent observations can be in whatever order is the most efficient for operation with 2 prisms. In the illustration below the points closest to the center point are observed first, followed by the outermost points (left first, then right).

25. CROSS SECTION SURVEY

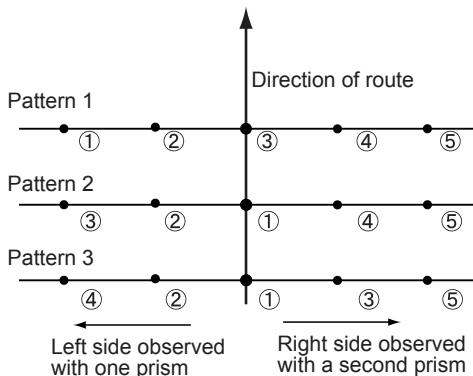


When "Right" or "Left -> Right" selected

Pattern 1: From right-most point to left-most point.

Pattern 2: Center point observed first. Then the point immediately to the right of the center point. Remaining points can then be observed in any order.

Pattern 3: Method using 2 prisms. Center point observed first followed by the point immediately to the right. Subsequent observations can be in whatever order is the most efficient for operation with 2 prisms.


When "Left -> Right" or "Right -> Left" selected, observation of a subsequent cross-section can be switched automatically to the opposite direction upon completion of the previous cross-section observation. This method minimizes the walking distance to the next starting point when measuring multiple cross-sections.

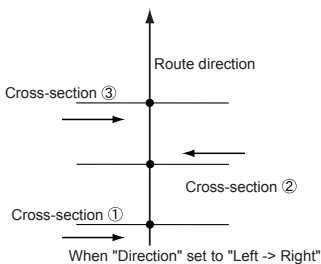



Cross survey data review

Cross-section data recorded in a JOB is displayed as shown at right. "Offset" represents the distance calculated from the center point coordinates and measurement point coordinates.


 Displaying JOB data:
"27.8 Reviewing JOB Data"

Sta..ing	3+3.200	
Offset	-12.820m	
HR	2.000m	
PT	XSECT03	▼
NEXT		PREV

N	-320.500	▲
E	100.200	
Z	6.200	
CD		
.		
NEXT		PREV


26. POINT TO LINE MEASUREMENT

Point to line allows an operator to define the coordinates of the target point when a line connecting the base point A (0, 0, 0) and the point B is set as the X axis. The instrument's station coordinates and angle for an unknown point C is set by observing the point A and the point B.

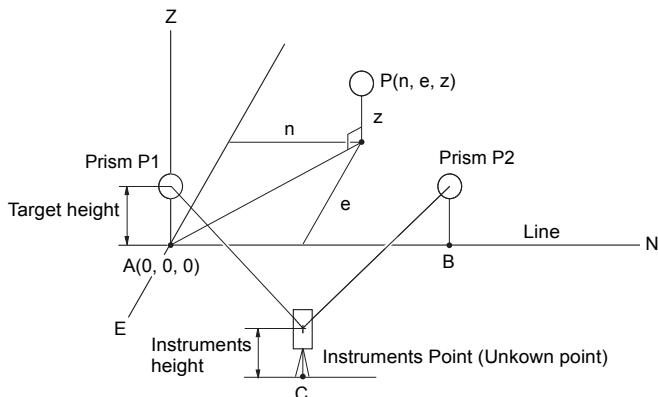


PROCEDURE Setting Baseline

1. Press **[Menu]** on the second page of the OBS mode and select "Pt to line".

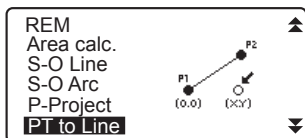

2. Select "Define baseline".

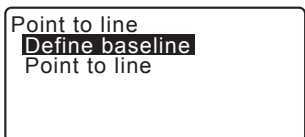

3. Enter an instrument height and press **[OK]**.



26. Point to Line MEASUREMENT

4. Collimate the first target point and press **[MEAS]**.

Measure 1st PT	
ZA	0° 00 ' 00 "
HA-R	0° 00 ' 00 "
HR	████████ 1.000m
PT	1003
[MEAS]	

After confirming the measured result, press **[OK]**.

SD	5.123m
ZA	34° 56 ' 12 "
HA-R	123° 45 ' 26 "
HR	████████ 1.000m
PT	1003
[REC] [MEAS] [OK]	

5. Measure the second target point in the same manner as the first one.

Measure 2nd PT	
ZA	45° 12 ' 34 "
HA-R	178° 56 ' 31 "
HR	████████ 2.000m
PT	1004
[MEAS]	

Confirm the measured result and press **[OK]**.

SD	5.123m
ZA	45° 12 ' 34 "
HA-R	178° 56 ' 31 "
HR	████████ 2.000m
PT	1004
[REC] [MEAS] [OK]	

6. Confirm the measured result of the baseline defined from the line between the first target point and the second one.

Baseline pt1-pt2	
HD	0.123m
VD	-0.003m
SD	0.156m
[S.CO] [OK]	

Pressing **[OK]** sets the instrument's point coordinates and angle.

Continue with the measurement of Point to Line.

- Pressing **[S.CO]** displays the instrument point coordinates defined from the measurement results of the first target point and the second one. Pressing **[OK]** conducts measurement of Point to Line.

N0:	20.000
E0:	30.000
Z0:	40.000
HI	2.000m
[REC] [OK]	


26. Point to Line MEASUREMENT

- Pressing **[REC]** records the coordinates for the instrument point as known point data in the current JOB. The instrument's station coordinates and height cannot be changed at this time.


PROCEDURE Point to Line Measurement

1. Press "Point to line" on the second page of the OBS mode.


2. Select "Point to line".

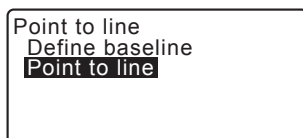

3. Collimate the target point and press **[MEAS]**. The measured result is displayed.

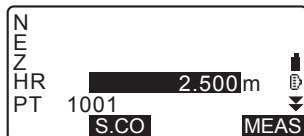

- Pressing **[REC]** records the coordinates of the target point as measured data in the current JOB.

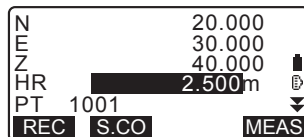

- Pressing **[S.CO]** displays the coordinates of the instrument station.

4. Collimate the next target point and press **[MEAS]** to begin measurement. It is possible to measure several points consecutively.
5. Pressing **{ESC}** returns to the <Point to Line> screen.

27. RECORDING DATA - TOPO MENU -

In Record menu, you can store the measurement data (distance, angle, coordinates), station point data, backsight station data, and note in the current JOB.

 "28. SELECTING/DELETING A JOB"

- A total of 5000 data can be stored inside the instrument. Recording instrument station data and backsight station data is an exception.



- If the same point name is input, the following screen is displayed.

N	5.544
E	-0.739
Z	0.245
PT	PNT-001
	Overwrite ?
ADD	NO YES

Press **[ADD]** to record the point as another record with the same name.

Press **[NO]** to input a new name.

Press **[YES]** to overwrite the present point.

27.1 Recording Instrument Station Data

Instrument station data can be stored in the current JOB.

- The items that can be recorded are the instrument station coordinates, point name, instrument height, codes, operator, date, time, weather, wind, temperature, air pressure and atmospheric correction factor.
- If instrument station data is not stored for the current JOB, the previously stored instrument data settings will be used.

PROCEDURE


1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>.

- Current JOB name is displayed.

27. RECORDING DATA - TOPO MENU -

2. Select "Occupy".

 
TOPO JOB1
Occupy
BS data
Angle data
Dist data
Coord data



3. Set the following data items.

- (1) Instrument station coordinates
- (2) Point name
- (3) Instrument height
- (4) Code
- (5) Operator
- (6) Date (Display only)
- (7) Time (Display only)
- (8) Weather
- (9) Wind
- (10) Temperature
- (11) Air pressure
- (12) Atmospheric correction factor


- Select **[LOAD]** to recall and use the registered coordinates.

 "12.1 Entering Instrument Station Data and Azimuth Angle PROCEDURE Reading in Registered Coordinate Data".

- When inputting code, **[ADD]**, **[LIST]** and **[SRCH]** are displayed.
Press **[ADD]** to save input codes in memory.

Press **[LIST]** to display saved codes in reverse chronological order.

 Press **[SRCH]** to search for a saved code.

 For reviewing and saving codes in Data mode, see "29.3 Registering/Deleting Codes" and "29.4 Reviewing Codes"

N0: 56.789
E0: -1234567.789
Z0: 1.234
PT Pt.004
HI 1.234m
[LOAD] **[OK]**

CD
: pole
Operator:
:
[ADD] **[LIST]** **[SRCH]** **[OK]**

Date : Jan/01/2012
Time : 17:02:33
Weath: Fine
Wind : Calm
[OK]

Temp. : 12°C
Press. : 1013hPa
ppm : -3
[Oppm] **[OK]**

- To set the atmospheric correction factor to 0ppm, press **[0ppm]**. The temperature and air pressure are set to the default setting.
4. Check the input data, then press **[OK]**.
 5. Press **{ESC}** to restore <TOPO>.




- Maximum point name size: 14 (alphanumeric)
- Input range of instrument height: -9999.999 to 9999.999 (m)
- Maximum code/operator size: 16 (alphanumeric)
- Weather selection: Fine, Cloudy, Light rain, Rain, Snow
- Wind selection: Calm, Gentle, Light, Strong, Very strong
- Temperature range: -35 to 60 (°C) (in 1°C step)/-31 to 140 (°F) (in 1°F step)
- Air pressure range: 500 to 1400 (hPa) (in 1 hPa step)/375 to 1050 (mmHg) (in 1mmHg step)/14.8 to 41.3 (inch Hg) (in 0.1 inch Hg step)
- Atmospheric correction factor range (ppm): -499 to 499

27.2 Recording Backsight Point

Backsight station data can be stored in the current JOB. Azimuth angle setting method can be selected from “inputting azimuth angle” or “calculating coordinates”.

PROCEDURE Inputting azimuth angle

1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>.
2. Select “BS data”.

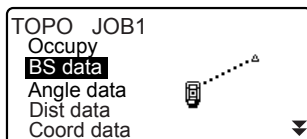

27. RECORDING DATA - TOPO MENU -

3. Select "Angle".
Angle measurement values are displayed in real time.

TOPO / Backsight
Angle
Coord

4. Input Azimuth angle.

TOPO / Backsight
Take BS
ZA 90° 12' 34"
HA-R 130° 12' 34"
HA-R: [REDACTED]
REC

5. Sight the backsight and press **[REC]** in the screen of step 4, and set the following items.

ZA 90° 12' 34"	A
HA-R 0° 00' 00"	
HR 0.000m	
PT [REDACTED]	↓
REC	OFFSET
AUTO	MEAS

- (1) Target height
(2) Point name
(3) Code

6. Press **[OK]** to record backsight station data. RED (Reduced) data and angle measurement data are recorded at the same time.
<TOPO> is restored.

CD	↑
: [REDACTED]	A
ADD	LIST
SRCH	OK


PROCEDURE Calculating azimuth angle by coordinates

1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>.
2. Select "BS data".
3. Select "Coord".

TOPO / Backsight
Angle
Coord

4. Input the backsight station coordinates.

- When you wish to read in and set coordinate data from memory, press **[LOAD]**.

 "12.1 Entering Instrument Station Data and Azimuth Angle" PROCEDURE
Reading in Registered Coordinate Data"

TOPO / Backsight	
NBS :	1.000
EBS :	1.000
ZBS :	<Null>
LOAD	OK

5. Press **[OK]** in the screen of step 4. Angle measurement values are displayed in real time. Calculated Azimuth angle is also displayed.

TOPO / Backsight	
Take BS	
ZA	90° 12' 34"
HA-R	123° 12' 34"
Azmth	45° 00' 00"
REC	

6. Sight the backsight and press **[REC]** in the screen of step 4, and set the following items.

- (1) Target height
- (2) Point name
- (3) Code

ZA	90° 12' 34"	A
HA-R	45° 00' 00"	
HR	0.000m	
PT		▼
OK		

7. Press **[OK]** to record backsight station data. Known point data and angle measurement data are recorded at the same time. <TOPO> is restored.



CD		▲
:		A
ADD	LIST	SRCH OK

27.3 Recording Angle Measurement Data


Angle measurement data can be stored in the current JOB.

PROCEDURE

1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>.
2. Select "Angle data" and sight the point to be recorded.
Angle measurement values are displayed in real time.

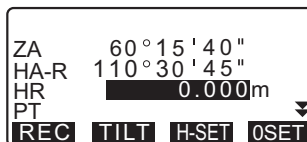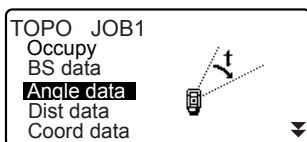

3. Set the following items.
 - (1) Target height
 - (2) Point name
 - (3) Code

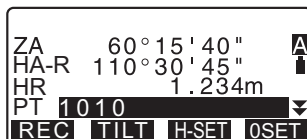


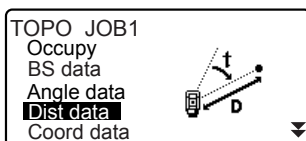
4. Check the input data, then press **[REC]**.
5. Press **{ESC}** to quit measurement and restore <TOPO>.

27.4 Recording Distance Measurement Data


Distance measurement data can be stored in the current JOB.

PROCEDURE

- Press **[MEAS]** in the first page of OBS mode to perform distance measurement.
 "11.2 Distance and Angle Measurement"
- Press **[TOPO]** in the third page of OBS mode. <TOPO> is displayed. Select "Dist data" to display the measurement results.



- Set the following items.
 - Target height
 - Point name
 - Code

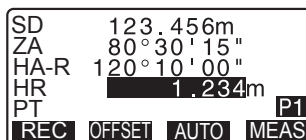

- Check the input data, then press **[REC]**.

27. RECORDING DATA - TOPO MENU -

5. To continue measurement, sight the next point, press **[MEAS]**, then perform steps 3 and 4 above.

SD	123.456m
ZA	80°30'15"
HA-R	120°10'00"
HR	1.234m
PT	P1
OFFSET	AUTO MEAS

- Press **[AUTO]** to perform distance measurement and automatically record the results.

[AUTO] is convenient for recording measurement data when target height, code and point name are not set.

SD	123.456m
ZA	80°30'15"
HA-R	120°10'00"
Recorded	

- Press **[OFFSET]** to offset measurement in TOPO Mode.

6. Press **{ESC}** to quit measurement and restore <TOPO>.



- In the screen displaying **[AUTO]**, press trigger key to perform automatic operation from distance measurement to recording.

27.5 Recording Coordinate Data


Coordinate data can be stored in the current JOB

PROCEDURE

1. Perform coordinates measurement in the OBS mode screen.

"13. COORDINATE MEASUREMENT"

2. Press **[TOPO]** in the third page of OBS mode to display <TOPO>. Select "Coord data" to display the measurement results.

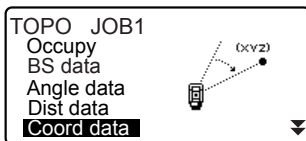

N	344.284	
E	125.891	
Z	15.564	
HR	2.000m	
PT		
[REC]	[OFFSET]	[AUTO] [MEAS]

3. Set the following items.
- (1) Target height
 - (2) Point name
 - (3) Code
4. Check the input data, then press **[REC]**.
5. To continue measurement, sight the next point, press **[MEAS]**, then perform steps 3 and 4 above.
- Pressing **[AUTO]** will start measurement, and automatically record the measured results. It is convenient to record measured data without setting the collimation height, code and point name.
 - Press **[OFFSET]** to start offset measurement.
6. Press **{ESC}** to quit measurement and restore <TOPO>.


27.6 Recording Distance and Coordinate Data

Distance measurement data and coordinate data can be stored in the current JOB at the same time.


- Both distance measurement data and coordinate data are recorded as the same point name.
- Distance measurement data is recorded first, then coordinate data is recorded.

PROCEDURE

1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>. Select "Dist + Coord" to display the measurement results.

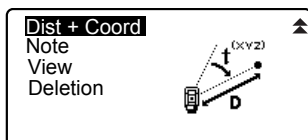

2. Sight the point and press **[MEAS]** to begin the measurement. The measurement results are displayed.

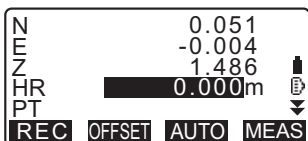


3. Set the following items.
 - (1) Target height
 - (2) Point name
 - (3) Code
4. Check the input data, then press **[REC]**.
5. Press **{ESC}** to quit measurement and restore <TOPO>.

27.7 Recording Notes


This procedure prepares notes data and records it in the current JOB.

PROCEDURE

1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>. Select "Note".

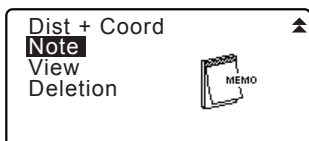

2. Enter the note data.

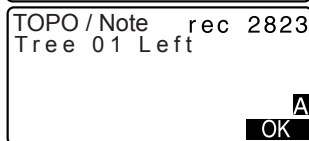

3. After inputting the note data, press **[OK]** to return to <TOPO>.



- Maximum note length: 60 characters (alphanumeric)

27.8 Reviewing JOB Data

It is possible to display the data within the current JOB that is selected.

- It is possible to search for data within the JOB to be displayed by point name. But the note data cannot be searched.
- Known point data that are entered from an external instrument are not reviewed.

PROCEDURE Reviewing JOB data

1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>. Select "View" to display the list of recorded points.

Dist + Coord	▲
Note	
View	
Deletion	

Occ	1
RED	2
Bkb	2
Ang.	2
Dist	3▼
↑↓·P	FIRST LAST SRCH

2. Select the point name to be displayed in detail and press **[ENT]**.
Details of the data are displayed.
This screen contains distance measurement data.

SD	123.456m	
ZA	20°31'21"	
HA-R	117°32'21"	
HR	123.456m	▼
PT	1010	
NEXT	PREV	EDIT RED

- To display previous data item, press **[PREV]**.
- To display next data, press **[NEXT]**.
- Press **[EDIT]** to edit code/target height/point name of the selected point name. Items that can be edited depend on the type of data selected.
Press **[OK]** to confirm changes and return to the previous screen.

- [**↑↓...P**] = Use {▲}/{▼} to move from page to page.
- [**↑↓...P**] = Use {▲}/{▼} to select individual point.
- Press [**FIRST**] to display first data.
- Press [**LAST**] to display last data.
- Press [**SRCH**] to search for point name. Input the point name after "PT".

The search may take time if many data are registered.

- Press [**RED**] to display the reduced data screen shown at right.

Press [**OBS**] to return to the previous screen.

HD	1234.456 m
VD	-321.123 m
Azmth	12°34'56"
HR	123.45 m ▼
PT	1010
<div style="display: flex; justify-content: space-between; padding: 0;"> [NEXT] [PREV] [EDIT] [OBS] </div>	

3. Press {**ESC**} to conclude detailed display and restore the list of points.
Press {**ESC**} again to restore <TOPO>.



- If more than two points with the same point name exist in the current JOB, CX finds the newer data only.

27.9 Deleting Recorded JOB Data

It is possible to delete data from the currently selected JOB.



- Deleting each data does not free the memory. When a JOB is deleted, the occupied memory is freed.
- ☞ "28.2 Deleting a JOB"

PROCEDURE Deleting Recorded JOB data

1. Press **[TOPO]** in the third page of OBS mode to display <TOPO>. Select "Deletion" to display the list of recorded points.

```
Dist + Coord  ▲
Note
View
Deletion
```

2. Select the data item to be displayed in detail and press **[ENT]**. Details of the data are displayed.

```
Occ          1
RED          2
Bkb          2
Ang.         2
Dist        3▼
↑↓...P  FIRST  LAST  SRCH
```

```
SD          123.456 m
ZA          20°31'21"
HA-R       117°32'21"
HR          5.000 m
PT 1010
NEXT  PREV  DEL
```

- To display previous data item, press **[PREV]**.
- To display next data, press **[NEXT]**.
- **[↑↓...P]** = Use {▲}/{▼} to move from page to page.
- **[↑↓...P]** = Use {▲}/{▼} to select individual point.
- Press **[FIRST]** to display first data.
- Press **[LAST]** to display last data.

- Press **[SRCH]** to search for point name. Input the point name after "PT".
The search may take time if many data are registered.
3. Press **[DEL]**. The selected measurement data will be deleted.
 4. Press **{ESC}** to restore <TOPO>.



- Check data items before deleting to avoid losing important data.
- Deleting an important data item, such as instrument station coordinates, can prevent successful completion of software operations that require such data after outputting to an external device.

28. SELECTING/DELETING A JOB

28.1 Selecting a JOB

Select the current JOB and Coordinate Search JOB.

- A total of 5 JOBS have been prepared, and JOB1 was selected when your CX was shipped from the factory.
- The names of the JOBS have been preset as JOB1 to JOB5; you can change them to any names you wish.
- Scale factor can be set for each JOB. Only scale factor of the current JOB can be edited.



Current JOB

Measurement results, instrument station data, known points data, notes and coordinate data are recorded in the current JOB.

Registering known point data: "29.1 Registering/Deleting Known Point Data".



Coordinate Search JOB

The registered coordinate data in the JOB selected here can be read into coordinate measurement, resection measurement, setting-out measurement, etc.



Scale correction

CX calculates horizontal distance and coordinates of a point using measured slope distance. If scale factor has been set, scale correction is carried out during calculation.

Corrected horizontal distance (s) = Horizontal distance (S) ×
Scale factor (S.F.)

- When scale factor is set to "1.00000000", the horizontal distance is not corrected.

Horizontal distance: "31.1 Configuration -Config Mode-"
● Observation Condition Horizontal distance (H Dist)

PROCEDURE JOB selection and scale factor setting

1. Select "JOB" in Data Mode.

Data
JOB
Known data
Code

2. Select "JOB selection".
<JOB selection> is displayed.

```
JOB
JOB selection
JOB details
JOB deletion
Comms output
Comms setup
```

3. Press **[LIST]**.

```
JOB selection
: JOB1
Coord search JOB
: JOB1
LIST
```

- JOB can also be selected by pressing **▶**/**◀**.
- The numbers to the right represent the number of data items in each JOB.
- "*" means that the JOB has not been output to an external device yet.

```
JOB selection
JOB01          46
*JOB02         254
JOB03         0
JOB04          0
JOB05          0
```

4. Align the cursor with the desired JOB as the current JOB and press **{ENT}**.

The JOB is determined.


5. Press **{ENT}**.
<JOB selection> is restored.

6. Align the cursor with "Coord search JOB" and press **[LIST]**.
<Coord search JOB> is displayed.

7. Align the cursor with the desired JOB as the coordinate search JOB and press **{ENT}**.
The JOB is determined and
<JOB> is restored.



28. SELECTING/DELETING A JOB

PROCEDURE Inputting a JOB name

1. Select "JOB" in Data mode.
2. Select in advance the JOB whose name to be changed.
 "PROCEDURE JOB selection and scale factor setting"

3. Select "JOB details" in <JOB>. After inputting the detailed information for the JOB, press **[OK]**. <JOB> is restored.

- Enter the scale factor for the current JOB.

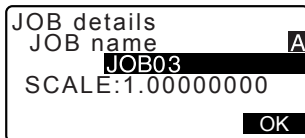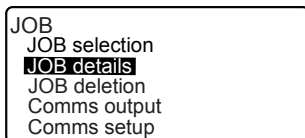

- Maximum length of JOB name: 12 (alphanumeric)
- Scale factor input range : 0.50000000 to 2.00000000 (*1.00000000)

“*” : Factory setting

28.2 Deleting a JOB

It is possible to clear the data within a designated JOB. After the data has been cleared, the JOB name returns to the name allocated when the CX was shipped.



- A JOB that has not been output to an auxiliary device (displayed with *) cannot be deleted.

PROCEDURE

1. Select "JOB" in Data Mode.
2. Select "JOB deletion".
<JOB deletion> is displayed.
 - The numbers to the right represent the number of data items in each JOB.

```
JOB
JOB selection
JOB details
JOB deletion
Comms output
Comms setup
```

```
JOB deletion
JOB01           46
*JOB02          254
JOB03         0
JOB04           0
JOB05           0
```

3. Align the cursor with the desired JOB and press {ENT}.
4. Press [YES]. The data within the JOB selected is deleted and <JOB deletion> is restored.

```
JOB03
  deletion
  Confirm ?
           NO YES
```

29. REGISTERING/DELETING DATA

29.1 Registering/Deleting Known Point Data

It is possible to register or delete coordinate data of the known points in the current JOB.

The coordinate data that has been registered can be output during setting for use as instrument station, backsight station, known point, and setting-out point coordinate data.

- It is possible to register 5000 items of coordinate data, including the data inside the JOBS.
- There are two registration methods: key entry and entry from an external instrument.
 - ☞ Interface cables: "34.2 Optional accessories"
 - Output format and command operations: "Communication manual"
- When entering known point data from an external device, CX does not check the repeated point name.
- Communication setup can be performed in the known data as well. Select "Comms Setup" in <Known data>.



- When "inch" is selected as the distance unit, the value must be input in "feet" or "US feet".
- Deleting each data does not free the memory. When a JOB is deleted, the occupied memory is freed.
 - ☞ "28.2 Deleting a JOB"

PROCEDURE Using the key entry method to register known point coordinate data

1. Select "Known data" in Data Mode.
 - Current JOB name is displayed.

Data
JOB
Known data
Code

2. Select "Key in coord" and input known point coordinates and point name.

```
Known data
Job.JOB1
Key in coord
Comms input
Deletion
View
```

```

                                rec 3991
N      567.950
E      -200.820
Z      305.740
PT                    5
```

3. After setting the data, press **{ENT}**.
The coordinate data is recorded in the current JOB and screen in step 2 is restored.

```

                                rec 3990
N      567.950
E      -200.820
Z      305.740
PT                    5
Recorded
```

4. Continue to enter other known point coordinate data.
5. After the registration of all the coordinate data has been completed, press **{ESC}** to restore <Known data>.

PROCEDURE Entering known point coordinate data from an external instrument

1. Connect CX and host computer.
2. Select "Known data" in Data Mode.
3. Select "Comms input" to display <Comms input>.


```
Known data
Job.JOB1
Key in coord
Comms input
Deletion
View
```

29. REGISTERING/DELETING DATA

Select the input format and press **[ENT]**.

Note

- Select either "T type" or "S type" according to the communication format used.

 "31.1 Configuration -Config Mode-" Communication Setup

Coordinate data starts to be entered from an external instrument and the number of received items is displayed on the screen. When data reception is completed, <Known data> is displayed.

- Press **{ESC}** to stop data reception in progress.
4. Receive the coordinate data for the next known point. Then, receive the coordinate data for other known points.
 5. Finish inputting the known points. After all registration is complete, press **[ESC]**. It returns to <Known Point>.

Note

- Selectable input formats
T type:GTS (Coord)/SSS (Coord)
S type: SDR33

Comms input

T type
S type

When "T type" is selected

Comms input

GTS(Coord)
SSS(Coord)

Comms input

Format	GTS(Coord)
Receiving	12

PROCEDURE Deleting designated coordinate data

1. Select "Known data" in Data Mode.
2. Select "Deletion" to display the list of known point data.

```
Known data
Job.JOB1
Key in coord
Comms input
Deletion
View
```

```
PT [REDACTED] 012
PT [REDACTED] 013
PT POINT01
PT ABCDEF
PT 123456789
↑↓·P FIRST LAST SRCH
```

3. Select the point name to be deleted and press **{ENT}**.

- **[↑↓...P]** = Use **{▲}**/**{▼}** to move from page to page.
- **[↑↓...P]** = Use **{▲}**/**{▼}** to select individual point.
- Press **[FIRST]** to display top of point name list.
- Press **[LAST]** to display end of point name list.

- **[SRCH]**

```
☞ "12.1 Entering Instrument
Station Data and Azimuth
Angle PROCEDURE
Coordinate Data Search
(Complete match) /
PROCEDURE Coordinate
Data Search (Partial match)"
```

```
N [REDACTED] 567.950
E [REDACTED] -200.820
Z [REDACTED] 305.740
PT [REDACTED] 5
NEXT PREV DEL
```


4. Press **[DEL]** to delete the selected point name.
 - Press **[PREV]** to display previous data.
 - Press **[NEXT]** to display next data.

29. REGISTERING/DELETING DATA


5. Press **{ESC}** to quit the point name list and return to <Known data>.

PROCEDURE Clearing all coordinate data at once (initialization)

1. Select "Known data" in Data Mode.
2. Select "Clear" and press **{ENT}**.

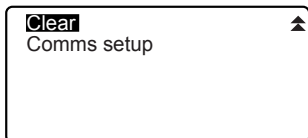

3. Press **[YES]**.
<Known data> is restored.

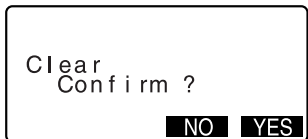


29.2 Reviewing Known Point Data

It is possible to display all the coordinate data within the current JOB.

PROCEDURE

1. Select "Known data" in Data Mode.
 - Current JOB name is displayed.
2. Select "View".
The point name list is displayed.

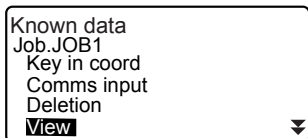

3. Select the point name to be displayed and press **{ENT}**.
The coordinates of the selected point name are displayed.

```
PT [REDACTED] 012
PT [REDACTED] 013
PT POINT01
PT ABCDEF
PT 123456789
PT [REDACTED]
↑↓·P FIRST LAST SRCH
```

```
N [REDACTED] 567.950
E [REDACTED] -200.820
Z [REDACTED] 305.740
PT [REDACTED] 5
NEXT PREV DEL
```

4. Press **{ESC}** to restore the point name list.
Press **{ESC}** again to restore
<Known data>.

29.3 Registering/Deleting Codes

It is possible to save codes in memory. You can also read in codes registered in memory when recording instrument station data or observation data.

PROCEDURE Inputting Codes

1. Select "Code" in Data Mode.

```
Data
JOB
Known data
Code
```

2. Select "Key in code".
Enter the code and press **{ENT}**.
The code is registered and
<Code> is restored.

```
Code
Key in code
Comms input
Comms output
Deletion
Code view
```

Note

- Maximum code size: 16 (alphanumeric)
- Maximum number of codes registered: 60

```
Code [REDACTED] A
: Pole
```

PROCEDURE Entering code from an external instrument



- Only the codes for communication formats compatible with "T type" can be input.
- When registering the code, it is necessary to select "T type" in the communication setting.

"31.1 Configuration -Config Mode-" Communication Setup

1. Connect the CX and a host computer in advance.
2. Select "Code" in the Data mode.

```
Data
JOB
Known data
Code
```

3. Select "Comms input" and press **[ENT]**.
Code communication starts and the number of transmitted data is displayed. When transfer is completed, the screen returns to <Code>.
 - Pressing **{ESC}** stops data transfer.


```
Code
Key in code
Comms input
Comms output
Deletion
Code view
```

```
Code
Format   CODE
Receiving  15
```

PROCEDURE Deleting codes

1. Select "Code" in Data Mode.
2. Select "Deletion". The registered code list is displayed.

```
Code
Key in coord
Comms input
Comms output
Deletion
Code view
```



- Align the cursor with the code to be deleted and press **[DEL]**.
The designated code is deleted.

```

Pole
A001
TREE01 LEFT
POINT01
POINT02
↑↓·P  FIRST  LAST  DEL

```

- Press **{ESC}** to restore <Code>.



- If you select "Clear list" in step 2 and then press **[YES]**, all registered codes are deleted.

29.4 Reviewing Codes

PROCEDURE

- Select "Code" in Data Mode.
- Select "Code view".
The registered code list is displayed.
- Press **{ESC}** to restore <Code>.

```

Code
Key in coord
Comms input
Comms output
Deletion
Code view

```

```

Pole
A001
Point 001
TREE01 LEFT
POINT01
↑↓·P  FIRST  LAST

```

30. OUTPUTTING JOB DATA

It is possible to output JOB data to a host computer.

- Connect the serial connector and the host computer with the interface cable.
- Complete the necessary communication settings in advance. Communication setup can be performed in the JOB menu as well. Select "Comms Setup" in <JOB>.



Interface cables: "34.2 Optional accessories"

Output format and command operations: "Communication manual"

- Measurement results, instrument station data, known point data, notes, and coordinate data in the JOB is output.
- Known point data entered from an external instrument is not output.



- When "inch" is selected as the distance unit, data is output in "feet" or "US feet" depending on the feet unit selected.

30.1 Outputting JOB Data to Host Computer

PROCEDURE

1. Connect CX and host computer.
2. Select "JOB" in Data Mode.
3. Select "Comms output" to display the JOB list.

Data
JOB
Known data
Code

JOB
JOB selection
JOB details
JOB deletion
Comms output
Comms setup

4. Select "T type" or "S type".
Press **[ENT]** after selection.

Note

- Select either "T type" or "S type" according to the communication format used.

☞ "31.1 Configuration -Config Mode-" Communication Setup

```
Comms output
T type
S type
```

5. Select the JOB to be output and press **{ENT}**.
"Out" appears to the right of the JOB selected. You can select as many JOBS as you want.

```
* JOB01      Out
JOB02      254
JOB03      Out
JOB04      0
JOB05      0
          OK
```

- "*" means the JOB has not been output to an external device yet.

6. Press **[OK]**.
7. Select the output format and press **{ENT}**.

When T type is selected

```
Comms output
GTS(Obs)
GTS(Coord)
SSS(Obs)
SSS(Coord)
```

When S type is selected

```
Comms output
SDR33
SDR2X
```

30. OUTPUTTING JOB DATA

When "GTS (Obs)" or "SSS (Obs)" is selected, select the output format of distance data.

- Selecting "Obs data" outputs the slope distance. Selecting "Reduced data" outputs the horizontal distance data converted from the slope distance. (When the SSS format is selected, the height difference is also output.)

Comms output
Obs data
Reduced data



- When the instrument station data is not recorded during the measurement, selecting "Reduced data" may cause output of an unintended measurement result.
8. Press **{ENT}** to start outputting data in the current JOB. After output is completed, the screen returns to the list of JOBS, where you can output data in other JOBS.
- Press **{ESC}** to stop data output in progress.

PROCEDURE Code output to a host computer



- Only the codes for communication formats compatible with "T type" can be output.
- When outputting the code, it is necessary to select "T type" in the communication setting.

 "31.1 Configuration -Config Mode-" Communication Setup

1. Connect the CX and a host computer in advance.

2. Select "Code" in the Data mode.

```
Data
JOB
Known data
Code
```

3. Select "Comms output" and press **{ENT}**. Code output begins. After code output is completed, the screen returns to the Code menu.

```
Code
Key in code
Comms input
Comms output
Dletion
Code view
```

31. CHANGING THE SETTINGS

This section explains the contents of parameter settings, how to change settings and how to perform initialization. Each item can be changed to meet your measurement requirements.

31.1 Configuration -Config Mode-

The following explains the Config Mode.

Config	
Obs.condition	
Instr.config	
Instr.const	
Comms setup	
Unit	▼

Key function	▲
Change Password	
Date and time	

● Observation Condition

Select "Obs. condition" in Config mode

Dist mode	: Sdist	
H Dist	: Ground	
Tilt crn	: Yes(H,V)	
coll. crn	: Yes	
C&R crn.	: K=0.20	
Sea level crn	: No	▼

V.obs	: Zenith	▲
Coord.	: N-E-Z	
Ang.reso	: 1"	
Sheet mod	: On	
Ofs V angr.	: Hold	
Stn.ID Inc	: 100	▼

V manual	: No	▲
Input order	: PT → CODE	

Items set and options (*: Factory setting)

Dist mode	Sdist*, Hdist, Vdist
H Dist (Horizontal distance display method)	Ground*, Grid
Tilt crn (Tilt angle compensation)	Yes(H,V)*, Yes(V), No
coll. crn (Collimation correction)	Yes*, No
C&R crn. (Earth curvature and refraction correction)	No, K=0.142, K=0.20*
Sea level crn (Sea level correction)	Yes, No*

V.obs (Vertical angle display method)	Zenith*, Horiz, Horiz 90° (Horizontal ±90°)
Coord.	N-E-Z*, E-N-Z
Ang.reso.(Angle resolution)	1"*, 5"
Sheet mod	On*, Off
Ofs V ang	Hold*, Free
Stn.ID Incr. (station ID increment)	0 to 99999 (100*)
V manual	Yes, No*
Input order	PT ➡ CODE*/CODE ➡ PT



Horizontal distance (H Dist)


The CX calculates the horizontal distance using the slope distance. There are the following 2 ways to display the horizontal distance data.

Ground:

The distance that reflects neither the Sea level correction factor nor the Scale factor.

Grid:

The distance in the plane rectangular coordinates system that reflects the Sea level correction and Scale factors (or the distance in the plane rectangular coordinates system that reflects the Scale factor only, when "No" is set for "Sea level crn".)

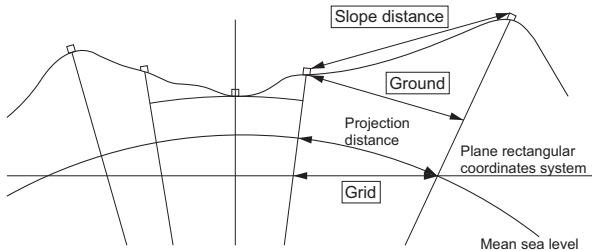

- The horizontal distance data recorded in this instrument is the ground distance only, and the displayed value changes according to the settings for the horizontal distance. When reviewing the observation data in the TOPO menu, set "Horizontal distance" and "Scale factor" so that the intended value is displayed.

31. CHANGING THE SETTINGS

- If horizontal distance is requested when selecting "T type" or by the GTS command, uncorrected "ground distance" is output, regardless of the Sea level correction or Scale factor setting.



Automatic tilt angle compensation mechanism

The vertical and horizontal angles are automatically compensated for small tilt errors using the 2-axis tilt sensor.

- Read the automatically compensated angles when the display has stabilized.
- The horizontal angle error (vertical axis error) fluctuates according to the vertical axis, so when the instrument is not completely leveled, changing the vertical angle by rotating the telescope will cause the displayed horizontal angle value to change.
Compensated horizontal angle = Measured horizontal angle + Tilt in angle / tan (Vertical angle)
- When the telescope is directed close to the zenith or nadir angle, tilt compensation is not applied to the horizontal angle.



Collimation correction

The CX has a collimation correction function that automatically corrects horizontal angle errors caused by horizontal axis and leveling axis errors. Normally set this item to "Yes".



Sea level correction

The CX calculates horizontal distance using slope distance values. As this horizontal distance does not take height above sea level into consideration, performing spherical correction is recommended when measuring at high altitudes. Spherical distance is calculated as follows.

$$(HDg) = \frac{R}{(R+H)} \times HD$$

Where: R = radius of the spheroid (6371000.000m)

H = averaged elevation of the instrument point and target point


HDg = Spherical distance

HD = horizontal distance

- *1 The averaged elevation is automatically calculated from the instrument point elevation and the collimation point elevation.



V obs. (vertical angle display method)

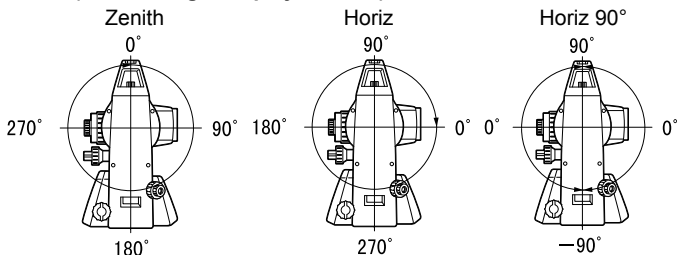

Sheet mod (Selecting target)

The target can be changed by selecting the option under "Target" in the EDM Settings, or by pressing **{SHIFT}** in the screen where the target symbol is displayed. The selection items can be preset to "Prism/Sheet/N-prism (reflectorless)" or "Prism/N-prism (reflectorless)".



Ofs V ang

Select whether the vertical angle is fixed in the angle offset measurement.



Input order

The input order of point name and code in recording screens can be selected.

● Instrument Configuration

Select "Instr. Config" in Config mode

Power off	: 30min
Reticle lev	: 3
Contrast	: 10
Resume	: On
EDM ALC	: Free

31. CHANGING THE SETTINGS

Items set and options (*: Factory setting)

Power off	5min, 10min, 15min, 30min*, No
Reticle lev	0 to 5 level (3*)
Contrast	0 to 15 level (10*)
Resume	On*, Off
EDM ALC	Hold, Free*



Power-saving automatic cut-off

To save power, power to the CX is automatically cut off if it is not operated for the selected time.



Resume function

When the Resume function is set to "On" and the power is switched off and then on again, the screen appearing before the instrument was switched off, or a prior screen is redisplayed.



- When the Resume function is set to "Off", values input before the power is switched off will disappear.



EDM ALC

Set the light receiving status of the EDM. While carrying out continuous measurement, set this item according to the measurement conditions.

- When EDM ALC is set to "Free" the instrument's ALC will be automatically adjusted if an error occurs as a result of the amount of light received. Set to "Free" when the target is moved during measurement or different targets are used.
- When "Hold" is set, the amount of light received will not be adjusted until initial adjustment has been performed and continuous measurement completed.
- Try setting to "Hold" when the light beam used for measurement is stable but is frequently obstructed by obstacles such as people, cars, or tree branches etc. preventing measurement from being performed.



- When the distance measurement mode is set to "Tracking" (target is moving during distance measurement), the distance will be measured in "Free" status regardless of the EDM ALC setting.

● Communication Setup

Select "Comms setup" in Config mode

Baud rate	: 9600bps
Data bits	: 8bit
Parity	: None
Stop bit	: 1bit
Check sum	: No
ACK/NAK	: No

CR, LF	: No	▲
ACK mode	: Standard	

Items set and options (*: Factory setting)

Baud rate	1200bps, 2400bps, 4800bps, 9600bps*, 19200bps, 38400bps
Data bits	8bit*, 7bit
Parity	None*, Odd, Even
Stop bit	1bit*, 2bit
ACK/NAK	Yes, No*

The setting effective when selecting "T types"

CR, LF	Yes, No*
ACK mode	Standard*, Omitted

The setting effective when selecting "S types"

Check sum	Yes, No*
-----------	----------

Note

- The followings are communication formats compatible with the CX.

T type	GTS (Obs / Coord), SSS (Obs / Coord)
S type	SDR33, SDR2X

Depending on the communication format used, select T type/S type.

 Output format and command operations: "Communication manual"

31. CHANGING THE SETTINGS

● Unit

Select "Unit" in Config mode

Temp.	: C
Press.	: hPa
Angle	: degree
Dist	: meter


Items set and options (*: Factory setting)

Temp. (Temperature)	°C*, °F	
Press	hPa*, mmHg, inchHg	
Angle	degree*, gon, mil	
Dist	meter*, feet, inch	
Feet (only displayed when "feet" or "inch" selected above)	Int. feet* (1m = 3.280839895), US feet (1m = 3.280833333)	



Inch (Fraction of an inch)

"Fraction of an inch" is the unit used in the United States and expressed like the following example.

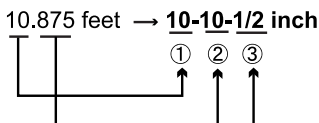

- ① 10.000 feet
- ② 0.875 feet x 12=10.5 inch
- ③ 0.5 inch=1/2 inch



- Even if "inch" is selected in this setting, all the data including the result of area calculation are output in "feet" and all the distance values must be input in "feet". In addition, when the "inch" display exceeds the range, it is displayed in "feet".



International feet and US survey feet

The CX can display feet values in International feet and US survey feet units.

International feet, the standard feet units, are referred to simply as "feet" elsewhere in this manual.

US survey feet are units used in surveys by the U.S. Coast and Geodetic Survey and are referred to as "US feet" in this manual.

When "feet" or "inch" is selected in "Dist", the "Feet" item will appear on the screen as below. When "meter" is selected, this item will not be displayed.

Temp.	:	°C
Press.	:	hPa
Angle	:	degree
Dist	:	feet
Feet	:	Int. feet

Results displayed in feet will differ according to the unit selected in this item.

● Date and time

Select "Date and time" in Config mode

Date and time
Date: Jan / 01 / 2015
Time: 16:44:38

Date: Entry example	July 20, 2015 → 20150720 (YYYYMMDD)
Time: Entry example:	2:35:17 p.m. → 143517 (HHMMSS)

31.2 EDM Settings

The following explains the EDM settings.

- "": Factory setting

Press **[EDM]** in the second page of OBS mode.

EDM	
Mode	: Fine "r"
Reflector	: Prism
PC	: 0

EDM	
Temp.	: 15 °C
Pres.	: 1013 hPa
ppm	: 0
[Oppm]	

- **[Oppm]**: Atmospheric correction factor returns to 0 and temperature and air pressure are set to the default values.

31. CHANGING THE SETTINGS

- Atmospheric correction factor is calculated and set using the entered values of the temperature and air pressure. Atmospheric correction factor can also be entered directly.

Items set, options, and input range (*: Factory setting)

Mode (Distance measurement Mode)	Fine "r"*, Fine AVG (Setting: 1 to 9 times), Fine "s", Rapid "r", Rapid "s", Tracking
Reflector	Prism*, Sheet, N-prism (reflectorless)
PC (Prism constant)	-99 to 99 mm ("Prism" is selected: 0*, "Sheet" is selected: 0*)
Temp. (Temperature)	-35 to 60°C (15*)
Air pressure	500 to 1400hPa (1013*)/ 375 to 1050mmHg (760*)
ppm (Atmospheric correction factor)	-499 to 499 (0*)



Atmospheric correction factor

The velocity of the light beam used for measurement varies according atmospheric conditions such as temperature and air pressure. Set the atmospheric correction factor when you wish to take this influence into account when measuring.

- The CX is designed so that the correction factor is 0 ppm at an air pressure of 1013 hPa, a temperature of 15°C, and a humidity of 50%.
- By inputting the temperature and air pressure values, the atmospheric correction value is calculated using the following formula and set into the memory. (humidity is regarded as 50%)

Atmospheric Correction Factor (ppm) =

$$282.324 - \frac{0.294362 \times p}{1 + 0.003661 \times t} + \frac{0.04127 \times e}{1 + 0.003661 \times t}$$

t : Air temperature (°C)

p : Pressure (hPa)

e : Water vapor pressure (hPa)

h : Relative humidity (%)

E : Saturated water vapor pressure

- e (water vapor pressure) can be calculated using the following formula.

$$e = h \times \frac{E}{100} \frac{(7.5 \times t)}{(t + 237.3)}$$

$$E = 6.11 \times 10^{(t + 237.3)}$$

With constant pressure, a temperature change of 1°C: an index change of 1 ppm.

With constant temperature, a pressure change of 3.6 hPa: an index change of 1 ppm.

To perform high accuracy measurements, it is necessary to find the atmospheric correction factor from even more accurate temperature and pressure measurements and perform an atmospheric correction.

It is recommended that extremely precise instruments be used to monitor the air temperature and pressure.

- Determine the temperature and pressure as follows.


Flat terrain :Use the temperature and pressure at the midpoint of the line.

Mountainous terrain :Use the temperature and pressure at the intermediate point (C).

If it is not possible to measure the temperature and pressure at the midpoint, take the temperature and pressure at the instrument station (A) and the target station (B), then calculate the average value.

Average air temperature : $(t_1 + t_2)/2$


Average air pressure : $(p_1 + p_2)/2$

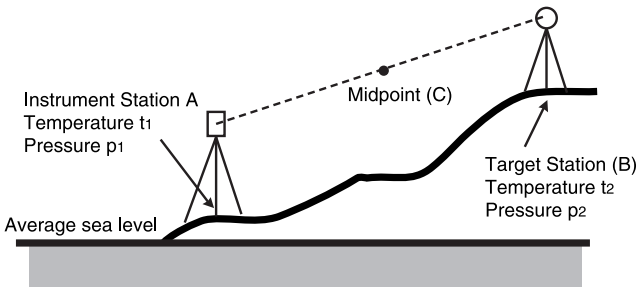

- If the weather correction is not required, set the ppm value to 0.

31. CHANGING THE SETTINGS

Atmospheric correction chart

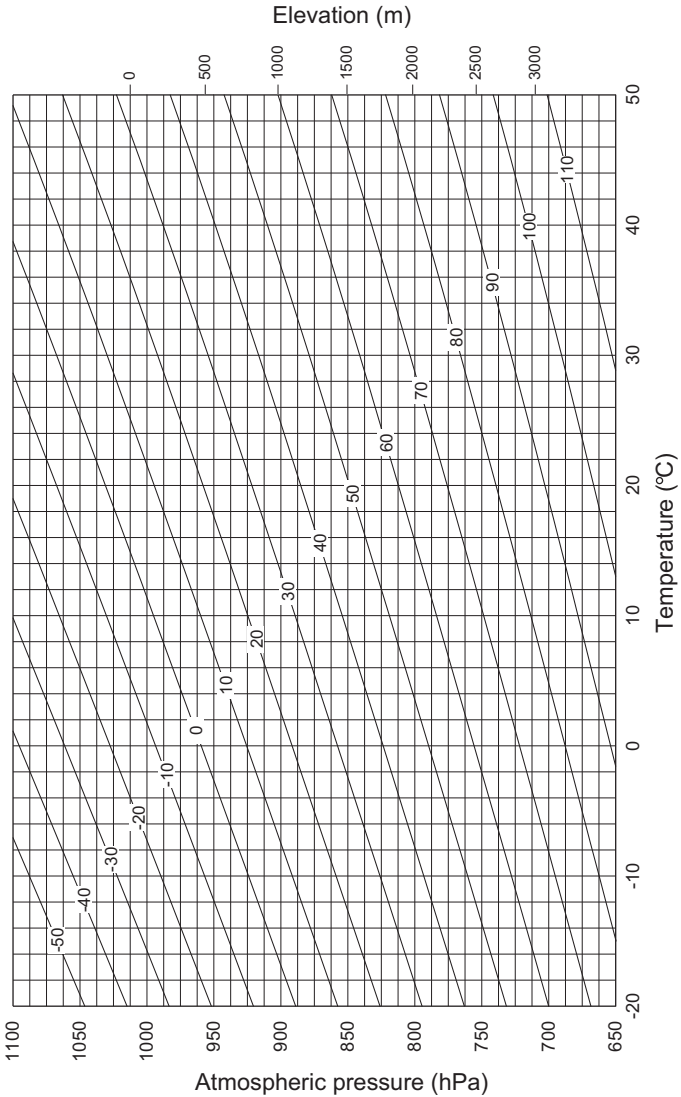

**Prism constant correction**

Reflective prisms each have their prism constant.

Set the prism constant correction value of the reflective prism you are using.

When selecting "N-prism (Reflectorless)" in "Reflector", prism constant correction value is set to "0" automatically.

31.3 Allocating Key Functions

It is possible to allocate the softkeys in OBS mode to suit the measurement conditions. It is possible to operate the CX efficiently because unique softkey allocations can be preset to suit various applications and the ways that different operators handle the instrument.

- The current softkey allocations are retained until they are revised again, even when the power is cut off.
- It is possible to register two sets of key function allocations: user setting 1 and user setting 2.
- It is possible to recall the softkey arrays registered for User 1 and User 2 as necessary.



- When softkey allocations are recorded and registered, the previously recorded key settings are cleared. When a softkey array is recalled, the key array is changed to the key array that has been recalled, clearing the previous key array. Be sure to remember this.

● **The following are the softkey allocations when the CX was shipped.**

Page 1 [MEAS] [SHV] [0SET] [COORD]

Page 2 [MENU] [TILT] [H-SET] [EDM]

Page 3 [MLM] [OFFSET] [TOPO] [S-O]

● **The following functions can be allocated to the softkeys.**

[MEAS]	: Distance measurement
[SHV]	: Switch between angle display and distance display
[0SET]	: Set horizontal angle to 0
[COORD]	: Coordinates measurement
[REP]	: Repetition measurement
[MLM]	: Missing line measurement
[S-O]	: Setting-out measurement

31. CHANGING THE SETTINGS

[OFFSET]	: Offset measurement
[TOPO]	: To TOPO menu
[EDM]	: Setting EDM
[H-SET]	: Set required horizontal angle
[TILT]	: Display tilt angle
[MENU]	: To Menu mode (Coordinates measurement, setting-out measurement, offset measurement, repetition measurement, missing line measurement, REM measurement, resection measurement, surface area measurement, set-out line, set-out arc, point projection, intersections, traverse)
[REM]	: REM measurement
[RESEC]	: Resection measurement (The instrument station coordinate can be recorded on the measurement result screen.)
[R/L]	: Select horizontal angle right/left
[ZA / %]	: Switch between zenith angle/slope in %
[HOLD]	: Hold horizontal angle/release horizontal angle
[CALL]	: Display final measurement data
[S-LEV]	: Return signal
[AREA]	: Surface area measurement
[F/M]	: Switch between meters/feet
[HT]	: Set the instrument station height and target height
[S-O LINE]	: Setting-out line measurement
[S-O ARC]	: Setting-out arc measurement
[P-PROJ]	: Point projection measurement
[PTL]	: PT to Line
[INTSCT]	: Intersections measurement
[TRAV]	: Traverse adjustment
[ROAD]	: Route surveying
[X SECT]	: Cross section survey
[TOPOII]	: Topography observation
[HVDOUT-T] / [HVDOUT-S]	: Output distance/angle measurement results to an external instrument
[HVOUT-T] / [HVOUT-S]	: Output angle measurement results to an external instrument
[NEZOUT-T] / [NEZOUT-S]	: Output the coordinate results to an external instrument
[---	: No functions set

● Softkey Allocation Examples

It is possible to allocate the same key to each page (example 1). The same function can be allocated to more than one key on the same page (example 2). And it is also possible to allocate a function to only one key (example 3).

Allocation example 1:

P1 [MEAS] [SHV] [H-SET] [EDM]

P2 [MEAS] [SHV] [H-SET] [EDM]

Allocation example 2:

P1 [MEAS] [MEAS] [SHV] [SHV]

Allocation example 3:

P1 [MEAS] [SHV] [---] [---]

PROCEDURE Allocating functions

1. Select "Key function" in Config Mode.
Select "Define." Currently allocated softkeys are displayed in <Key function>.

2. Align the cursor with the softkeys whose allocation you want to change using \leftarrow / \rightarrow .
The cursor of the selected softkey flashes.

Key function			
MEAS	SHV	0SET	COORD
MENU	TILT	H-SET	EDM
MLM	OFFSET	TOPO	S-O
			OK

3. Change the softkey function using \blacktriangle / \blacktriangledown .
Set the softkey function and its location by pressing \leftarrow / \rightarrow . The set softkey stops flashing and the cursor flashes on the next softkey.


Key function			
MEAS	SHV	MLM	COORD
MENU	TILT	H-SET	EDM
MLM	OFFSET	TOPO	S-O
			OK


4. Repeat steps 2 to 3 only as many times as necessary.

31. CHANGING THE SETTINGS

- Press **[OK]** to record the allocations and restore <Key function>. The functions with their new allocations are displayed in OBS mode.

PROCEDURE Registering an allocation


- Allocate functions to the softkeys.
 "PROCEDURE Allocating functions"
- Select "Key function" in Config mode.
- Select "Registration."
Select either "User'1" or "User'2" as the softkey array to be registered.
- Press **{ENT}**. The softkey array is registered as user 1 or user 2 and <Key function> is restored.

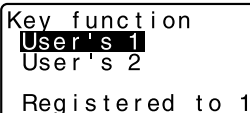

```
Key function
User's 1
User's 2
Registered to 1
```

PROCEDURE Recalling an allocation

- Select "Key function" in Config Mode.
- Select "Recall." Select the key array for either User 1, User 2, or Default (setting when the CX was shipped), and press **{ENT}**. <Key function> is restored. This displays the functions in the recalled array in OBS mode.

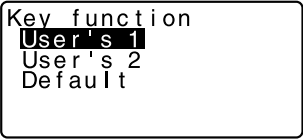

```
Key function
User's 1
User's 2
Default
```

31.4 Changing Password


Set password can be changed.

- No password was set when the CX was shipped.

PROCEDURE Changing password

1. Select "Change Password" in Config mode.

2. Input old password and press **{ENT}**.

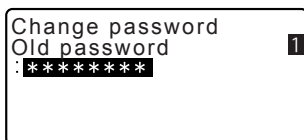

```
Change password
Old password
:*****
1
```

3. Input new password twice and press **{ENT}**. The password is changed and <Config> is restored.



```
Change password
New password
:*****
New password again
:*****
1
```


- If no password was input as new password and **{ENT}** was pressed, no password is set.



- Input range of password: 3 or more characters and 8 or fewer characters.

31.5 Restoring Default Settings

The following explains the two methods of restoring default settings: Restoring set items to initial settings and turning power on. Initializing the data and turning power on.

- Restore the following items to the initial settings when the CX was shipped.
EDM setting, Config mode settings (including softkey arrays)
 About initial settings when the CX was shipped: "31.1 Configuration - Config Mode-", "31.3 Allocating Key Functions"
- Initialize the data. The following data is initialized.
Data within all jobs
Known point data within memory
Code data within memory

PROCEDURE Restoring set items to initial settings and turning power on

1. Turn the power off.
2. While pressing **{F4}** and **{B.S.}**, press **{ON}**.
3. The CX is turned on, "Default set" appears on the screen and all items are restored to their initial settings.

PROCEDURE Initializing the data and turning the power on

1. Turn the power off.
2. While pressing **{F1}**, **{F3}** and **{B.S.}**, press **{ON}**.
3. The CX is turned on, "Clearing memory..." appears on the screen and all items are restored to their initial settings.

32. WARNING AND ERROR MESSAGES

The following is a list of the error messages displayed by the CX and the meaning of each message. If the same error message is repeated or if any message not shown below appears, the instrument has malfunctioned. Contact your local dealer.

BadCondition

The air is shimmering a lot, etc., measuring conditions are poor.

The center of the target cannot be sighted.
Resight the target.

Unsuitable distance measurement conditions when reflectorless measurement is set. When reflectorless measurement is set, distance cannot be measured because the laser beam is striking at least two surfaces at the same time.

Choose a single surface target for distance measurement.

Calculation error

Coordinates identical to the known point coordinates observed during resection exist. Set another known point so that the known point coordinates do not coincide.

An error occurred during calculation.

Checksum error

A sending/repetition error has occurred between the CX and external equipment.

Send/receive the data again.

Clock error

Clock error occurs when the voltage of the lithium battery decreases or the battery itself is depleted. For details on replacing lithium batteries contact your local dealer.

Communication error

A reception error has occurred in coordinate data from an external instrument.

Check the settings of parameters concerning communication conditions.

32. WARNING AND ERROR MESSAGES

Flash write error!

It is impossible to read in data.
Contact your local dealer.

Incorrect Password

Input password does not match set password. Input correct password.

Invalid baseline

During setting-out line measurement or point projection measurement, baseline has not been defined correctly.

Memory is full

There is no more room to enter data.
Record the data again after deleting unnecessary data from the JOB or coordinate data from the memory.

Need 1st obs

During missing line measurement, the observation of the starting position was not completed normally.
Sight the starting position accurately and press **[OBS]** to perform the measurement again.

Need 2nd obs

During missing line measurement, the observation of the target was not completed normally.
Sight the target accurately and press **[MLM]** to perform the measurement again.

Need offset pt.

Observation of the offset point during offset measurement was not completed normally.
Sight the offset point accurately and press **[OBS]** to perform the measurement again.

Need prism obs

During REM measurement, the observation of the target was not completed normally.
Sight the target accurately and press **[OBS]** to perform measurement again.

New password Diff.

Passwords input when setting a new password do not match.
Input the same password twice.

No data

When searching for or reading in coordinate data or searching for code data, the search stopped either because the item in question does not exist or the data volume is large.

No solution

The calculation of the instrument station coordinates during resection does not converge.

Assess the results and if necessary, perform the observation again.

Intersect point could not be calculated. Either necessary data items were not input or the Intersect point does not exist.

North/East is null, Read error


The Northing or Easting field of the given coordinate is null.

Input the coordinate.

Out of range

The tilt of the instrument exceeds the tilt angle compensation range during measurement.

Level the instrument again.

 "7.2 Levelling"

A direction which does not cross with the base plane during plane offset measurement.

Out of value

During gradient % display, the display range (less than $\pm 1000\%$) has been exceeded.

During REM measurement, either the vertical angle has exceeded horizontal $\pm 89^\circ$ or the measured distance is greater than 9999.999m.

Install the instrument station far from the target.

The instrument station coordinates calculated during resection are too high. Perform the observation again.

During setting-out line measurement, scale factor has been less than 0.100000 or exceeded 9.999999.

During area calculation, results exceeded the display range.

32. WARNING AND ERROR MESSAGES

Pt already on route

Traverse tried to close on a traverse point other than the Start pt. during automatic route search. Press any key to return to the last point found in automatic route search. Either select the next traverse point to continue the current search or specify the Start pt. to close a closed-loop traverse.

Please use the Star key in obs mode
Can be used only in the Observation mode.

Pt1-Pt2 too near

When setting the baseline with "Point to Line", two reference points are too close.

Leave the space of 1 m or longer between the two reference points.

Same coordinates

The same values are input in Pt.1 and Pt.2 in setting-out line measurement.
CX cannot define the baseline.

SDR format err

The file read in is not SDR format. Check the file.

Send first

JOB data output (transmission to the host computer) is not completed before JOB is cleared.

Either transmit the JOB to be cleared to the host computer.

Signal off

Measuring conditions are poor, and there is not any reflective light for measuring distances.

Resight the target. When using reflective prisms, effectiveness will be improved by increasing the number of prisms used.

Station coord is Null

Cannot calculate. Station point coordinate is set to "Null".

Input the coordinate.

Temp Range OUT

CX is outside useable temperature range and accurate measurement cannot be performed. Repeat measurement within the appropriate temperature range. If the CX is used under direct sunlight, use an umbrella to protect it against the heat of the sun.

Time out (during measurement)

Measuring conditions are poor, and due to the insufficient amount of reflective light, measuring could not be carried out within the time specified.

Resight the target. When using reflective prisms, effectiveness will be improved by increasing the number of prisms used.

Too short

Input password has fewer than 3 characters. Password must have 3 or more characters and 8 or fewer characters.

The calculated result is too large to be displayed on the screen in its totality.

33. CHECKS AND ADJUSTMENTS

 
A CX is a precision instrument that requires fine adjustments. It must be inspected and adjusted before use so that it always performs accurate measurements.

- Always perform checking and adjustment in the proper sequence beginning from "33.1 Circular Level" to "33.6 Additive Distance Constant".
- In addition, the instrument should be inspected with special care after it has been stored a long time, transported, or when it may have been damaged by a strong shock.
- Make sure the instrument is securely set up and stable before performing checks and adjustments.

33.1 Circular Level


PROCEDURE Checking and adjusting

1. Level while checking the display.

 "7.2 Levelling"




- If the tilt sensor is misaligned, the circular level is not adjusted correctly.

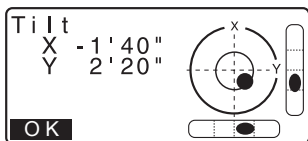

2. Check the position of the bubble of the circular level.
If the bubble is not off-center, no adjustment is necessary.
If the bubble is off-center, perform the following adjustment.

3. First confirm the off-center direction.
Use the adjusting pin to loosen the circular level adjustment screw on the side opposite to the direction the bubble is displaced to move the bubble to the center.

Circular level
adjusting screws

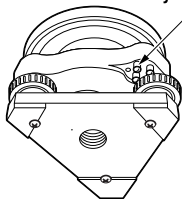

- Adjust the adjusting screws until the tightening tension of the three screws is the same to align the bubble in the middle of the circle.



- Be careful that the tightening tension is identical for all the adjusting screws.
- Also, do not over-tighten the adjusting screws as this may damage the circular level.

33.2 Tilt Sensor

If the tilt angle shown on the display shifts from tilt angle 0° (zero point), the instrument is not correctly levelled. This will adversely affect angle measurement. Perform the following procedure to cancel the tilt zero point error.

PROCEDURE Check

- Carefully level the instrument. If necessary, repeat the procedures to check and adjust the bubble levels.
- Set the horizontal angle to 0° . Press **[OSET]** twice in the first page of the OBS mode screen to set the horizontal angle to 0° .
- Select "Instr. const" in the Config. mode screen to display the current correction constant in the X (sighting) direction and Y (horizontal axis) direction.

```
Config
Obs.condition
Instr.config
Instr.const
Comms setup
Unit
```

```
Instr.const
Tilt: X -10 Y 7
Collimation
```

33. CHECKS AND ADJUSTMENTS

Select "Tilt X Y" and press **{ENT}** to display the tilt angle in the X (sighting) direction and Y (horizontal axis) direction.

```
Tilt offset
X      - 0° 01' 23"
Y      0° 00' 04"
HA-R   00° 00' 00"
Take F1
      OK
```

4. Wait a few seconds for the display to stabilize, then read the automatically compensated angles X1 and Y1.
5. Loosen the horizontal clamp and turn the instrument 180° while referring to the displayed horizontal angle, then retighten the clamp.
6. Wait a few seconds for the display to stabilize, then read the automatically compensated angles X2 and Y2.

```
Tilt offset
X      - 0° 00' 03"
Y      0° 00' 04"
HA-R   180° 00' 00"
Take F2
      OK
```

7. In this state, calculate the following offset values (tilt zero point error).

$$X_{\text{offset}} = (X1 + X2) / 2$$

$$Y_{\text{offset}} = (Y1 + Y2) / 2$$

If one of the offset values (X_{offset} , Y_{offset}) exceeds $\pm 20''$, adjust the value using the following procedure.

When the offset value falls within the range $\pm 20''$, adjustment is not necessary.

Press **{ESC}** to return to <Instr. const>.

PROCEDURE Adjustment

8. Store values X2 and Y2.
Press **[OK]**. "Take F2" is displayed.

9. Rotate the top of the instrument through 180° until the displayed horizontal angle is $180^\circ \pm 1'$ and **[OK]** is displayed.

10. Wait a few seconds for the display to stabilize, then store the automatically compensated angles X1 and Y1.

Press **[YES]** to store tilt angles X1 and Y1. The new correction constant is displayed.

Tilt offset		
Current	X-10	Y 7
New	X 4	Y-11
		NO YES

11. Confirm that the values are in the adjustment range.

If both correction constant are within the range ± 180 , select **[YES]** to renew the correction angle. <Instr. const> is restored. Continue to step 12.

If the values exceed the adjustment range, select **[NO]** to cancel the adjustment and restore <Instr. const>. Contact your local dealer to perform the adjustment.

PROCEDURE Recheck

12. Press **{ENT}** at <Instr. const>.
13. Wait a few seconds for the display to stabilize, then read the automatically compensated angles X3 and Y3.
14. Rotate the top of the instrument through 180° .
15. Wait a few seconds for the display to stabilize, then read the automatically compensated angles X4 and Y4.

33. CHECKS AND ADJUSTMENTS

16. In this state, the following offset values (tilt zero point error) are calculated.

$$X_{\text{offset}} = (X3+X4)/2$$

$$Y_{\text{offset}} = (Y3+Y4)/2$$

When both offset values fall within the range $\pm 20''$, adjustment is completed.

Press **{ESC}** to return to <Instr. const>.

If one of the offset values (X_{offset} , Y_{offset}) exceeds $\pm 20''$, repeat the check and adjustment procedures from the beginning. If the difference continues to exceed $\pm 20''$ after repeating the check 2 or 3 times, have your local dealer perform the adjustment.

33.3 Collimation

With this option you can measure collimation error in your instrument so that the instrument can correct subsequent single face observations. To measure the error, make angular observations using both faces.




- Perform adjustment in weak sunlight and no scintillation.

PROCEDURE

1. Carefully level the instrument.
2. Install a target at a point about 100m in the horizontal direction from the instrument.




3. Display <Collimation>. Select "Instr.const" in the Config. mode screen and select "Collimation".
4. While the telescope is in Face 1, sight the center of the target correctly and press **[OK]**. Rotate the instrument 180°.
5. While the telescope is in Face 2, sight the center of the target correctly and press **[OK]**.
6. Press **[YES]** to set the constant.
 - Press **[NO]** to discard the data and return to the screen in step 4.

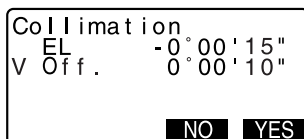

33.4 Reticle

PROCEDURE Check 1: Perpendicularity of the reticle to the horizontal axis


1. Carefully level the instrument.
2. Align a clearly visible target (the edge of a roof for example) on point A of the reticle line.

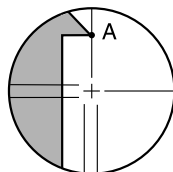

33. CHECKS AND ADJUSTMENTS

3. Use the telescope fine motion screw to align the target to point B on a vertical line.

If the target moves parallel to the vertical line, adjustment is unnecessary. If its movement deviates from the vertical line, have our service representative adjust it.

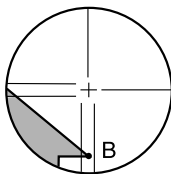

PROCEDURE Check 2: Vertical and horizontal reticle line positions



- Perform check in weak sunlight and no scintillation.
- "Tilt crn" should be set to "Yes (H,V)" and "coll.crn" to "Yes" in <Obs. condition> while performing checks.

1. Carefully level the instrument.
2. Install a target at a point about 100m in the horizontal direction from the instrument.
3. While the OBS mode screen is displayed and the telescope is in face 1, sight the center of the target and read out the horizontal angle A1 and the vertical angle B1.

Example: Horizontal angle $A1=18^{\circ} 34' 00''$
Vertical angle $B1=90^{\circ} 30' 20''$



4. While the telescope is in face 2, sight the center of the target and read out the horizontal angle A2 and the vertical angle B2.

Example: Horizontal angle A2=198° 34' 20"

Vertical angle B2=269° 30' 00"

5. Do the calculations:

A2-A1 and B2+B1

If A2-A1 is within $180^{\circ} \pm 20''$ and

B2(B1 is within $360^{\circ} \pm 40''$, adjustment is unnecessary.

Example: A2-A1 (Horizontal angle)

=198° 34' 20" - 18° 34' 00"

=180° 00' 20"

B2-B1 (Vertical angle)

=269° 30' 00" + 90° 30' 20"


=360° 00' 20"

If the difference is large even after repeating the check 2 or 3 times, make sure that checking and adjusting of "33.2 Tilt Sensor" and "33.3 Collimation" are completed. If the results remain the same, have our service representative perform the adjustment.

33.5 Optical Plummet



PROCEDURE Check

1. Carefully level the CX and exactly center a survey point in the reticle of the optical plummet.
2. Turn the upper part 180° and check the position of the survey point in the reticle.
If the surveying point is still centered, no adjustment is necessary.
If the surveying point is not still centered in the optical plummet, adjust as follows:

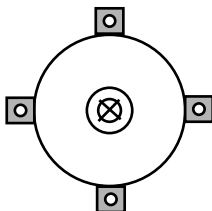


PROCEDURE Adjustment

3. Correct half the deviation with the levelling foot screw.
4. Firmly hold down the top portion of the instrument, and remove the optical plummet knob cover, then remove the optical plummet reticle cover on the inside. Replace the optical plummet knob cover. Use the 4 adjusting screws of the optical plummet to adjust the remaining half of the deviation as show below.

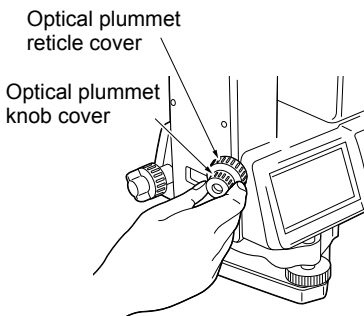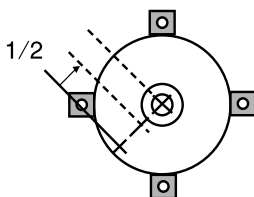


5. When the survey point is on the lower (upper) part of the illustration:

- 1 Loosen the upper (lower) screw slightly.
- 2 Tighten the lower (upper) screw by the same amount.

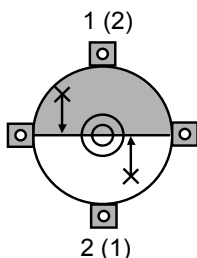


6. If the survey point is on the solid line (dotted line):

- 3 Loosen the right (left) screw slightly.
- 4 Tighten the left (right) screw by the same amount.

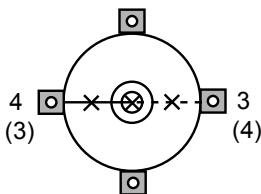

7. Check the adjustment by rotating the upper part of the instrument. The survey point should remain centered in the reticle. If necessary, repeat the adjustment.

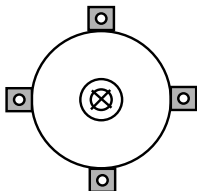

8. Remove the optical plummet knob cover, and install the optical plummet reticle cover on the inside.
Replace the optical plummet knob cover.



Do not over-tighten the 4 adjusting screws as this may cause the reticle to go out of adjustment.

33.6 Additive Distance Constant

The additive distance constant K of the CX is adjusted to 0 before delivery. Although it almost never deviates, use a baseline with a known distance precision to check that the additive distance constant K is close to 0 several times a year and whenever the values measured by the instrument begin to deviate by a consistent amount. Perform these checks as follows.




- Errors in setting up the instrument and reflective prism or in sighting the target will influence the additive distance constant. Be extremely careful to prevent such errors when performing these procedures.
- Set up so that the instrument height and the target height are identical. If a flat place is not available, use an automatic level to make sure the heights are identical.

PROCEDURE Check


1. Find an area of flat ground where two points 100m apart can be selected.

Set up the Instrument at point A and the reflective prism at point B. Establish a point C half way between points A and B.

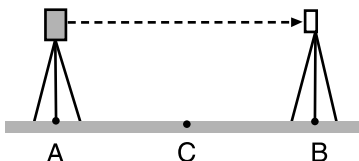

2. Precisely measure the horizontal distance between point A and point B 10 times and calculate the average value.

3. Place the CX at point C directly between points A and B and set up the reflective prism at point A.

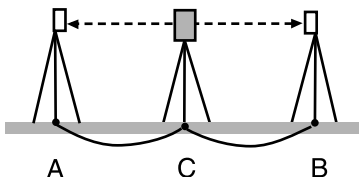

4. Precisely measure the horizontal distances CA and CB 10 times each and calculate the average value for each distance.
5. Calculate the additive distance constant K as follows.
$$K = AB - (CA+CB)$$
6. Repeat steps 1 to 5 two or three times.
If the additive distance constant K is within $\pm 3\text{mm}$ even once, adjustment is unnecessary.
If it always exceeds this range, have our service representative perform an adjustment.

34. STANDARD EQUIPMENT AND OPTIONAL ACCESSORIES

34.1 Standard equipment

When you use this instrument for the first time, ensure that there are no missing equipments.

☞ "List of standard components" (separate sheet)


34.2 Optional accessories

The following are optional accessories which are sold separately from the CX.

☞ Target and power supply optional accessories: "34.3 Target system" and "34.4 Power supplies".


● Plumb bob

The plumb bob can be used to set up and center the instrument on days when there is little wind. To use the plumb bob, unwind its cord, pass it through the cord grip piece as shown in the figure to adjust its length, then suspend it from the hook attached to the centering screw.

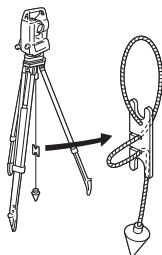

● Tubular compass (CP7)

Slide the tubular compass into the tubular compass slot, loosen the clamp screw, then rotate the top part of the instrument until the compass needle bisects the index lines. The telescope's face 1 sighting direction in this position will indicate magnetic north. After use, tighten the clamp and remove the compass from the slot.

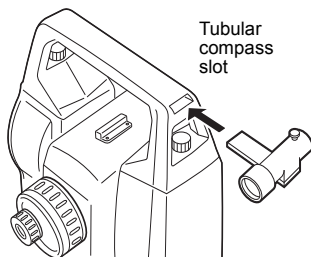

The tubular compass is susceptible to the influence of nearby magnets or metal. Such influence could cause it to fail to accurately indicate magnetic north. Do not use magnetic north as indicated by this compass for base line surveying.

● Telescope eyepiece lens (EL7)

Magnification: 40X

 
Field of view: 1° 20'


● Diagonal eyepiece (DE27)

The diagonal eyepiece is convenient for observations near the nadir and in narrow spaces.

Magnification: 30X


After removing the handle from the CX, loosen the attachment screw to remove the telescope eyepiece. Then screw the diagonal lens into place.

 Handle removal method:
"4.1 Parts of the Instrument"

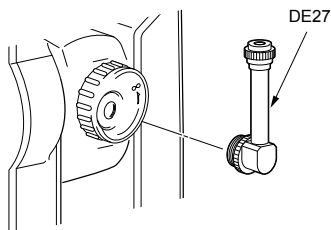

● Solar filter (OF3A)

When sighting targets where glare is present, solar observations for example, attach it to the objective lens of the CX to protect its interior and the eyes of the operator. The filter part can be flipped up without being removed.

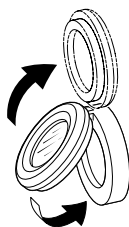

● Interface cable

Connect between the CX and the host computer for data output.

Cable	Notes
DOC210	Pin Numbers and signal levels : RS-232C compatible D-sub connector : 9pins (female)

34.3 Target system

The following are all special accessories (sold separately).



- When using a reflecting prism equipped with a target for distance and angle measurements, be sure to direct the reflective prism correctly and sight the center of the prism target accurately.
- Each reflective prism has its own prism constant value. When changing prisms, be sure to change the prism constant correction value.


● Reflecting Prism System (AP Series)

Use an appropriate system for CX.
The figure on the right is an example.
Because all reflecting prisms and accessories have standardized screws, it is possible to combine these prisms, accessories, etc. according to your objectives.



● 2-point target (2RT500-K)


This target is used for two-distance offset measurement.

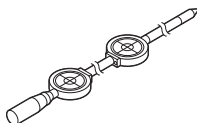

● Instrument height adaptor (AP41)

This device is used to adjust the height of the target.


- Make sure that the instrument height "236" (mm) is displayed in the instrument height adjustment window.

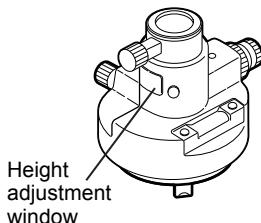


1. Install the tribrach to the instrument height adaptor.
2. Level the instrument and check the position of the bubble of the plate level.

34. STANDARD EQUIPMENT AND OPTIONAL ACCESSORIES


- Turn the upper part through 180° and check the bubble position. If the bubble is still centered, no adjustment is necessary. If the bubble is off-center, adjust as follows.

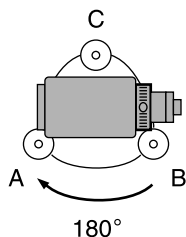

 
- Correct half of the bubble displacement using levelling foot screw C.



- Correct the remaining half of the displacement by using the adjustment pin to rotate the plate level adjustment screw. When the plate level adjustment screw is turned in the counterclockwise direction, the bubble moves in the same direction.

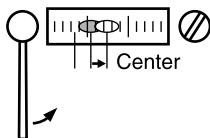


- Rotate the top of the instrument and continue adjustments until the bubble remains centered for any position of the upper part. If the bubble does not move to the center even when the adjustment has been repeated, ask your local dealer to adjust it.
- Adjust the optical plummet of the AP41 instrument height adaptor following the checking and adjustment methods of optical plummet.
 "33.5 Optical Plummet"

34.4 Power supplies

Operate your CX with the following combinations of power equipment.



- Be sure to carefully read the operating manuals for the battery and charger before operating.
- Never use any combination other than those indicated below. If you do, the CX could be damaged.

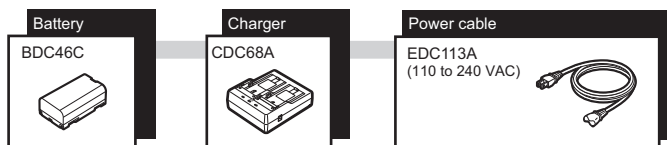

- Dedicated power cables differ according to the country or the area where the instrument is used. Contact your local dealer for the details.

35. SPECIFICATIONS

Except where stated, the following specifications apply to all models of CX Series.

Telescope

Length:	171mm
Aperture:	45mm (EDM:48mm)
Magnification	30X
Image:	Erect
Resolving power:	2.5"
Field of view	1°30'
Minimum focus:	1.3m
Focussing screw:	1 speed
Reticle illumination:	5 brightness levels

Angle measurement

Horizontal and Vertical circles type:

Rotary absolute encoder

Detecting

CX-52: 2 sides

CX-55: 1 side

IACS (Independent Angle Calibration System)

CX-52 only

Angle units: Degree/Gon/Mil (selectable)

Minimum display: 1" (0.0002gon/0.005mil)/5" (0.0010gon/0.02mil) (selectable)

Accuracy:

CX-52: 2" (0.0006gon/0.010mil)

CX-55: 5" (0.0015gon/0.025mil)

(ISO 17123-3 : 2001)

Measuring time: 0.5 sec or less

Collimation compensation: On/Off (selectable)

Measuring mode:

Horizontal angle: Right/Left (selectable)

Vertical angle: Zenith/Horizontal/Horizontal $\pm 90^\circ$ /% (selectable)

Tilt angle compensation

Type: Liquid 2-axis tilt sensor

Minimum display: 1"

Range of compensation: $\pm 6'$ (± 0.1111 gon)

Automatic compensator: ON (V & H/V)/OFF (selectable)

Compensation constant: Can be changed

Distance Measurement

Measuring method: Coaxial phase shift measuring system

Signal source: Red laser diode 690nm

35. SPECIFICATIONS

	Class 3R (IEC60825-1 Ed. 3.0: 2014/ FDA CDRH 21CFR Part 1040.10 and 1040.11 (Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No.50, dated June 24, 2007.)) (When the prism or reflective sheet is selected in Config mode as target, the output is equivalent to Class 1).
Measuring range:	(Using the following reflective prism/reflective sheet target during normal atmospheric conditions.* ¹) Reflective sheet RS90N-K* ³ : 1.3 to 500m (1,640ft) 1.3 to 300m (980ft)* ² Reflective sheet RS50N-K* ³ : 1.3 to 300m (980ft) 1.3 to 180m (590ft)* ² Reflective sheet RS10N-K* ³ : 1.3 to 100m (320ft) 1.3 to 60m (190ft)* ² Compact prism CP01: 1.3 to 2,500m (8,200ft) Standard prism AP01AR X 1: 1.3 to 4,000m (13,120ft)* ⁶ Mini pole prism OR1PA: 1.3 to 500m (1,640ft) Reflectorless (White)* ⁴ : 0.3 to 350m (1,140ft) 0.3 to 200m (650ft)* ⁷ Reflectorless (Gray)* ⁵ : 0.3 to 220m (720ft) 0.3 to 100m (320ft)* ⁷
Minimum display:	Fine/Rapid measurement: 0.001m (0.005ft / 1/8inch) Tracking measurement: 0.01m (0.1ft / 1/2inch)
Maximum slope distance display:	Prism/ reflective sheet: 7,680m (25,190ft) Reflectorless: 350m (1,140ft)
Distance unit:	m/ft/inch (selectable)
Accuracy: (Using prism)	Fine measurement: (2 + 2 ppm X D) mm Rapid measurement: (5 + 2 ppm X D) mm

(Using reflective sheet target)^{*3}

Fine measurement: $(3 + 2 \text{ ppm} \times D)$ mm

Rapid measurement: $(5 + 2 \text{ ppm} \times D)$ mm

(Reflectorless (White))^{*4}

Fine measurement:

$(3 + 2 \text{ ppm} \times D)$ mm (0.3 to 200m)

$(5 + 10 \text{ ppm} \times D)$ mm (over 200 to 350m)

Rapid measurement:

$(6 + 2 \text{ ppm} \times D)$ mm (0.3 to 200m)

$(8 + 10 \text{ ppm} \times D)$ mm (over 200 to 350m)

(Reflectorless (Gray))^{*5}

Fine measurement

$(3 + 2 \text{ ppm} \times D)$ mm (0.3 to 100m)

$(5 + 10 \text{ ppm} \times D)$ mm (over 100 to 170m)

$(10 + 10 \text{ ppm} \times D)$ mm (over 170 to 220m)

Rapid measurement:

$(6 + 2 \text{ ppm} \times D)$ mm (0.3 to 100m)

$(8 + 10 \text{ ppm} \times D)$ mm (over 100 to 170m)

$(15 + 10 \text{ ppm} \times D)$ mm (over 170 to 220m)

Measurement mode:

Fine measurement (single/repeat/average)/

Rapid measurement (single/repeat)/Tracking
(selectable)

Measuring time:

Fine measurement: 1.7 sec + every 0.9 sec.

Rapid measurement 1.4 sec + every 0.7 sec.

Tracking measurement: 1.4 sec + every 0.3 sec.

Atmospheric correction:

Temperature input range: - 35 to 60°C (in 0.1°C step)/ - 31 to 140°F (in 1°F step)

Pressure input range: 500 to 1,400 hPa (in 1hPa step)

375 to 1,050 mmHg (in 1mmHg step)

14.8 to 41.3 inchHg (in 0.1inchHg step)

ppm input range: -499 to 499 ppm (in 1 ppm step)

Prism constant correction:

-99 to 99 mm (in 1 mm step)

0mm fixed for reflectorless measurement

Earth curvature and refraction correction:

No/Yes K=0.142/Yes K=0.20 (selectable)

Scale factor setting:

0.5 to 2.0

Sea level correction:

No/Yes (selectable)

35. SPECIFICATIONS

- *1: Slight haze, visibility about 20 km, sunny periods, weak scintillation.
- *2: Measurement at 50 to 60°C (122 to 140°F)
- *3: Figures when the laser beam strikes within 30° of the reflective sheet target.
- *4: Figures when using Kodak Gray Card White side (reflection factor 90%) and brightness level is less than 30000 lx (a little cloudy).
- *5: Figures when using Kodak Gray Card Gray side (reflection factor 18%) and brightness level is less than 30000 lx (a little cloudy).
- *4,*5: When performing reflectorless measurement, the possible measurement range and precision will change depending on the target reflection factor, weather conditions and location conditions.
- *6: Face the prism toward the instrument during the measurement with the distance at 10 m or less.
- *7: At the time of the tracking measurement.

Internal memory

Capacity 5,000 measurement points

Data transfer

Data input/output Asynchronous serial, RS232C compatible

Power Supply

Power source: Rechargeable Li-ion battery BDC46C

Working duration at 20 °C:

Distance and angle measurement

(Fine single measurement = every 30 sec.):

BDC46C: about 15 hours

Battery state indicator: 4 levels

Auto power-off: 5 levels (5/10/15/30 min/Not set) (selectable)

Charging time at 25 °C: about 2.5 hours (using CDC68A)*⁸

Battery (BDC46C)

Nominal voltage 7.2V

Capacity 2430mAh

Dimensions 38 (W) x 70 (D) x 20 (H) mm

Weight about 103g

Charger (CDC68A)

Input voltage: AC100 to 240V

Charging time per battery (at 25°C):

BDC46C: about 2.5 hours

(Charging can take longer than the times stated above when temperatures are either especially high or low.)

Charging temperature range:	0 to 40°C
Storage temperature range:	-20 to 65°C
Size:	94 (W) X 102 (D) X 36 (H) mm
Weight:	about 170g

- *8:** Charging can take more than 2.5 hours when temperatures are either especially high or low.

General

Display unit:	LCD graphic display, 192 dots X 80 dots
CX-52:	1 LCD graphic display on each face with illuminator
CX-55:	1 LCD graphic display with illuminator
Operation panel (keyboard):	25 keys (soft function, operations, power on, light) with illuminator
Auto power-off:	5 levels (selectable)
Laser-pointer function:	Provided On/Off (selectable)
Sensitivity of levels:	
Circular level:	10'2 mm
Electronic Circular levels:	
Graphic display range	6' (inner circle)
Digital display range	±6' 30"
Optical plummet:	
Image:	Erect
Magnification:	3X
Minimum focus:	0.3 m
Operating temperature (no condensation):	-20 to 60 °C (-4 to 140 °F) ^{*9}
Storage temperature range (no condensation):	-30 to 70 °C (-22 to 158 °F)
Dust and water resistance:	IP66 (IEC 60529: 2001)
Instrument height:	192.5 mm from tribrach mounting surface 236 mm +5/-3mm from tribrach bottom
Size (with handle):	CX-52: 177 (W) X 181 (D) X 348 (H) mm CX-55: 177 (W) X 174 (D) X 348 (H) mm
Weight (with handle and battery):	5.4kg (11.9 lb)

- *9:** No direct sunlight for using high temperatures of 50 to 60 °C (122 to 140 °F) .

36. EXPLANATION

36.1 Manually Indexing the Vertical Circle by Face 1, Face 2 Measurement

The 0 index of the vertical circle of your CX is almost 100% accurate, but when it is necessary to perform particularly high precision angle measurements, you can eliminate any inaccuracy of the 0 index as follows.




- If the power is cut off, the vertical circle indexing is ineffective. Do it again every time the power is turned on.

PROCEDURE Manually indexing the vertical circle


1. Select "Obs. condition" in Config mode. Set "V manual" (vertical circle indexing method) to "Yes".

2. Press **[OBS]** on the status screen. The electric circular level is displayed in the screen.

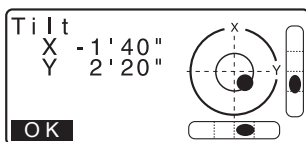


3. Carefully level the instrument and press **[OK]**.

The vertical angle V1 is displayed under "Take F1."

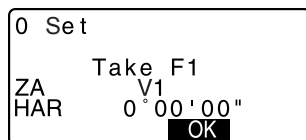

4. Accurately sight a clear target with a distance of about 30m in the horizontal direction with the telescope in face 1. Press **[OK]**. The vertical angle V2 is displayed under "Take F2."

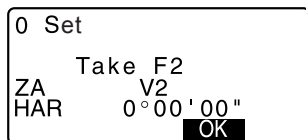

5. Turn the upper part through 180° and clamp it. Then set the telescope in the face 2 position and accurately sight the same target.

Press **[OK]**.

The vertical and horizontal angles are displayed.

This concludes the vertical circle indexing procedure.

36.2 Correction for refraction and earth curvature

The instrument measures distance, taking into account correction for refraction and earth curvature.

Distance Calculation Formula

Distance Calculation Formula; with correction for refraction and earth curvature taken into account. Follow the Formula below for converting horizontal and vertical distances.

Horizontal distance $D = AC(\alpha)$

Vertical distance $Z = BC(\alpha)$

$D = L\{\cos\alpha - (2\theta - \gamma) \sin\alpha\}$

$Z = L\{\sin\alpha + (\theta - \gamma) \cos\alpha\}$

$\theta = L \cdot \cos\alpha / 2R$: Earth curvature correcting item


$g = K \cdot L \cos\alpha / 2R$: Atmospheric refraction correcting item


$K = 0.142$ or 0.2 : Coefficient of refraction

$R = 6371\text{km}$: Radius of earth

a : Altitude angle

L : Slope distance

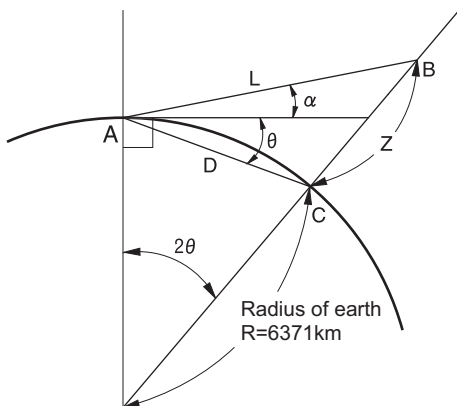



 Changing "K (Coefficient of refraction)" value : "31.1 Configuration - Config Mode-"

37. REGULATIONS



Region/ Country	Directives/ Regulations	Labels/Declarations
U.S.A.	FCC-Class A	<p>FCC Compliance</p> <p>WARNING: Changes or modifications to this unit not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.</p> <p>NOTE: This equipment has been tested and found to comply with the limits for a Class A digital device pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.</p>
California, U.S.A.	Proposition 65	<p>WARNING : Handling the cord on this product or cords associated with accessories sold with this product, will expose you to lead, a chemical known to the State of California to cause birth defects or other reproductive harm. <i>Wash hands after handling.</i></p>
California, U.S.A.	Perchlorate Material (CR Lithium Battery)	<p>This product contains a CR Lithium Battery which contains Perchlorate Material-special handling may apply. See http://www.dtsc.ca.gov/hazardouswaste/perchlorate/ Note ; This is applicable to California, U.S.A. only</p>

37. REGULATIONS

Region/ Country	Directives/ Regulations	Labels/Declarations
California and NY, U.S.A.	Recycling Batteries	<p style="text-align: center;"><u>DON'T THROW AWAY RECHARGEABLE BATTERIES, RECYCLE THEM.</u></p> <p style="text-align: center;"><u>Topcon Positioning Systems Inc., United States Return Process for Used Rechargeable Nickel Metal Hydride, Nickel Cadmium, Small Sealed Lead Acid, and Lithium Ion, Batteries</u></p> <p>In the United States Topcon Positioning Systems Inc., has established a process by which Topcon customers may return used rechargeable Nickel Metal Hydride(Ni-MH), Nickel Cadmium(Ni-Cd), Small Sealed Lead Acid(Pb), and Lithium Ion(Li-ion) batteries to Topcon for proper recycling and disposal. Only Topcon batteries will be accepted in this process.</p> <p>Proper shipping requires that batteries or battery packs must be intact and show no signs of leaking. The metal terminals on the individual batteries must be covered with tape to prevent short circuiting and heat buildup or batteries can be placed in individual plastic bag. Battery packs should not be disassembled prior to return.</p> <p>Topcon customers are responsible for complying with all federal, state, and local regulations pertaining to packing, labeling, and shipping of batteries. Packages must include a completed return address, be prepaid by the shipper, and travel by surface mode. <u>Under no circumstance should used/recyclable batteries be shipped by air.</u></p> <p>Failure to comply with the above requirements will result in the rejection of the package at the shipper's expense.</p> <p>Please remit packages to: Topcon Positioning Systems, Inc. C/O Battery Return Dept, 150 7400 National Dr. Livermore, CA 94551</p> <p style="text-align: center;"><u>DON'T THROW AWAY RECHARGEABLE BATTERIES, RECYCLE THEM.</u></p>
Canada	ICES-Class A	<p>This Class A digital apparatus meets all requirements of Canadian Interference-Causing Equipment Regulations. Cet appareil numérique de la Class A respecte toutes les exigences du Règlement sur le matériel brouilleur du Canada.</p> <p>This class A digital apparatus complies with Canadian ICES-003. Cet appareil numérique de la classe A est conforme à la norme NMB-003 du Canada.</p>

Region/ Country	Directives/ Regulations	Labels/Declarations
Europe	EMC-Class B	<p>EMC NOTICE In industrial locations or in proximity to industrial power installations, this instrument might be affected by electromagnetic noise. Under such conditions, please test the instrument performance before use.</p> <p>This product complies with the electromagnetic environmental testing of industrial locations.</p> <p>Model: CX series</p> <p>Manufacturer Name: TOPCON CORPORATION Address: 75-1, Hasunuma-cho, Itabashi-ku, Tokyo, 174-8580 JAPAN</p> <p>Europe Representative Name: Topcon Europe Positioning B.V. Representative Director: Jim Paetz Address: Essebaan 11, 2908 LJ Capelle a/d IJssel, The Netherlands</p> 
EU	WEEE Directive	<div style="border: 1px solid black; padding: 10px;">  <p>WEEE Directive This symbol is applicable to EU members states only.</p> <p>Following information is only for EU-member states: The use of the symbol indicates that this product may not be treated as household waste. By ensuring this product is disposed of correctly, you will help prevent potential negative consequences for the environment and human health, which could otherwise be caused by inappropriate waste handling of this product. For more detailed information about the take-back and recycling of this product, please contact your supplier where you purchased the product or consult.</p> </div>

37. REGULATIONS

Region/ Country	Directives/ Regulations	Labels/Declarations																																																							
EU	EU Battery Directive	<div style="border: 1px solid black; padding: 5px;">  <p>EU Battery Directive This symbol is applicable to EU members states only.</p> <p>Battery users must not dispose of batteries as unsorted general waste, but treat properly.</p> <p>If a chemical symbol is printed beneath the symbol shown above, this chemical symbol means that the battery or accumulator contains a heavy metal at a certain concentration. This will be indicated as follows: Hg: mercury(0.0005%), Cd: cadmium(0.002%), Pb: lead(0.004%)</p> <p>These ingredients may cause serious hazardous for human and the global environment.</p> </div> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> <p>This product contains a coin cell. You cannot replace batteries by yourself. When you need to replace and/or dispose batteries, contact your local dealer.</p> </div>																																																							
China	Chinese Environmental Directive	<p style="text-align: center;">< 产品中有毒有害物质或元素的名称及含量 ></p> <table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <thead> <tr> <th rowspan="2">部件名称</th> <th colspan="6">有毒有害物质或元素</th> </tr> <tr> <th>铅 (Pb)</th> <th>汞 (Hg)</th> <th>镉 (Cd)</th> <th>六价铬 (Cr(VI))</th> <th>多溴联苯 (PBB)</th> <th>多溴二苯醚 (PBDE)</th> </tr> </thead> <tbody> <tr> <td>望远镜部位 (除了印制主板)</td> <td>×</td> <td>○</td> <td>×</td> <td>×</td> <td>○</td> <td>○</td> </tr> <tr> <td>主机托架部 (除了印制主板)</td> <td>×</td> <td>○</td> <td>×</td> <td>×</td> <td>○</td> <td>○</td> </tr> <tr> <td>主板部位</td> <td>×</td> <td>○</td> <td>×</td> <td>×</td> <td>○</td> <td>○</td> </tr> <tr> <td>显示器</td> <td>×</td> <td>○</td> <td>○</td> <td>○</td> <td>○</td> <td>○</td> </tr> <tr> <td>印制主板</td> <td>×</td> <td>○</td> <td>×</td> <td>×</td> <td>○</td> <td>○</td> </tr> <tr> <td>其他 (电源、充电器、盒子等)</td> <td>×</td> <td>○</td> <td>○</td> <td>○</td> <td>○</td> <td>○</td> </tr> </tbody> </table> <p>○: 表示该有毒有害物质在该部件所有均质材料中的含量均在电子信息产品中有毒有害物质的限量要求标准规定的限量要求 (SJ/T11363-2006)以下 ×: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出电子信息产品中有毒有害物质的限量要求标准规定的限量要求 (SJ/T11363-2006) This information is applicable for People's Republic of China only.</p> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;">  <p>环保使用年限标识是根据《电子信息产品污染控制管理办法》以及《电子信息产品污染控制标识要求》制定的。适用于中国境内销售的电子信息产品的标识。 只要按照安全及使用说明内容在正常使用电子信息产品情况下,从生产日期算起,在此期限内产品中含有的有毒有害物质不致发生外泄或突变,不致对环境造成严重污染或对人体、财产造成严重损害。 产品正常使用后,要废弃在环保使用年限内或者刚到年限的产品,请根据国家标准采取适当的方法进行处置。 另外,此期限不等于质量功能的保证期限。 The Mark and Information are applicable for People's Republic of China only.</p> </div>	部件名称	有毒有害物质或元素						铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴联苯 (PBB)	多溴二苯醚 (PBDE)	望远镜部位 (除了印制主板)	×	○	×	×	○	○	主机托架部 (除了印制主板)	×	○	×	×	○	○	主板部位	×	○	×	×	○	○	显示器	×	○	○	○	○	○	印制主板	×	○	×	×	○	○	其他 (电源、充电器、盒子等)	×	○	○	○	○	○
部件名称	有毒有害物质或元素																																																								
	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴联苯 (PBB)	多溴二苯醚 (PBDE)																																																			
望远镜部位 (除了印制主板)	×	○	×	×	○	○																																																			
主机托架部 (除了印制主板)	×	○	×	×	○	○																																																			
主板部位	×	○	×	×	○	○																																																			
显示器	×	○	○	○	○	○																																																			
印制主板	×	○	×	×	○	○																																																			
其他 (电源、充电器、盒子等)	×	○	○	○	○	○																																																			

TOPCON CORPORATION

75-1 Hasunuma-cho, Itabashi-ku, Tokyo 174-8580, Japan <http://www.topcon.co.jp>

Please see the attached address list or the following website for contact addresses.

GLOBAL GATEWAY <http://global.topcon.com/>

©2015 TOPCON CORPORATION
ALL RIGHTS RESERVED